BULLETIN | CI-PM-3-00

SERVICE | PAGING MODULATOR CARDS

BULLETIN NUMBER: REVISION: DATE:	SB-0011 A NOV 2004
PRODUCT DESCRIPTION:	PAGING MODULATOR CARD
DE REFERENCE / ECO:	ECO # 832
PRODUCTS EFFECTED:	Model Number Board Versions
	CI-PM-3-00 50029-07
SYMPTOMS:	Component failure could result in module failure, blown subrack fuse, or system failure.
CAUSE:	capacitor voltage under rated
SOLUTION:	Remove C40 (a 1.0 µf 16 V Tant) and/or replace with a 1.0 µf 35 V Tantalum Capacitor
PARTS REQUIRED:	If replacing C40: DE part number: 1055-5B105M35 CAP., SM, 1.0uF TANT., 20%,35V KEMET T491B105M035AS
RETURN REQUESTS:	To have affected product returned to Daniels Electronics for servicing (or replacement, etc), please contact the service department to obtain and RMA number and return shipping instructions at 1-800-664-4066
REVISION HISTORY:	Rev Date Description A 23/11/04 First Release

