|        | ПП |
|--------|----|
| [(6(0) | H  |

Classification:

Model: Adonis-C1 (Scanner Option)

Subject: Service Manual Correction

From: Technical Services Dept., GTS Division

☐ Troubleshooting

☐ Mechanical

□ Paper path

Other (

## Technical Bulletin

| Date: 05-Apr-00        |      | No.: RA283001 |        |                    |
|------------------------|------|---------------|--------|--------------------|
| Prepared by: K. Takagi |      |               |        | <sup>-</sup> akagi |
| ☐ Part info            | orma | tion          | Action | required           |

⊠ Service manual revision

☐ Retrofit information

**PAGE: 1/1** 

Please add the following SP mode in your Adonis-C1 Scanner Kit service manual, on page 4-2.

☐ Electrical

☐ Transmit/receive

SP mode No. 017 has been added so that the scanning margin can be adjusted. This was made available with the release of scanner controller firmware version 4.0.0.

| No  |          | Function   | Settings    |
|-----|----------|--|-------------|
| 017 | Trimming | Adjusts the scanning margins for both the main and | 0~5         |
|     |          | sub scan directions.                               | 1 mm / step |
|     |          | The larger the value, the wider the margin.        | 0           |

|   | l echnical Bulletin         |             |                            |              | PAGE: 1/1          |
|---|-----------------------------|-------------|----------------------------|--------------|--------------------|
| Model: Adonis-C1 (Scanner Option)                     |                             |             | Dat                        | e: 24-Jan-01 | No.: RA283005      |
| Subject: Scanner controller does not connect to a hub |                             |             | Prepared by: S. Tomoe      |              |                    |
| From: Technical                                       | Services Dept., GTS Divisio | n           |                            |              |                    |
| Classification:                                       | ☑ Troubleshooting           | ☐ Part info | ☐ Part information ☐ Actio |              | n required         |
|   | ☐ Mechanical                | ☐ Electric  | al                         | ☐ Servi      | ce manual revision |
|   | ☐ Paper path                | ☐ Transm    | it/rec                     | eive 🗌 Retro | fit information    |

Technical Bulletin

## **SYMPTOM**

Other (

)

The scanner controller may not connect with some types of hubs at 10 Mdps, depending on the particular hub and scanner NIB combination.

## **CAUSE**

The OSC5 oscillator on the scanner controller does not match the particular hub.

## **SOLUTION**

The OSC5 oscillator has been changed. The new controller is A8775311 (A8775310N).

**Note:** Initially, this was only a suffix change, however later we changed the part number to A8775311.