

| | | | |
|--|---|---|--|
| Model: Kir-C | | Date: 26-Oct-01 | No.: RB040017 |
| Subject: ROM History (Kir-C1 Printer Option PS2) | | Prepared by: M. Mano | |
| From: Technical Services Dept., GTS Division | | | |
| Classification: | <input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Other () | <input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive | <input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input checked="" type="checkbox"/> Retrofit information |

Firmware history for the Kir-C1 Printer Option PS2

| B4315280 | Version | C.SUM | Production |
|----------|---------|-------|---------------------|
| B | 1.01 | F384 | 1st Mass Prod. |
| C | 1.02 | AD6E | September Prod. '01 |
| D | 1.03 | CAF9 | October Prod. '01 |

| Symptoms Corrected | Suffix |
|---|--------|
| <i>The printer does not work when printing from the PS driver and Tray 1 has been set to a custom size in User Tools→ System Settings.</i> | D |
| <i>If the memory full condition occurs when printing from the PS driver with Rotate Collate, the image is printed out upside-down after the condition is cleared.</i> | D |
| <i>With PS 300dpi printing from a Mac application, the font comes out enlarged on the cover page.</i> | C |
| <i>Incorrect resolution values appear in the Get Info pull-down menu on Mac operating systems.</i> | C |
| <i>When printing from Dazel using the PS driver (SEF feed), a Load Tray error happens and the file cannot be printed out.</i> | C |
| <i>After printing out the PS Font List, a paper jam occurs while printing out the Configuration Page. Following this, the PS Font list cannot be printed out even after jam recovery.</i> | C |

Reissued: 04-Decv-01

| | | |
|--------------|-----------------|----------------|
| Model: Kir-C | Date: 26-Oct-01 | No.: RB040017a |
|--------------|-----------------|----------------|

RTB Correction

The items in bold italics have been corrected or added.

| | | | |
|--|--|---|--|
| Subject: ROM History (Kir-C1 Printer Option PS2) | | Prepared by: K. Ugaeri | |
| From: Technical Services Dept., GTS Division | | | |
| Classification: | <input type="checkbox"/> Troubleshooting | <input type="checkbox"/> Part information | <input type="checkbox"/> Action required |
| | <input type="checkbox"/> Mechanical | <input type="checkbox"/> Electrical | <input type="checkbox"/> Service manual revision |
| | <input type="checkbox"/> Paper path | <input type="checkbox"/> Transmit/receive | <input checked="" type="checkbox"/> Retrofit information |
| | <input type="checkbox"/> Other () | | |

Firmware history for the Kir-C1 Printer Option PS2.

| B4315280 | Version | C.SUM | Production |
|----------|-------------|-------------|----------------------------|
| B | 1.01 | F384 | 1st Mass Prod. |
| C | 1.02 | AD6E | No Production |
| D | 1.03 | CAF9 | September Prod. '01 |
| E | 1.04 | F31E | December Prod. '01 |

| Symptom Corrected | Suffix |
|---|----------|
| <p><i>When PS2 firmware ver.1.02 or 1.03 is used on the old Kir-C1 controllers ver.1.00/1.02/1.04, "processing" is displayed on the LCD panel and PS printing is not possible.</i></p> <p><i>*For the old Kir-C1 controller ver.1.00, 1.02 or 1.04, use this PS2 version (=1.04 suffix E), or version 1.01 (suffix B).</i></p> <p>- PS2 Firmware Version -</p> <p>- Controller Firmware - Ver.1.01 Ver.1.03 Ver.1.04</p> <p>Old Kir-C1 Controller Ver.1.00, 1.02 or 1.04 OK NG OK</p> <p>New Kir-C1 Controller Ver.Vd.1.00 NG OK OK</p> <p>Stella series Controller NG OK OK</p> | E |

Reissued: 04-Decv-01

| | | |
|--|-----------------|----------------|
| Model: Kir-C | Date: 26-Oct-01 | No.: RB040017a |
| The printer does not work when printing from the PS driver and Tray 1 has been set to a custom size with User Tools→ System Settings. | D | |
| If the memory full condition occurs when printing from the PS driver with Rotate Collate, the image is printed out upside-down after the condition is cleared. | D | |
| <i>The PS font list comes out reduced, and is printed out continuously until paper end. This symptom occurs with new Kir-C Controller firmware vd.1.00 (which incl. duplex function) and all Stella series controllers.</i> | C | |
| With PS 300dpi printing from a Mac application, the font comes out enlarged on the cover page. | C | |
| Incorrect resolution values appear in the Get Info pull-down menu on Mac operating systems. | C | |
| When printing from Dazel using the PS driver (SEF feed), a Load Tray error occurs and the file cannot be printed out. | C | |
| After printing out the PS Font List, a paper jam occurs while printing out the Configuration Page. Following this, the PS Font list cannot be printed out even after jam recovery. | C | |

| | | | |
|--|--|---|---|
| Model: Kir-C | | Date: 26-Dec-01 | No.: RB040021 |
| Subject: PS2 Option | | Prepared by: K. Ugaeri | |
| From: Technical Services Dept., GTS Division | | | |
| Classification: | <input checked="" type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Other () | <input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive | <input checked="" type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input checked="" type="checkbox"/> Retrofit information |

When the PS2 option is installed on the Kir-C1, the following problems occur with some combinations of the controller and PS2 firmware versions.

Symptoms

#1

When PS2 firmware ver.1.03 is used on the old Kir-C1 controllers ver.1.00/1.02/1.04, PS printing is not possible and “processing” is displayed on the LCD.

#2

When PS2 firmware ver.1.01 is used on the new Kir-C1 controllers ver.vd.1.00 for the duplex function, the PS font list (user program function) does not print correctly. The PS font list is reduced and printed in the upper left quadrant of the paper, and printing continues until paper runs out.

| | | PS2 Firmware Version | | |
|------------------------------------|---|----------------------|----------|----------|
| | | Ver.1.01 | Ver.1.03 | Ver.1.04 |
| Controller Firmware Version | Old Kir-C1 Controller Ver.1.00, 1.02, or 1.04 | OK | NG#1 | OK |
| | New Kir-C1 Controller Ver.Vd.1.00 | NG#2 | OK | OK |

Cause

PS2 firmware bug

Countermeasure

PS2 firmware is improved with ver.1.04.

Action required

For the old Kir-C1 controller ver.1.00/1.02/1.04, use PS2 version 1.04 (suffix E), or version 1.01 (suffix B).

For the new Kir-C1 controller ver. Vd.1.00, use PS2 version 1.03 (suffix D) or later.

Reissued: 1-May-02

| | | |
|--------------|-----------------|----------------|
| Model: Kir-C | Date: 26-Oct-01 | No.: RB040017b |
|--------------|-----------------|----------------|

RTB Correction

The items in bold italics have been corrected or added.

| | | | |
|--|---|---|--|
| Subject: ROM History (Kir-C1 Printer Option PS2) | | Prepared by: K. Miura | |
| From: Technical Services sec. Service Planning Dept. | | | |
| Classification: | <input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Other () | <input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive | <input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input checked="" type="checkbox"/> Retrofit information |

Firmware history for the Kir-C1 Printer Option PS2.

| B4315280 | Version | C.SUM | Production |
|-----------------|--------------------|--------------------|-----------------------------|
| B | 1.01 | F384 | 1st Mass Prod. |
| C | 1.02 | AD6E | No Production |
| D | 1.03 | CAF9 | September Prod. '01 |
| E | 1.04 | F31E | December Prod. '01 |
| <i>F</i> | <i>1.50</i> | <i>E0E7</i> | <i>May Prod. '02</i> |

| Symptom Corrected | Suffix |
|---|-----------------|
| <i>A PS error may be displayed when printing from Adobe InDesign Ver. 2.0.</i> | <i>F</i> |

Reissued: 14-May-02

| | | |
|--------------|-----------------|----------------|
| Model: Kir-C | Date: 26-Oct-01 | No.: RB040017c |
|--------------|-----------------|----------------|

RTB Correction

The items in bold italics have been corrected or added.

| | | | |
|--|---|---|--|
| Subject: ROM History (Kir-C1 Printer Option PS2) | | Prepared by: K. Miura | |
| From: Technical Services sec. Service Planning Dept. | | | |
| Classification: | <input type="checkbox"/> Troubleshooting <input type="checkbox"/> Mechanical <input type="checkbox"/> Paper path <input type="checkbox"/> Other () | <input type="checkbox"/> Part information <input type="checkbox"/> Electrical <input type="checkbox"/> Transmit/receive | <input type="checkbox"/> Action required <input type="checkbox"/> Service manual revision <input checked="" type="checkbox"/> Retrofit information |

Firmware history for the Kir-C1 Printer Option PS2.

| B4315280 | Version | C.SUM | Production |
|----------|---------|-------|---------------------|
| B | 1.01 | F384 | 1st Mass Prod. |
| C | 1.02 | AD6E | No Production |
| D | 1.03 | CAF9 | September Prod. '01 |
| E | 1.04 | F31E | December Prod.'01 |
| F | 1.50 | E0E7 | May Prod. '02 |

| | |
|---|-----------------|
| Symptom Corrected | Suffix |
| <i>The printer option now supports Mac OS X ver 10.1 (Native) and newer.</i> | <i>F</i> |

Reissued: 16-Jul-02

| | | |
|--------------|-----------------|----------------|
| Model: Kir-C | Date: 26-Oct-01 | No.: RB040017d |
|--------------|-----------------|----------------|

RTB Correction

The items in bold italics have been corrected or added.

| | | | |
|--|--|---|--|
| Subject: ROM History (Kir-C1 Printer Option PS2) | | Prepared by: M. Mano | |
| From: Technical Services sec. Service Planning Dept. | | | |
| Classification: | <input type="checkbox"/> Troubleshooting | <input type="checkbox"/> Part information | <input type="checkbox"/> Action required |
| | <input type="checkbox"/> Mechanical | <input type="checkbox"/> Electrical | <input type="checkbox"/> Service manual revision |
| | <input type="checkbox"/> Paper path | <input type="checkbox"/> Transmit/receive | <input checked="" type="checkbox"/> Retrofit information |
| | <input type="checkbox"/> Other () | | |
| | | | |

Firmware history for the Kir-C1 Printer Option PS2.

| B4315280 | Version | C.SUM | Production |
|-----------------|--------------------|--------------------|--------------------------------|
| B | 1.01 | F384 | 1st Mass Prod. |
| C | 1.02 | AD6E | No Production |
| D | 1.03 | CAF9 | September Prod. '01 |
| E | 1.04 | F31E | December Prod.'01 |
| F | 1.50 | E0E7 | May Prod. '02 |
| <i>G</i> | <i>1.60</i> | <i>46AC</i> | <i>August Prod. '02</i> |

| Symptom Corrected | Suffix |
|---|-----------------|
| <i>Display of the Euro currency symbol supported with PS drivers used in a UNIX environment.</i> | <i>G</i> |

Reissued: 9-Jan-03

| | | |
|--------------|-----------------|----------------|
| Model: Kir-C | Date: 26-Oct-01 | No.: RB040017e |
|--------------|-----------------|----------------|

RTB Correction

The items in bold italics have been corrected or added.

| | | | |
|--|--|----------------------|--|
| Subject: ROM History (Kir-C1 Printer Option PS2) | | Prepared by: M. Mano | |
| From: Technical Services Sec. Service Planning Dept. | | | |
| Classification: | <input type="checkbox"/> Troubleshooting <input type="checkbox"/> Part information <input type="checkbox"/> Action required | | |
| | <input type="checkbox"/> Mechanical <input type="checkbox"/> Electrical <input type="checkbox"/> Service manual revision | | |
| | <input type="checkbox"/> Paper path <input type="checkbox"/> Transmit/receive <input checked="" type="checkbox"/> Retrofit information | | |
| | <input type="checkbox"/> Other () | | |

We hereby inform you of the firmware history for the Kir-C1 Printer Option PS2.

| B4315280 | Version | C.SUM | Production |
|-----------------|--------------------|--------------------|---------------------------------|
| B | 1.01 | F384 | 1st Mass Prod. |
| C | 1.02 | AD6E | No Production |
| D | 1.03 | CAF9 | September Prod. '01 |
| E | 1.04 | F31E | December Prod. '01 |
| F | 1.50 | E0E7 | May Prod. '02 |
| G | 1.60 | 46AC | August Prod. '02 |
| <i>H</i> | <i>1.90</i> | <i>7614</i> | <i>January Prod. '03</i> |

| Symptom Corrected | Suffix | | | | | | | | | | | | | | | | | | | | |
|--|--------------------------|--------------------------|----------|--|-------------------------|----------|----------|----------|--|----|----|----|-----------------------------------|----|----|----|--------------------------|----|----|----|--|
| <i>Sometimes a PS file made in a UNIX environment cannot be printed.</i> | <i>H</i> | | | | | | | | | | | | | | | | | | | | |
| <i>The individual countermeasure for the BMW is applied to the mass production.</i> | <i>H</i> | | | | | | | | | | | | | | | | | | | | |
| Display of the Euro currency symbol supported with PS drivers used in a UNIX environment. | G | | | | | | | | | | | | | | | | | | | | |
| Printer option now supports Mac OS X ver 10.1 (Native) and newer. | F | | | | | | | | | | | | | | | | | | | | |
| PS error may be displayed when printing from Adobe InDesign Ver. 2.0. | F | | | | | | | | | | | | | | | | | | | | |
| When PS2 firmware ver.1.02 or 1.03 is used on the old Kir-C1 controllers ver.1.00/1.02/1.04, “processing” is displayed on the LCD panel and PS printing is not possible. *For the old Kir-C1 controller ver.1.00, 1.02 or 1.04, use this PS2 version (=1.04 suffix E), or version 1.01 (suffix B). | E | | | | | | | | | | | | | | | | | | | | |
| <table><tr><td></td><td colspan="3">- PS2 Firmware Version -</td></tr><tr><td>- Controller Firmware -</td><td>Ver.1.01</td><td>Ver.1.03</td><td>Ver.1.04</td></tr><tr><td>Old Kir-C1 Controller Ver.1.00, 1.02 or 1.04</td><td>OK</td><td>NG</td><td>OK</td></tr><tr><td>New Kir-C1 Controller Ver.Vd.1.00</td><td>NG</td><td>OK</td><td>OK</td></tr><tr><td>Stella series Controller</td><td>NG</td><td>OK</td><td>OK</td></tr></table> | | - PS2 Firmware Version - | | | - Controller Firmware - | Ver.1.01 | Ver.1.03 | Ver.1.04 | Old Kir-C1 Controller Ver.1.00, 1.02 or 1.04 | OK | NG | OK | New Kir-C1 Controller Ver.Vd.1.00 | NG | OK | OK | Stella series Controller | NG | OK | OK | |
| | - PS2 Firmware Version - | | | | | | | | | | | | | | | | | | | | |
| - Controller Firmware - | Ver.1.01 | Ver.1.03 | Ver.1.04 | | | | | | | | | | | | | | | | | | |
| Old Kir-C1 Controller Ver.1.00, 1.02 or 1.04 | OK | NG | OK | | | | | | | | | | | | | | | | | | |
| New Kir-C1 Controller Ver.Vd.1.00 | NG | OK | OK | | | | | | | | | | | | | | | | | | |
| Stella series Controller | NG | OK | OK | | | | | | | | | | | | | | | | | | |
| The printer does not work when printing from the PS driver and Tray 1 has been set as to a custom size in User Tools→ System Settings. | D | | | | | | | | | | | | | | | | | | | | |
| If the memory full condition occurs when printing from the PS driver with Rotate Collate, the image is printed out upside-down after the condition is cleared. | D | | | | | | | | | | | | | | | | | | | | |

Reissued: 9-Jan-03

| | | |
|--------------|-----------------|----------------|
| Model: Kir-C | Date: 26-Oct-01 | No.: RB040017e |
|--------------|-----------------|----------------|

| Symptom Corrected | Suffix |
|--|--------|
| The PS font list comes out reduced, and is printed out continuously until paper end. This symptom occurs with new Kir-C Controller firmware vd.1.00 (which incl. duplex function) and all Stella series controllers. | C |
| With PS 300dpi printing from a Mac application, the font comes out enlarged on the cover page. | C |
| Incorrect resolution values appear in the Get Info pull-down menu on Mac operating systems. | C |
| When printing from Dazel using the PS driver (SEF feed), a Load Tray error happens and the file cannot be printed out. | C |
| After printing out the PS Font List, a paper jam occurs while printing out the Configuration Page. Following this, the PS Font list cannot be printed out even after jam recovery. | C |