

Reissued: 31-May-99

Model: NAD 30S/30/40 Scanner Option	Date: 2-Mar-99	No.: RA695001a
-------------------------------------	----------------	----------------

RTB Correction

The items in bold italics have been corrected or added.

Subject: Service preparation for NAD scanner option		Prepared by: S. Tomoe	
From: GTSS Field Information Dept.			
Classification:	<input type="checkbox"/> Troubleshooting	<input type="checkbox"/> Part information	<input type="checkbox"/> Action required
	<input type="checkbox"/> Mechanical	<input type="checkbox"/> Electrical	<input type="checkbox"/> Service manual revision
	<input type="checkbox"/> Paper path	<input type="checkbox"/> Transmit/receive	<input type="checkbox"/> Retrofit information
	<input checked="" type="checkbox"/> Other ()		

The Scanner Kit that is a new option for NAD30/40 series will be launched from April 1999. Before launching this option, a new SIB board (called "Scanner Control Board" in the parts catalog, #18, page 19) is required.

This is because the SIB board in the NAD machines produced before November 1998 (***RAI production***) and ***June 1999 (RPL production)*** does not support the scanner functions.

1. SIB board information

There are 3 versions of the SIB board.

Version	NAD30S/NAD30	NAD40	Production
1	A2331843C	A2321831C	Before November 1998
2	A2331843D	A2321831D	From November 1998
3	A6955330	A6955340	Future (1 or 2 months later)

Relationship between SIB and machine configuration is as follows.

Parts Version	C	C+F, C+P	C+F+P	C+S, C+F+S, C+P+S, All
1	O	O	O	X
2	O	O	O	O
3	O	O	O	O

O: Available, X: Not available, C: Copier, F: Fax, P: Printer, S: Scanner

All the above parts can be used in machines without the scanner option. However, for machines with the scanner option, ver.2 and 3 must be used.

As shown in the above table, ver.1 and 2 have the same part number and the SPC cannot control parts that have different suffixes. So, we recommend that you use version 3 parts when installing the scanner.

Our SPC has already stocked the version 3 parts which can be ordered from our SPC at any time. In the near future (1 or 2 months later), the part number for the SIB will change to version 3. At that time, an MB will be issued.

Reissued: 31-May-99

Model: NAD 30S/30/40 Scanner Option

Date: 2-Mar-99

No.: RA695001a

2. Expenses

Our sales section will let you know regarding the claim fees from customers for replacing the SIB board, and the parts cost. Please contact your sales section for more details.

RAI (China) Production

Model Name	Version	Serial Number	
Ricoh	AF350	A7698910001	
Gestetner	3235S D435S 2835S	AQ18910001	
Infotec	4351MF	3Q18910001	
Gestetner	3235 D435 2835	AQ38910001	
Infotec	4352MF	3Q29180001	
Ricoh	AF450	A7708910001	
Gestetner	3245 D445 2845	AQ58910001	
Infotec	4451MF	AQ39180001	

RPL (UK) Production

Model Name	Version	Serial Number	
Ricoh	AF350	A7698910001	
Gestetner	3235S D435S 2835S	AQ18910001	
Infotec	4351MF	3Q18910001	
Gestetner	3235 D435 2835	AQ38910001	
Infotec	4352MF	3Q29180001	
Ricoh	AF450	A7708910001	
Gestetner	3245 D445 2845	AQ58910001	
Infotec	4451MF	AQ39180001	