# Important: Since V2.00SP2 the default windows password is "894129"!

For downgrade to versions < V2.00 see separat chapter in this release notes!



Test and Measurement Division

#### **Release Notes**

## Firmware Release V2.00SP3 for R&S FSL Spectrum Analyzers

with order number: 1300.2502.xx

#### Features of V2.00/V2.00SP1-3:

- Support of unregistered licenses
- Support of command SYST:KLOC to allow local locout also via VXI-11 interface.
- Support of command MMEM:CAT:LONG? to read out long format of file structure.
- FSL-B5: Video Out Legacy support
- Possibility of running the instrument without administrator rights (requires new XP image as well, see chapter "Operation with and without administrator rights")
- Support of "Open Start Menu" soft key to access the Windows Start Menu
- FSL-K9: Support of R&S NRP-Z56 and NRP-Z57
- FSL-K93: Enhanced DL-MAP auto demodulation. This includes automatic detection of the IDcell
- FSL-K93: Physical Layer auto demodulation for a single UL burst
- FSL-K93: Preamble Channel Frequency Response measurement results also available for WiBro
- FSL-K93: Frame Length measurement available in the Capture Memory Window
- FSL-K93: EVM Data & Pilots measurement available in Constellation Window
- FSL-K93: Support of ETSI EN 302 544-1 Spectrum Emission Mask measurement for Bandwidth 5 MHz and 10 MHz
- FSL-K93: Support of estimated and predefined burst boosting

Release Note Revision:

Printed in the Federal Republic of Germany

### **Contents**

History	3
General Topics	3
Prerequisite for Firmware Update	3
Firmware Update	3
Copying the installation files to the instrument	
Performing the firmware update on the instrument  Operation with and without Administrator Rights	
Downgrade to a version < 2.00	
Firmware installation of the R&S FSL-K7 analog demodulator, R&S FSL-K8 BLUETOO Analyzer software, R&S FSL-K9 power sensor measurement and R&S FSL-K14 spectro measurement	TH ogram
Firmware installation of the R&S FSL-K20/K72/K82/K84/K91/K91n/ K92/K93/LxiClassC	6
Compatibility of R&S FSL-K20/K30/K72/K82/K91/K91n/K92/K93  Enabling options via option key code entry	
New Functions	7
Modified Functions	8
Improvements in V2.00SP3	9
Improvements in V2.00SP1/SP2	9
Improvements in V2.00	10
Known Issues	11
Modifications to the Documentation	12
Last minute changes to the operating manual	
Local Lockout via VXI-11 possible	
MMEMory:CATalog:LONG? <path>SYSTem:SHUTdown</path>	
FSL-B5: Video Out Legacy support	
FSL-K30: The SCPI command 'STATus:QUEStionable:CORRection' has been modified	t13
FSL-K30: Single Frequency measurement	
New soft key for opening windows start menu  Remote Commands for FSL-K93 V2.01 extensions	14
Appendix: Installation troubleshooting	
Appendix: Contact to our hotline	20

### **History**

Date	Rel Note Rev	Changes
27. April. 2012	1	First revision for V2.00SP3

## **General Topics**

#### **Prerequisite for Firmware Update**

Attention: In order to ensure a correct firmware update a minimum version 2.03 of the FSL XP Image is required.

The XP image version is shown during start-up. When the R&S FSL splash screen appears the "XP Image Version" is shown in the top left corner. The minimum required XP image version is 2.03. (The information is also available in the registry, use regedit HKEY\_LOCAL\_MACHINE/Software/Image/MajorVersion and /MinorVersion. The decimal values in brackets are the valid ones. MajorVersion (2) and MinorVersion (1) means 2.01)

If the XP image version is 2.01 the "XP Image Update 2.03 for FSL" or newer is required to install before proceeding any further firmware installations. The "XP Image Update for FSL" with its own release notes can be downloaded from the R&S internet in the FSL download section. Please install the XP image update according to its release notes.

Without the minimum XP image version 2.03, the firmware update will complete without any effect and the firmware version will remain unchanged (Setup | More | System Info | Versions+Options: Table entry Instrument shows the old firmware version number)

#### **Firmware Update**

If the XP Image Update fulfils the prerequisite (see chapter above) the firmware update can be carried out.

The firmware update set of the R&S FSL consists of one package file (with the extension .package) and the following installation files (with the extension .msi):

The \* is the placeholder for a detailed version information of that file.

#### Copying the installation files to the instrument

To install a new firmware version the installation files of the new version have to be copied to the instrument. This can be done in several ways:

Using a memory stick:

- Copy all files to a directory of the memory stick (the default path is D:\FW\_UPDATE).
- Insert the memory stick into one of the USB sockets at the front panel of the R&S FSL.

Using the remote desktop and copying the installation files to a directory of the instrument:

- Connect the R&S FSL to your LAN.
- > Start the remote desktop on your PC (C:\winnt\system32\mstsc.exe).
- ➤ Enter the TCP/IP address of the instrument, you want to update. Ensure that the **local** resources→drives option is selected and press the Connect button.
- ➤ Login to the instrument (user name and password are by default "894129". In former firmware version the password may be "123456" or "instrument").
- ➤ To get the TCP/IP address of the instrument, in the Start menu, select Settings → Network Connections → Local Area Connection (2) → Properties, select Internet protocol (TCP/IP) and press the Properties button.
  - An edit dialog box with the **IP address** field is displayed. The IP address consists of 4 numbers between 0 and 255.
- After the login, create an own directory and copy all installation files from your PC to the instrument using the explorer at the instrument (the drives of your PC are listed in the folder window of the explorer as well as the local drives of the instrument).

#### Performing the firmware update on the instrument

The firmware update process is performed in the following steps:

- > Switch the instrument on and wait until the Analyzer has resumed operation, ensure to be logged on to windows with administrator privileges. The "Instrument" account has these rights and can be used for carrying out the update.
- Press the SETUP hard key, go to the side menu using the More softkey, and press the two softkeys Firmware Update one after the other.
  - A dialog box is displayed. If necessary, change the default path to locate the installation files (enter the path name using an external keyboard or the keypad at the front panel of the instrument or use the **Browse** button).
- Press the Execute button to start the update.
  The instrument firmware is shutting down and a dialog box is displayed. By default all the installation packages for the basic analyzer firmware available at the path you entered are selected.
- ➤ Firmware applications (e.g. FSL-K20) appear at the end of the list and can be selected with the 🗹 key.
- > Press the **Install** button.
  - The installation is running. After a few minutes the system will restart automatically. After the restart the firmware installation is complete.
- After the firmware update the UNCAL flag appears. A self alignment is necessary. Press the **SETUP** hard key, **Alignment** and the **Self Alignment** to start the alignment procedure.
- Depending on the previous firmware version a reconfiguration of the hardware may be required during the first start of the firmware. In this case the following message box will be displayed:
  - "Start automatically reload of PCI FPGA ..."

The update will be performed automatically.

Afterwards, a message box with the following text will be displayed:

"Finished automatically reload of PCI FPGA. Reboot the device!"

Now, please turn off the instrument at the rear panel.

If you have an instrument with options FSL-B30 (DC power supply) and FSL-B31 (battery pack), please switch off the instrument at the front panel too. Wait until the instrument is completely switched off. After a few seconds, you can restart the instrument.

For problems with firmware installation see the chapter "Appendix: Installation troubleshooting" at the end of this document.

#### **Operation with and without Administrator Rights**

With firmware version V2.00 (image version 3.11) and higher, the analyzer may be operated with or without administrator rights. Some administrative tasks (e.g. a firmware update or a LXI functions or network configuration) do require administrator rights.

In the default configuration, auto login is enabled, and the "Instrument" account with administrator rights is active. This means that no password is required, and the full functionality of the analyzer is available. An additional user account (user name "NormalUser" with default password "894129" or "123456" with former firmware versions) is predefined. Use standard Windows functionality if you wish to deactivate the auto login mechanism and activate the NormalUser account.

An update from a firmware version <V2.00 to version V2.00 or higher does not replace the XP-image. Meaning only a firmware update will not offer the functionality to the "NormalUser". To replace the image version, contact your R&S service representative. Prerequisite is a front module controller LPC8 which can be recognized with the Bios version V6.0.xx.yy.

#### Note:

The FSL 1300.2502.14 will not support the operation without administrator rights.

#### Downgrade to a version < 2.00

A downgrade of the firmware from V2.00 or greater to version <V2.00 requires the following process:

- Ensure to be logged in with administrator rights (user "Instrument")
- > Exit the firmware with ALT-F4
- Select Windows Start Menu -> Programs -> Accessories -> Backgrade to start the back grade preparation in the registry. Accept the message box to allow that registry settings to be performed.
- Perform the firmware installation of the firmware with version < V2.00 using the Instrument Update Tool under Windows Start Menu -> Programs -> Accessories -> FSLUpdateTool

## Firmware installation of the R&S FSL-K7 analog demodulator, R&S FSL-K8 BLUETOOTH Analyzer software, R&S FSL-K9 power sensor measurement and R&S FSL-K14 spectrogram measurement

The R&S FSL-K7, R&S FSL-K8, R&S FSL-K9 and R&S FSL-K14 application software packages are included in the basic instrument firmware. Therefore they do not need a separate firmware update procedure.

## Firmware installation of the R&S FSL-K20/K72/K82/K84/K91/K91n/K92/K93/LxiClassC

As mentioned in the firmware update description above, these applications have their own installation file and are therefore added to the selection list. Simply check it with the  $\square$  key if their installation is requested.

#### Note:

Since version 1.90 there is a different LXI package in the installation. The old LXI package will be disabled by a red cross by default. The new one can be selected with the  $\square$  key if required.

#### Note:

The functionality of the FSL-K91n is integrated within the K91 and the functionality of the FSL-K93 is integrated within the K92 msi file and they are activated by their own key codes.

#### Compatibility of R&S FSL-K20/K30/K72/K82/K91/K91n/K92/K93

The compatibility of these firmware options is checked with the installation tool. If a non compatible version of the basic instrument firmware is installed the options will be deleted.

R&S FSL V2.00SP3 is compatible to the following firmware option releases:

	&S	R&S	R&S	R&S	R&S	R&S FSL-	R&S FSL-
	-K20	FSL-K30	FSL-K72	FSL-K82	FSL-K84	K91/K91n	K92/K93
2.00	SP2	2.00SP1	2.00	2.00	2.00	2.00SP2	2.01SP1

#### **Enabling options via option key code entry**

This section can be skipped if the option key was entered once.

For activation of application software packages a license key for validation must be entered. The license key is in the device certificate or delivered as a part of the software package. The process is performed in the following steps:

- Press the SETUP hard key, go to the side menu using the More softkey, and press the Option Licenses softkey and then the Install Option softkey.
  A dialog box is displayed.
- Enter the option key number using the keypad.
- Press ENTER.

On a successful validation the message **option key valid** is displayed. If the validation failed, the option software is not installed.

#### **New Functions**

The version numbers indicate the version in which the new function was introduced:

Version	Function
V2.00SP2	Support of unregistered licenses and the R&S device ID is shown for that reason in the
	Version + Option dialog. In addition installation of option by an XML file is supported.
V2.00SP2	Support of command SYST:KLOC to allow local locout also via VXI-11 interface.
V2.00SP2	Support of command MMEM:CAT:LONG? to read out long format of file structure.
V2.00SP2	Support of command SYSTem:SHUTdown to shut down the firmware and the Windows
	System on the instrument.
V2.00SP2	FSL-B5: Video Out Legacy support: Allows to change the behaviour of FSLs with mother board
	2112.1800 back to the bahaviour of the previous mother board 1300.3080.
V2.00SP1	FSL-K30: Single Frequency Measurement
V2.00	Possibility of running the instrument without administrator rights (requires new XP image as
	well, see chapter "Operation with and without administrator rights")
V2.00	Support of "Open Start Menu" soft key to access the Windows Start Menu
V2.00	FSL-K9: Support of R&S NRP-Z56 and NRP-Z57
V2.01	FSL-K93: Enhanced DL-MAP auto demodulation. This includes automatic detection of the
	IDcell
V2.01	FSL-K93: Physical Layer auto demodulation for a single UL burst
V2.01	FSL-K93: Preamble Channel Frequency Response measurement results also available for
	WiBro
V2.01	FSL-K93: Frame Length measurement available in the Capture Memory window
V2.01	FSL-K93: EVM Data & Pilots measurement available in the Constellation Window

#### R&S FSL

Version	Function
V2.01	FSL-K93: Support of ETSI EN 302 544-1 Spectrum Emission Mask measurement for
	Bandwidth 5 MHz and 10 MHz
V2.01	FSL-K93: Support of estimated and predefined burst boosting
V2.01	FSL-K93: Frame Length measurement available in the Capture Memory measurement window
V2.00SP1	FSL-K91: FFT offset can now be specified

## **Modified Functions**

The version number indicate the version in which the modification was carried out.

Version	Function
V2.00SP3	Modified synthesizer setup tables.
V2.00SP2	For some frequencies the marker signal count reading on the display is had too many digits. It is now limited to the accuracy of 1Hz.
V2.00SP2	The "instrument" account password was changed from "123456" to "894129" for security reasons.
V2.00SP2	FSL-K20 (CATV): The calculation of the noise floor correction for the C/N quiet line measurement has been improved.
V2.00SP1	FSL-K30: the SCPI command 'STATus:QUEStionable:CORRection' has been modified to provide information about missing LOSS or ENR values.
V2.00SP2	FSL-K91: Peak Vector Error measurement results can be configured for 802.11b and G measurements to be measured across all symbols or the PSDU only.
V2.00SP1	Default shutdown changed from "Off" to "Standby".
V2.00	The auto run function for USB memory sticks or other USB mass memory devices is disabled.
V2.00	The remote command TRACe: COPY worked different in comparison with the R&S FSP and the manual description of the FSL:
	The first operand is the destination of the data to be copied, the second operand describes the source.
	The command TRAC: COPY TRACE1, TRACE2 copies the TRACE2 to TRACE1.
V2.00	Modified synthesizer setup tables for FSL18.
V2.00	FSL-K8: EDR Carrier Frequency Stability and Modulation Accuracy: The calculation of the initial frequency error has been adjusted - the transition bits of the GFSK header are no longer evaluated.
V2.00	FSL-K20 (CATV): Signal level offset now works as reference level offset in spectrum analyzer mode. Up to now, only the grid position was adjusted, but from now on the measurement results are affected, too.

## Improvements in V2.00SP3

The version number indicate the version in which the issue was observed for the first time.

Version	Function
V2.00SP3	FSL20: Level reading corrected in zero span at 15.8 GHz.
V2.00SP3	Restarting of FSL after 4s emergency shut down from the front on/off key corrected.

## Improvements in V2.00SP1/SP2

The version number indicate the version in which the issue was observed for the first time.

Version	Function
V2.00	Backgrade process from version >= 2.00 to a version <2.00 lead to a wrong path setting for
	save sets and print outs. Also the FSL-K92/K93 could not measure due to this reason.
	Upgrade to this new version and then downgrade will solve the problem.
V1.80	Harmonic distortion measurement: Improved THD calculation.
V2.00	FSL-K20 (CATV): Analog and digital spectrum measurements. When switching the trace view
	mode, sometimes an additional sweep with clear/write mode was executed. This issue is
	solved.
V2.00	FSL-K20 (CATV): When switching the unit within the tables of C/N, CTB, CSO, the
	measurements could stop sweeping, This issue is solved.
V1.90	FSL-K20 (CATV): If once the softkey "RF = Mkr Freq" was unavailable, it stayed unavailable
	always. This issue is solved.
V2.00	FSL-K30: The LOSS and ENR tables were slow to fill through SCPI commands. This issue is
	solved.
V2.00	FSL-K30: For Fixed LO measurements frequencies in the LOSS Out table were incorrectly
	checked against RF Frequencies. This issue is solved.
V2.00	FSL-K30: The calibrated status was sometimes incorrectly restored after recalling a saved file
	from outside K30. This issue is solved.
V2.00	FSL-K91: Updates to ensure the receive filter is correctly used when processing 802.11b & g
	results
V2.00	FSL-K91 & FSL-K93: Updates to ensure gating works in the SEM measurement for all SEM
	xml file settings.
V2.01	FSL-K93: Help pages were not available. This problem is solved.
V1.70	C/No measurement: the result display was truncated, so the leading digit for values from
1/2 22	100 dBc/Hz onwards was not displayed correctly. This issue is solved.
V2.00	With an active transducer factor in the unit dBµA an offset was added to the reference level
1/4 70	after change. This issue is solved.
V1.70	Marker Peak List: In case of totally identically peak level values in a measurement only one
1/4 00	was entered in the peak list. This issue is solved.
V1.90	Switch on sequence for preamplifier improved.
V2.00	SEM measurement: The remote command : CALC: LIM1: FAIL? for query the limit line results
1/0.00	returned always 0. This issue is solved.
V2.00	FSL-K14: The spectrogram with detector RMS or Average and sweep points > 501 just
1/0.00	showed one color. This issue is solved.
V2.00	FSL-K20: A recall from the base instrument to the K20 sometimes did not work if the "Recall
1/0.00	File" button was used. The "Enter" key always worked.
V2.00	FSL-K20: In the CSO Off Service mesasurement, the marker was not always automatically
1/0.00	positioned to the peak value of the curve.
V2.00	FSL-K20: C/N measurement: after switching to an analog standard with a noise reference
	band width not equal to the default of 5 MHz, the first channel was sometimes measured with
	the default reference band width. This issue is solved.

## Improvements in V2.00

The version number indicate the version in which the issue was observed for the first time.

Version	Function
V2.00	Via Remote: The query of the filter type with BAND: RES: TYPE? did not return the FFT state
	correctly. This problem is solved.
V2.00	With relative grid, the trace could be displayed wrong after rebooting the firmware unless the reference level was changed. This problem is solved.
V1.91	Tracking generator: After calibration, normalization and using the reference value position the reference line was not centered although the position value was 50%. This problem is solved.
V1.80	A big negative reference level offset could lead to clipped noise in the trace. This problem is solved.
V1.80	For FSL with mother board 1300.3080 and firmware version between 1.80 and 1.91:
	The FSL-B5 IF output had a level drop of 6 dB. This problem is solved.
V1.91	FSL-K20:
	Several problems after warm boot were fixed. Depending of the saved settings for the warm
	boot:
	- RF step size could be zero
	- In the Modulation Standard Options dialog analog and digital standards could be mixed up
	- Automatic adaption of the symbol rate to the selected constellation did not work
V1.91	FSL-K20:
	Sometimes the external reference was not switched on correctly after a recall

Improvements of previous versions:

Version	Function			
V1.90	Problem concerning the minimum tracking generator output level which depends on the			
	frontend variant solved, was always -20 dBm.			
	frontend variant min. tracking generator output level			
	1300.3609.04 - 20 dBm			
	1300.3609.06 - 50 dBm			
V1.81	With marker signal count on a spike could occur in the trace after the marker position. This problem is solved.			
V1.81	In Fast ACP Mode the marker x-axis unit was wrong. This problem is solved.			
V1.80	Trace ASCII export: Although the unit was set to dBµV the numeric values showed dBm values. This problem is solved.			
V1.81	For R&S FSL devices with mother board 2112.1800 the IF power trigger hysteresis and hold off did not work correctly. This problem is solved.			
V1.81	The marker auto max peak function could be switched off after changing frequency parameters. This problem is solved.			
V1.81	FSL-K8: EDR Modulation Accuracy: In continuous sweep mode the values in the table did not update. This problem is solved.			
V1.81	FSL-K20: In Spectrum mode, the markers in the display were shown wrong, if the user multiply switched a marker from normal to delta and vice versa.			
V1.90	FSL-K82: Channel Select in the CDP or CDEP measurement: In bit reverse mode, the descending channel selection problem is solved.			
V1.90	FSL-K91/91n: With 802.11b signals with short preamble the bit stream result would not be displayed. This problem is solved			
V1.90	FSL-K91/91n: Trigger hysteresis and trigger hold off settings in the spectrum analyzer would affect power trigger operation in WLAN option. This problem is solved			

## **Known Issues**

The version number indicate the version in which the issue was observed for the first time.

Version	Function
V2.00	Downgrade from a firmware version > V2.00 to a firmware version < V2.00 will not work. The firmware does not start. This is normal because of the change for the user without administrator rights. See chapter "Downgrade to a version < 2.00" in this release notes for the correct steps to downgrade.
V1.30	With some save sets containing trace information, the traces are only properly shown if the set is restored after a preset.
V2.00	FSL-K82 (cdma2000 BTS Analyzer) and FSL-K84 (1xEV-DO BTS Analyzer): Save sets of software-versions before 2.00 can not be recalled.
V1.81	FSL-K91 and R&S FSL devices with mother board 2112.1800.02: Trace pixels in capture buffer and PVT display with values below (RefLevel-60dB) may be displayed wrong (to low).

#### **Modifications to the Documentation**

The new and modified functions mentioned in these release notes are already documented. Except the below mentioned last minute changes you can find the description including remote commands in the online help or in the manual. The manual can be downloaded from the internet under: <a href="http://www.rohde-schwarz.com">http://www.rohde-schwarz.com</a>. Select DOWNLOAD and search for FSL within the category MANUAL.

#### Last minute changes to the operating manual

#### Local Lockout via VXI-11 possible

The following commands allows the local lockout and go to local also via the VXI-11 interface: SYSTem:KLOCk < State>

This command activates the local lockout (remote control) or returns to the local mode.

Parameters: ON | OFF

ON: LLO (local lockout) OFF: GTL (go to local)

Example: "SYST:KLOK ON" // Activates LLO (remote control)

Mode: A

#### MMEMory:CATalog:LONG? <path>

This command displays extended information on the files contained in the current or specified directory. This command is an event and therefore has no \*RST value and no query.

#### Return values:

<total number of bytes the directory contains>,"<File name1>, <suffix1>, <Length of file 2 in bytes>","<File name 2>, <suffix2>, <Length of file2 in bytes>",...,"<File name n>, <suffix n>, <Length of file n in bytes>"

The response value consists of a list of strings, separated by commas. It begins with the total number of bytes the directory contains. Then the information for each file is returned. The <suffix> may be:

- ASCii
- BINary
- STAT

#### **Query parameters:**

DOS Path name

The path name should be in conformance with DOS conventions and may also include the drive name. Following this value, for each file, a string is listed according to the following syntax:

"<File name>, <suffix>, <Length of file in bytes>"

#### Example:

```
MMEM:CAT:LONG? 'C:\R_S\Instr\user
Returns all files in C:\R_S\Instr\user:
1776,3331993600, "autolog.txt,ASC,1520", "autologin.reg,BIN,144",
"no_autologin.reg,BIN, 112"
Query for the current directory:
MMEM:CDIR?
Response:
C:\R_S\Instr\user
```

Usage: Query only

Mode: A

#### SYSTem:SHUTdown

This command terminates the firmware and shuts down the Windows system of the instrument. ATTENTION: Unsaved data will be lost. The shut down will happen immediately without further queries.

#### FSL-B5: Video Out Legacy support

For devices with FSL-B5 and mother board 2112.1800 the softkey under Setup -> General Setup -> More -> Video Out Legacy ON /OFF will provide in the ON state the same behaviour of the Video Out as FSL with the previous mother board 1300.3080. This value is not taking part at preset or save recall

#### Remote operation

#### OUTPut:VIDeo:LEGacy <State>

For devices with FSL-B5 and mother board 2112.1800 this command will provide in the ON state the same behaviour of the Video Out as FSL with the previous mother board 1300.3080. This value is not taking part at preset or save recall

Parameter: ON | OFF

**Example:** "OUTP:VID:LEG ON" // switches the video legacy mode on

Characteristics: \*RST value: (no influence on this parameter, factory default OFF)

SCPI: device-specific

Mode: A

## FSL-K30: The SCPI command 'STATus:QUEStionable:CORRection' has been modified

#### STATus:QUEStionable:CORRection Register

This register comprises information about the correction state of noise measurements. It can be queried by STATus:QUEStionable:CONDition? and STATus:QUEStionable[:EVENt]? commands.

Bit No	Meaning
0	NO CORRection
	1 User calibration is required (i.e. not done, or setup changed). Will remain 1 until a user calibration is done. Set to 1 at the start of a user calibration. It will go to 0 at the end of a user calibration only if at least all points on one range have been calibrated. Initial value is 1.
1	Unused
2	Deprecated, unused
3	Missing Loss or ENR values
	No ENR, Loss In and/or Loss Out can be determined for one or all of the measurement
	frequencies. This occurs when using tables of ENR, Loss In and/or Loss out values. Check that
	the frequency ranges of the tables covers the range of frequencies to be measured. For each
	measurement frequency where ENR, Loss In or Loss Out cannot be determined 0 is used
4 to 15	Unused

#### **FSL-K30: Single Frequency measurement**

Single Frequency measurements give access to the functionalities of Frequency List measurements for quick measurements at one particular frequency: only one frequency has to be set before running the measurement and the measurement is performed at this frequency only. As with Frequency List measurements measurement at this frequency can be done once (Single measurements) or continuously (Continuous measurements).

Single Frequency measurements are run:

#### R&S FSL

- by checking the Single Freq checkbox in the Frequency Settings dialog and then choosing the type of execution by pressing the Run Single or Run Cont Hotkey
- by using the CONFigure:FREQuency:SINGle or CONFigure:FREQuency:CONTinuous SCPI command and then INITiate

The frequency the measurement is done at can be set in the Start Frequency field in the Frequency Settings dialog.

If the Single Frequency measurement is selected Start and Stop frequencies are always identical and the list reduced to one element, allowing to quickly run a measurement at one specific frequency. The Stop and Step Frequency fields are disabled and the Stop Frequency follows changes made to the Start Frequency.

The result is displayed in the Result List, limiting the list to one element. However in this mode the graphical display is disabled and remains blank.

#### Remote operation

CONFigure:FREQuency:CONTinuous

This remote control command configures R&S FS-K30 for a continuous frequency measurement (continuous measurement at one single frequency as opposed to frequency list measurements). After this command has been executed a continuous frequency measurement will be the measurement started when the user issues the INITiate command.

**Example**: "CONF:FREQ:CONT" R&S FS-K30 is configured to run continuous

frequency measurements.

Characteristics: \*RST value: -

SCPI: device-specific

This command is an event and is therefore not assigned an \*RST value and has no query.

CONFigure:FREQuency:SINGle

This remote control command configures R&S FS-K30 for a single frequency measurement (single measurement at one single frequency as opposed to frequency list measurements). After this command has been executed a single frequency measurement will be the measurement started when the user issues the INITiate command.

**Example**: "CONF:FREQ:SING" R&S FS-K30 is configured to run single frequency measurements.

**Characteristics:** \*RST value: SCPI: device-specific

This command is an event and is therefore not assigned an \*RST value and has no query.

#### New soft key for opening windows start menu

Under **Setup** -> **General Setup** -> **More** the new soft key **Open Start Menu** is available and it opens the Windows Start Menu

#### Remote Commands for FSL-K93 V2.01 extensions

#### CALCulate<1|2>:MARKer<1>:FUNCtion:TTCapture:RPTYpe

This command sets the type of the reference power for the 'sub frame length' calculation. The following types are available:

RMS The reference power is relative to the RMS power of the sub frame.

PEAK The reference power is relative to the peak power of the sub frame.

USER The reference power is user-defined.

**Example:** "CALC:MARK:FUNC:TTC:RPTY RMS"

"CALC:MARK:FUNC:TTC:RPTY PEAK"
"CALC:MARK:FUNC:TTC:RPTY USER"

Characteristics: \*RST value: RMS

SCPI: device-specific

Mode: K93

#### CALCulate<1|2>:MARKer<1>:FUNCtion:TTCapture:RPOWer

This command sets the reference power of the 'sub frame length' calculation in the case that the reference power type is USER.

Example: "CALC:MARK:FUNC:TTC:RPOW -20"

**Characteristics:** \*RST value: 0 SCPI: device-specific

Mode: K93

#### CALCulate<1|2>:MARKer<1>:FUNCtion:TTCapture:RPOType

This command sets the type of the reference power offset of the 'sub frame length' calculation. The following types are available:

PSN The offset is calculated as a percentage of the "EVM Data and Pilots" result.

USER The offset is user-defined.

**Example:** "CALC:MARK:FUNC:TTC:RPOT PSN"

"CALC:MARK:FUNC:TTC:RPOT USER"

Characteristics: \*RST value: PSN

SCPI: device-specific

Mode: K93

#### CALCulate<1|2>:MARKer<1>:FUNCtion:TTCapture:RPOFfset

This command sets the reference power offset of the 'sub frame length' calculation.

**Example:** "CALC:MARK:FUNC:TTC:RPOF 5"

**Characteristics:** \*RST value: 5 SCPI: device-specific

Mode: K93

#### CALCulate<1|2>:MARKer<1>:FUNCtion:TTCapture:AVERaging

This command sets the smoothing factor of the 'sub frame length' calculation. It may only be odd.

**Example:** "CALC:MARK:FUNC:TTC:AVER 129"

Characteristics: \*RST value: 11 SCPI: device-specific

Mode: K93

#### CALCulate<1|2>:MARKer<1>:FUNCtion:TTCapture:LENGth?

This command returns the result of the 'sub frame length' calculation.

**Example:** "CALC:MARK:FUNC:TTC:LENG?"

**Characteristics:** \*RST value: 0 SCPI: device-specific

Mode: K93

#### CONFigure:WIMax:Frame:IDCell

This remote control command can be used to specify the downlink. IDCell number, which in turn is used as DL\_PermBase parameter for the permutation equations to partly set the sub carrier randomizer initialisation vector.

**Example**: "CONF:WIM:DLSFFRAMe:IDC 0"

**Characteristics:** \*RST value: 0 SCPI: device-specific

Mode: K93

#### CONFigure:WIMax:Frame:IDCell:AUTO

#### R&S FSL

This remote control command can be used to specify that IDCell number will be determined by analysis

Example: "CONF:WIM:FRAMe:IDC:AUTO 0"

**Characteristics:** \*RST value: SCPI: device-specific

K93 Mode:

#### CONFigure:WIMax:FRAMe:PREDefmap

This remote control command can be used to configure the predefined map mode for auto demod.

- CONFig, i.e. the use of frame config
- IQDL, downlink determined by a loaded IQW file
- IQUL, uplink, determined by an IQW file
- SMU, the current SMU or equivalent generator settings are used

**Example**: "CONF:WIM:FRAMe:PREDefmap CONFig 0"

**Characteristics:** \*RST value: SCPI: device-specific

K93 Mode:

#### CONFigure:WIMax:FRAMe:ZONEtouse

This remote control command can be used to configure the zone that will be used for auto demodulation.

**Example**: "CONF:WIM:FRAMe:ZONe LAST" Last zone is used

Zone 2 is used "CONF:WIM:FRAMe:ZONe Z2"

**Characteristics:** \*RST value: 0

SCPI: device-specific

Mode: K93

#### CONFigure:WIMax:DLSFrame:IDCell

Backward compatible, see CONFigure:WIMax:FRAMe:IDCell

#### CONFigure:WIMax:ZONE<1...26>:CONTrol:STCConfig

This remote control specifies the space time coding.

**NOSTC** No space time coding

One antenna (uplink MIMO only). TX1

TX2 Two antennas

Example: "CONF:WIM:ZONE1:CONT:STCC TX2"

**Characteristics:** \*RST value: SCPI: device-specific

Mode: K93

#### CONFigure:WIMax:ZONE<1...26>:BURSt<1...32>:CONTrol[:DATA]

This remote control command can be used to enter a burst definition that is to be associated with a specific zone. It accepts eight arguments which make up all the input settings to create a new burst.

A zone may have up to 32 bursts defined within it.

New bursts can only be appended to the end of the existing burst list. For example if 4 bursts are already defined, then the suffix required to enter a new burst is 5.

The argument list must be defined as follows:

Modulation Modulation scheme -AUTO | QPSK | QPSK\_1\_2 | QPSK\_3\_4 | QAM16 |

QAM16\_1\_2 | QAM16\_3\_4 | QAM64 | QAM64\_1\_2 | QAM64\_2\_3 |

QAM64\_3\_4 | QAM64\_5\_6

(see CONFigure:WIMax:ZONE<1...26>:BURSt<1...32>:FORMat for

modulation details)

Subchannels Number of sub channels used by the burst (does not apply to downlink

DL MAP burst and uplink bursts)

Symbols Number of symbols used by the burst (does not apply to downlink DL MAP

burst and uplink bursts)

Slot Duration Slot duration (only applies to downlink DL\_MAP

burst and uplink bursts)

SubChannel Offset Sub channel offset of the burst Symbol Offset Symbol offset of the burst

**Burst Power** Defines the boosting power of the burst

Burst type - FCH | DLMAP | ULMAP | DATA | HARQ **Burst Type** 

| FASTfeedback

Example: "CONF:WIM:ZONE1:BURS1:CONT QAM16\_1\_2,5,10,20,0,0,0,DATA"

To define a 16 QAM 1/2 burst using 5 sub channels and 10 symbols.

"CONF:WIM:ZONE1:BURS1:CONT QAM16 1 2,0,0,6,0,0,0,DLMAP"

To define a 16 QAM 1/2 DL Map burst of 6 slots in length.

**Characteristics:** \*RST value:

> SCPI: device-specific

Mode: K93

#### CONFigure:WIMax:ZONE<1...26>:BURSt<1...32>:FORMat

This remote control command can be used to specify the burst modulation format. The following formats are available:

**AUTO** Auto Detect - modulation is detected when the signal is analysed

**QPSK** QPSK\_1\_2

QPSK\_1\_2 QPSK code rate 1/2 QPSK\_3\_4 QPSK code rate 3/4 QAM16

QAM16 1 2

16 QAM code rate 1/2 QAM16\_1\_2 QAM16 3 4 16 QAM code rate 3/4

QAM64 QAM64 1 2

QAM64 1 2 64 QAM code rate 1/2 QAM64 2 3 64 QAM code rate 2/3 QAM64 3 4 64 QAM code rate 3/4 QAM64 5 6 64 QAM code rate 5/6

Example: "CONF:WIM:ZONE1:BURS1:FORM QAM64 3 4

Characteristics: \*RST value: SCPI: device-specific

Mode: K93

#### [SENSe:]DEMod:FORMat[:BCONtent]:AUTo

The remote command is used to specify for OFDM how the DSP should use its demodulation and for OFDMA whether the DSP should perform a pre-analysis to determine the Zone, Burst and Downlink sub-Channel Map for the current captured signal prior to calculating the results.

NONE, 'OFDM' demodulation off (Brute force mode) the specified modulation is used for all bursts.

**FIRSt**, 'OFDM' retrieve the first valid payload modulation and analyze all bursts with same modulation. **USER**, 'OFDM' analyze all bursts carrying the modulation specified.

**ALL**, 'OFDM' analyze each burst with the first valid payload modulation found for that burst. **SIGNal**, 'OFDMA' and 'MIMO' pre-analyze to determine the Zone, Burst and Downlink sub—Channel Map, prior to analyze for the first Zone results. Note: this setting now get translated into **DLMAP**. **PREDefined**, 'OFDMA' and 'MIMO' analyze using the predefined Zone, Burst and Downlink sub—Channel Map for the current captured signal for the specified Zone results

ULPHY, 'OFDMA' and 'MIMO' The UL data burst in UL subframe is used

**ULMAP,** 'OFDMA' and 'MIMO' analyze using UL Map, pre-analyze to determine the Zone, Burst and uplink sub—Channel Map, prior to analyze for the zone specified see: CONFig:WIMax:FRAMe:ZONEtouse.

**DLMAP**, 'OFDMA' and 'MIMO' analyze using UL Map, pre-analyze to determine the Zone, Burst and downlink sub-Channel Map, prior to analyze for the zone specified see: CONFig:WIMax:FRAMe:ZONEtouse.

**Example:** "SENSe:DEM:FORM:AUT FIRSt" Specifies that the first symbol field should be decoded.

Characteristics: \*RST value: ALL SCPI: device-specific

Mode: K92, K93


## **Appendix: Installation troubleshooting**

The installation will only be carried out correctly if it is done through the firmware with **Setup | More | Firmware Update** as described in the "Firmware Update" section in this release notes. A second valid possibility is the usage of the update tool (FSLUpdate)

Never try to update by starting the MSI-files directly! In this case version checking is not carried out and this may lead to black screens when starting up the firmware or an application.

If such an installation problem occurs on the FSL the following procedure will completely remove the firmware and a new installation of firmware and applications is possible. Please use a USB keyboard and mouse for this procedure.

- Open DOS prompt
- Change to the following folder (please include the quotes " " due to the blank and the & sign) cd "C:\Program Files\Rohde&Schwarz\Installer\"
- Execute FSLInstaller.exe /remove
- Confirm with Install twice
- (after reboot it may happen that the driver needs to be copied again, allow this action)
- Execute Windows Start -> Settings -> Control Panel -> Add or Remove Programs
- Remove all R&S FSL components which are left except the following components
  - R&S FSL Installer Utility Vx.xx
  - R&S FSL EEPROM Files Vx.xx

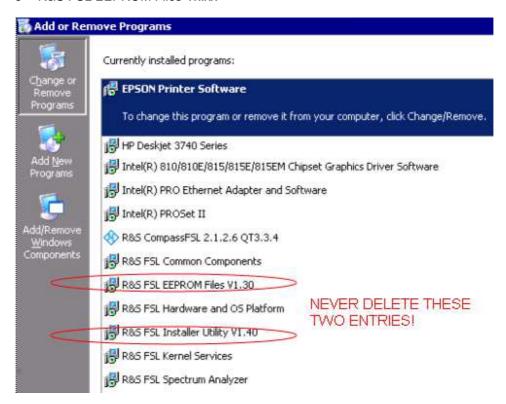

- Now execute Windows Start->Programs->Accessories->FSLUpdateTool
- Install firmware as described above in the "Firmware Update" section

## **Appendix: Contact to our hotline**

#### Technical support - where and when you need it

For quick, expert help with any Rohde & Schwarz equipment, contact one of our Customer Support Centers. A team of highly qualified engineers provides telephone support and will work with you to find a solution to your query on any aspect of the operation, programming or applications of Rohde & Schwarz equipment.

#### Up-to-date information and upgrades

To keep your instrument up-to-date and to be informed about new application notes related to your instrument, please send an e-mail to the Customer Support Center stating your instrument and your wish.

We will make sure that you get the right information.

Europe, Africa, Middle East Phone +49 89 4129 12345

customersupport@rohde-schwarz.com

**North America** Phone 1-888-TEST-RSA (1-888-837-8772)

customer.support@rsa.rohde-schwarz.com

**Latin America** Phone +1-410-910-7988

customersupport.la@rohde-schwarz.com

**Asia/Pacific** Phone +65 65 13 04 88

customersupport.asia@rohde-schwarz.com

**China** Phone +86-800-810-8228 /

+86-400-650-5896

 $\underline{customersupport.china@rohde\text{-}schwarz.com}$