


APPROXIMATE AREA DAMAGED DUE TO SITE INCIDENT. SLAB AND COLUMN REINFORCEMENT DAMAGED TO BE REPAIRED PER NOTES ON THIS SKETCH

- NOTES:
- 1. ANY REINFORCEMENT DAMAGED DUE TO THE SITE INCIDENT SHALL BE REPLACED ACCORDING TO DESIGN DRAWINGS.
 - 2. ANY SLAB REINFORCEMENT CUT DURING REPAIR OF FORMWORK SHOULD BE REPLACED ACCORDING TO DESIGN DRAWINGS.
 - 3. REPAIR OF CONTINUOUS BOTTOM BAR ARE ALLOWED TO BE SPLICED AT 1/3 DISTANCE BETWEEN COLUMNS WITH TENSION SPLICE.
 - 4. REPAIR OF CONTINUOUS TOP BAR ARE TO BE SPLICED AT MID SPAN WITH TENSION SPLICE.
 - 5. VERTICAL DOWELS FOR COLUMN 2 THAT ARE DAMAGED SHALL BE REPLACED TO MAINTAIN COMPRESSION SPLICE LENGTH.
 - 6. REPAIRED SLAB AND COLUMN REINFORCEMENT TO BE REINSPECTED AND APPROVED BY REBAR INSPECTOR PRIOR TO CONCRETE POUR.

1 PART PLAN AT 34TH FLOOR



REV	DATE	DESCRIPTION

 <div>One Penn Plaza 250 West 34th st New York, NY 10119 (212) 687-9888 www.wsp.com/usa</div>	CLIENT: FORTIS PROPERTY GROUP,LLC	PROJECT: 161 MAIDEN LANE	REF. DWG. S-340	
	ARCHITECT: HILL & WEST ARCHITECTS,LLP	TITLE: REINFORCEMENT REPAIR FOR DAMAGED SLAB REINFORCEMENT AT 34TH FLOOR	DESIGN BY: JL	CHECKED BY: JL
			DRAWN BY:	DATE: 04.09.2018
			SCALE:	DRAWING No: SSK-52
			PROJECT No: B1310880	SHEET 1 OF 1
			CAD FILE:	