

## S E R V I C E N O T E

SUPERSEDES: None

**HP 54715A Amplifier Plug-In****Serial Numbers:** 0000A00000/US3451999**Duplicate Service Notes:** 54713A-01  
54713B-01  
54714A-01

Attenuator replacement requires front-casting modification and a shorter mounting screw

**Situation:**

Replacement attenuator, part number 54512-63402, now requires a round mounting hole in the plug-in's front panel casting and a shorter attenuator mounting screw.

*Continued*

DATE: July 1997

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

**INFORMATION ONLY**

AUTHOR:

ENTITY:

ADDITIONAL INFORMATION:

RK

0800

**Solution/Action:**

Use a round file to round out the front-panel casting's channel input hole to allow mounting the new attenuator. The new attenuators have a pressed-in BNC connector that requires the round mounting hole. Position the plug-in on its side to keep the metal filings out of the plug-in when filing out the front-panel hole. Use a 0515-0430 mounting screw to mount the attenuator front to the circuit board. A longer screw can damage and short the channel input.

**Parts Required**

Part Number	Qty	Description
0515-0430	1	Machine Screw M3 6mm-Lg Pan-Hd T10