

INFORMATION ONLY – DOES NOT COMMUNICATE
A MODIFICATION OR SAFETY CONDITION

54830-02

S E R V I C E N O T E

1. Supersedes:
NONE

54830B

Serial Numbers: ALL

Error's in service manual 54830-97001.

Parts Required:

P/N	Description	Qty.
NONE		

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR: [initials] PRODUCT LINE: [product line]

ADDITIONAL INFORMATION:

© AGILENT TECHNOLOGIES, INC. 2002
PRINTED IN U.S.A.



Agilent Technologies

January 25, 2002

Situation:

Error in service manual 54830-97001.

- 1. There is no CD-ROM removal Procedure. Use the procedure in the 54845B/46B service manual until revision comes out.**
- 2. External Trigger Sensitivity is as follows:**
 - a. Dc to 100MHz: 0.05x(signal range)**
 - b. 100MHz to 500MHz: 0.10x(signal range)**
- 3. Input Impedance (resistance) is as follows:**
 - a. 50 Ohm: $\pm 1.0\%$**
- 4. DC Calibrator Specifications**
 - a. Performance test record result should be between .98 an 1.02**
- 5. Time Measurement Accuracy Specification**
 - a. Equivalent Time: (≥ 16 averages)
 $\pm [(0.0015 * dT) + (\text{full scale}/(2 * \text{memory depth})) + 30\text{ps}]$**

Solution/Action:

There will be an updated manual release around May 2002. Until then just use this service note as your information to correct these errors.