

S E R V I C E N O T E

SUPERSEDES: NONE

6834B AC Power Source / Analyzer**Serial Numbers:** 0000A00000 / 3601A00143**Auxiliary Power Supply Nuisance Fuse Opening****Duplicate Service Notes:** 6814B-02, 6834A-04,
6814A-03, 6843A-03**To Be Performed By:** Agilent-Qualified Personnel**Parts Required:**2110-0688 Fuse Sub 3A 125V
2110-0991 Fuse PC 2A 250V*Continued*

DATE: January 1997

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS: LABOR 2.0 Hours	
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY: <input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT	USED PARTS: <input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		AGILENT RESPONSIBLE UNTIL: January 1999
AUTHOR: BH	ENTITY: 2100	ADDITIONAL INFORMATION:	

Situation:

The A10 Auxiliary Power Supply assembly protection fuses do not have sufficient ampere rating and may open under some load conditions. The A10 auxiliary power supply assembly is used in 5 different models making it difficult which assembly requires a fuse change by serial number. Therefore all AC power source A10 assemblies should be checked to verify the correct fuse is installed. If the upper left corner of the A10 assembly is marked with "rev J" the fuse rating has been checked and/or changed.

Solution / Action:

Change the following parts on the A10 Aux PS assembly.

Change A10F1 to 2110-0991 2A 250V

Change A10F2 to 2110-0688 3A 125V

Mark the upper left corner of the A10 assembly with "rev J" to signify that the fuse rating has been checked or the fuses changed.