**SONY**

Car Stereo

# Service Bulletin

**CSA-14**

**Sony Service Company** - Technical Services
A Division of Sony Electronics
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDX-U404/U606 **No.** 292

**Subject:** Preventing Audio Dropouts **Date:** August 25, 1993

**Symptom:**

(51) Audio dropouts occur without any relation to vibration of the vehicle or scratches on the disc.

**Solution:** Replace IC31 on the Servo board with the improved type shown below.

| REF | FORMER | | NEW | |
|---|---|---|---|---|
| | DESCRIPTION | PART NUMBER | DESCRIPTION | PART NUMBER |
| IC31 | IC, CXP82224-003Q | 8-752-843-14 | IC, CXP82224-008Q | 8-752-850-17 |

Applicable Serial Numbers CDX-U404: up to 20700

CDX-U606 up to 16200

[SERVO BOARD]

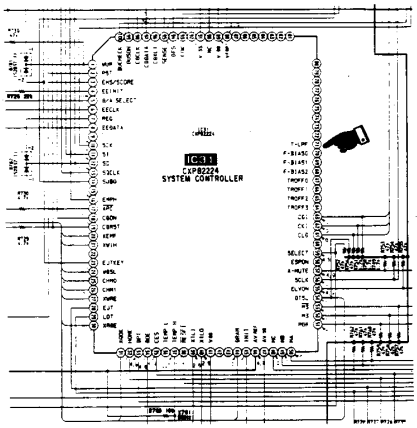


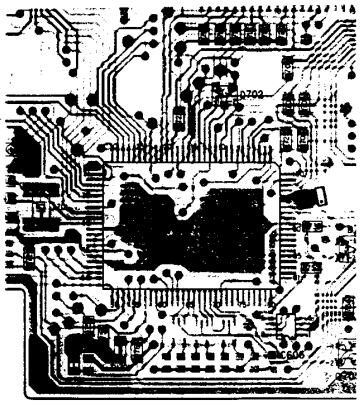


Reference: Technical News ME-93026
Autoflagged - NO

PRINTED ON RECYCLED PAPER

PRINTED IN USA
CSA-14893-1