


**MODEL:** iR2200/ 2800 / 3300

**SUBJECT:** Installing System Software V40.06

#### Detail:

CD-ROM FY9-4082-016 contains file 'iR2200N-USen4006.iff' which causes an error. Due to this error it is impossible to use the system software on 'H' PCL only machines.


The following error is displayed when upgrading is attempted.

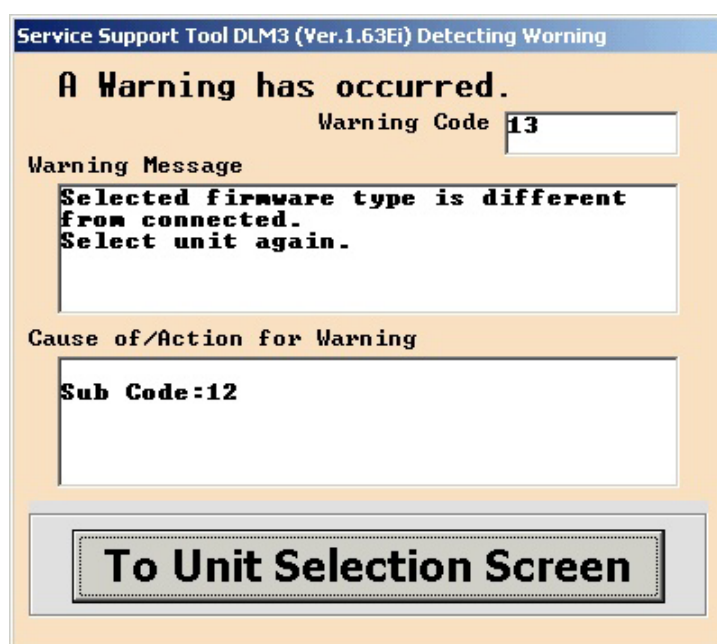


To overcome this, a new file has been released and is available to download from Notes / Intranet or Dealernet in the Product Driver Database, under Patches.

#### Action:


Locate the ServTool folder which was created when the SST was installed.

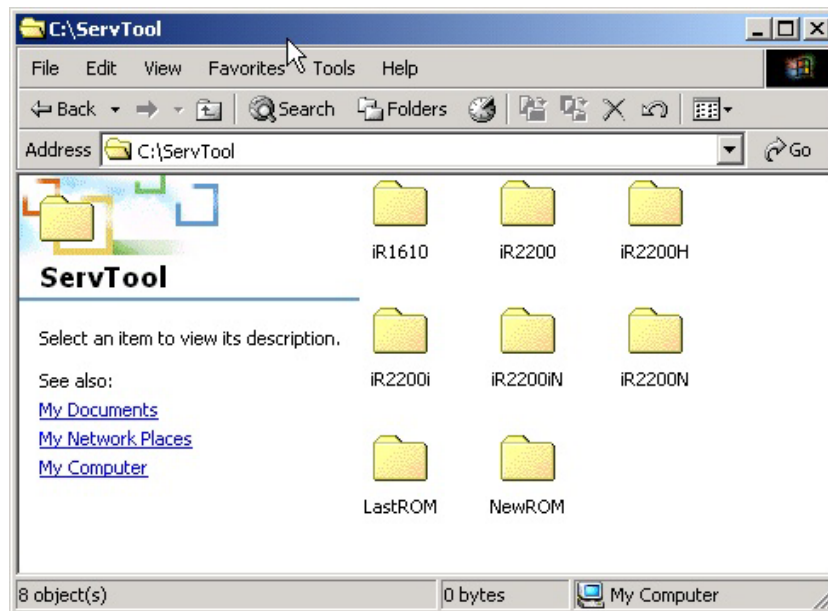

Open iR2200N Folder. Locate and open folder named "system".  
Within this folder you will find a folder named "USenv4006"

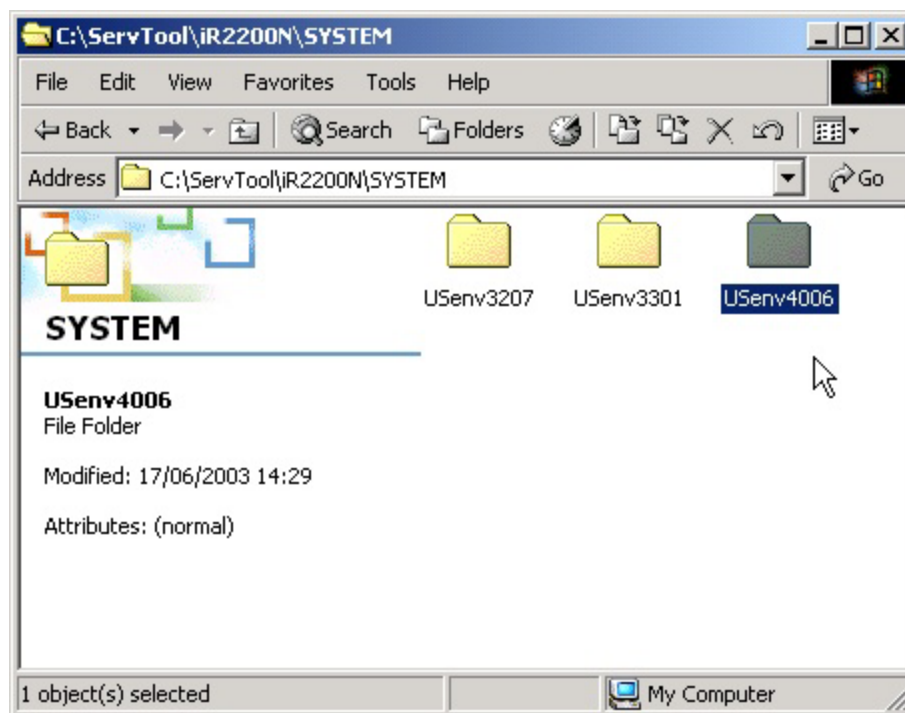

Open this folder and you will find a file named "ir2200n-usen4006.ift".

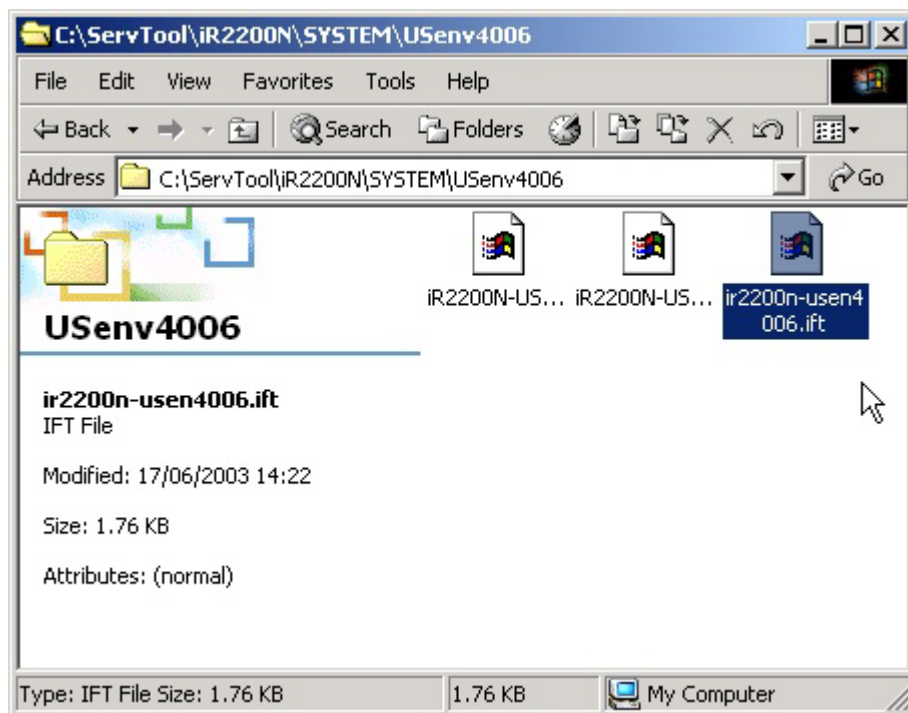

Delete this file and replace it with the revised file downloaded from Notes / Intranet or Dealernet.

Start SST and download V40.06