Classification Yellow

MODELS **37GT25H** (S/N 107****~) **51GT25H** (S/N 107****~)

SYMPTOM Tuning drift

CAUSE R1021

ACTION For units with serial numbers below that shown above, change the value of R1021 from 22k to 12k, using the part number given below.

Note that this resistor has been changed from July 2001 (serial numbers after the one shown above).
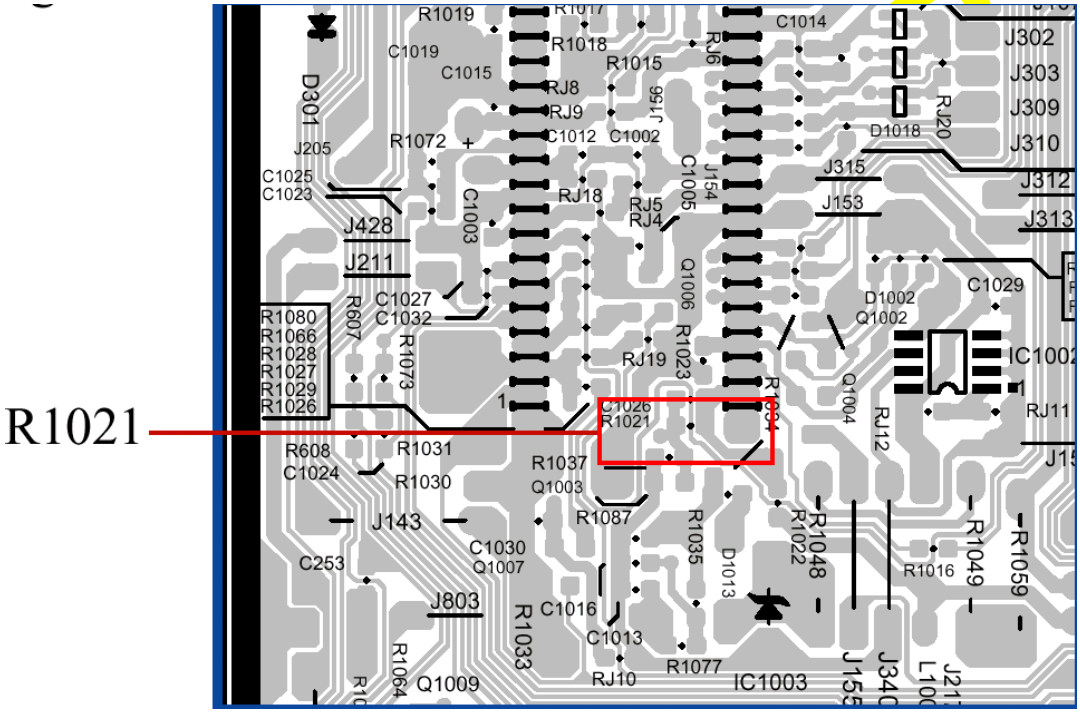
REF NO	DESCRIPTION	PART NUMBER	PRICE CODE
R1021	Resistor, 12k	VRS-TV1JD123J	AA