

PASSENGER ADDRESS SYSTEM

HAP
OCT 10/06

23-31-00
SECTION TITLE
PAGE 1

NON-ILLUSTRATED FIGURE

THE ITEMS REFLECTED IN THIS FIGURE ARE INTENTIONALLY
NON-ILLUSTRATED. THEY ARE REFERENCED TO EITHER A
NEXT HIGHER OR NEXT LOWER ASSEMBLY/INSTALLATION FIGURE.

E 23310002A REV 051

FUNCTIONAL COLLECTOR CUSTOMER UNIQUE (PASSENGER ADDRESS SYSTEM ONLY)
FIGURE 2A

HAP
OCT 15/08

23-31-00-02A

23-31-00-02A
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2 A			FUNCTIONAL COLLECTOR CUSTOMER UNIQUE (PASSENGER ADDRESS SYSTEM ONLY)	201967	
- 2	400A9101-2610		FUNCTIONAL COLLECTOR- CUSTOMER UNIQUE (PASSENGER ADDRESS SYSTEM ONLY)	201967	RF
- 50	417A6300-5SP		FOR NHA/OTHER SYS DET SEE: 23-00-00-02 .PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC POSITION DATA: STA 304.41 LBL 24.18 WL 280.15 FOR DETAILS SEE: 23-31-06-04	201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-00-02A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-00
 FIG. 02A
 PAGE 1
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

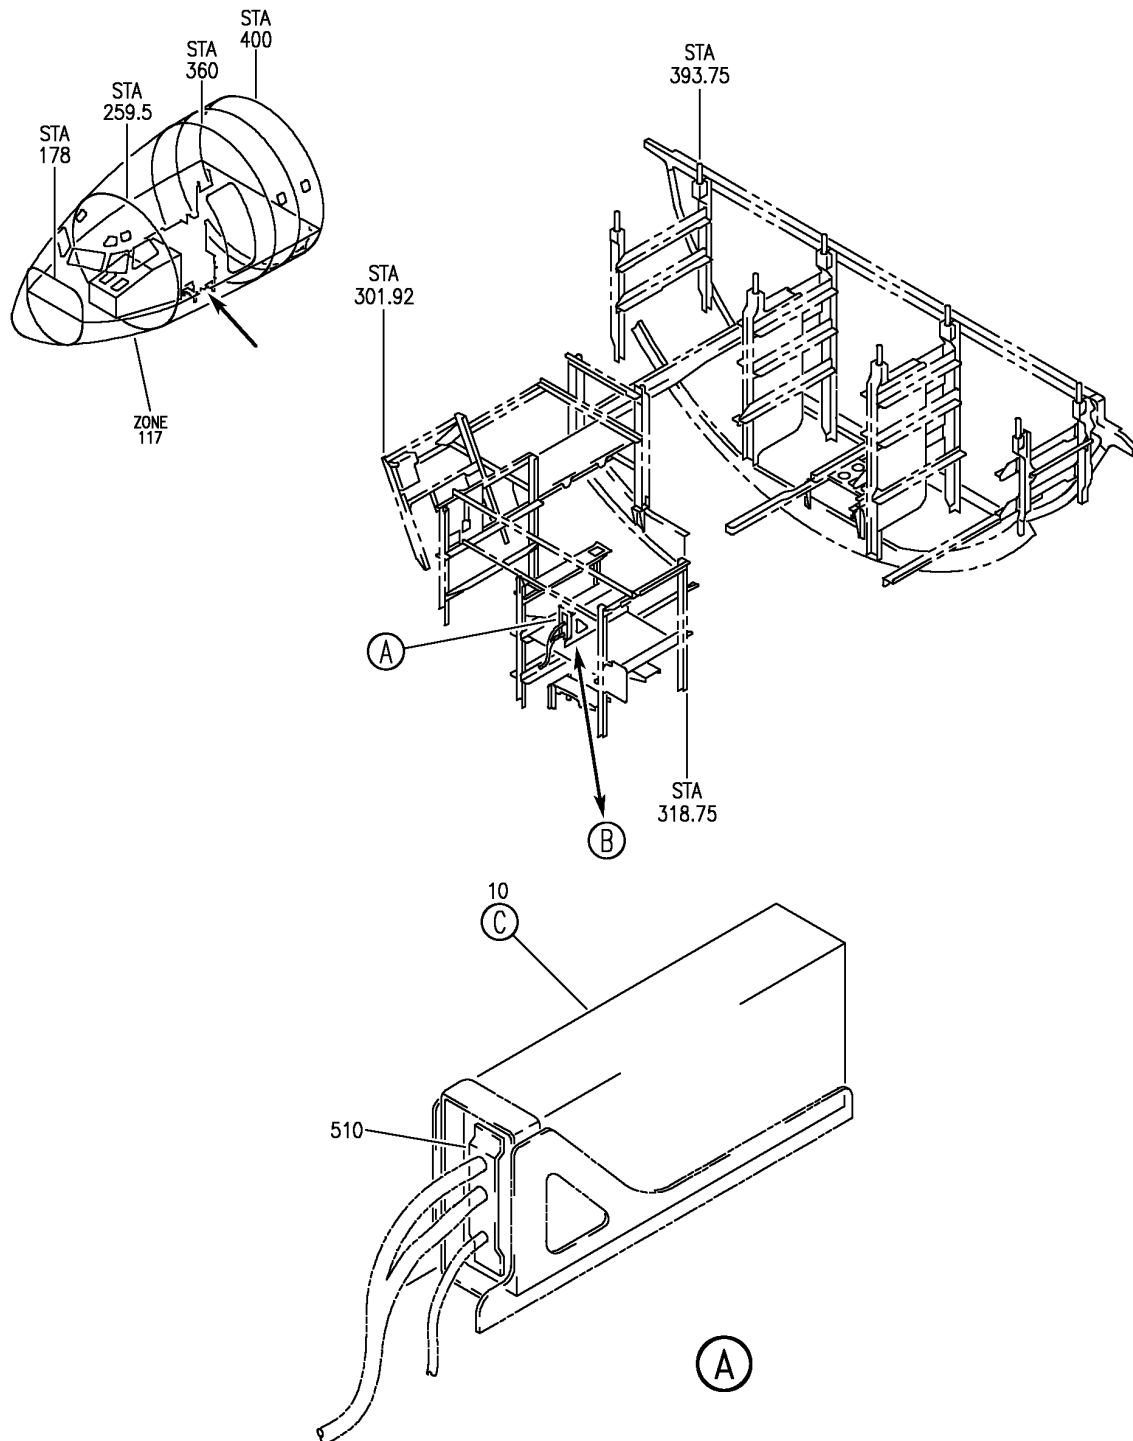

E 23310101 SHT 1 REV 082

EQUIPMENT INSTL PUBLIC ADDRESS AMPL E1 RACK
FIGURE 1 (SHEET 1)


23-31-01-01

HAP
OCT 10/06

23-31-01-01
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

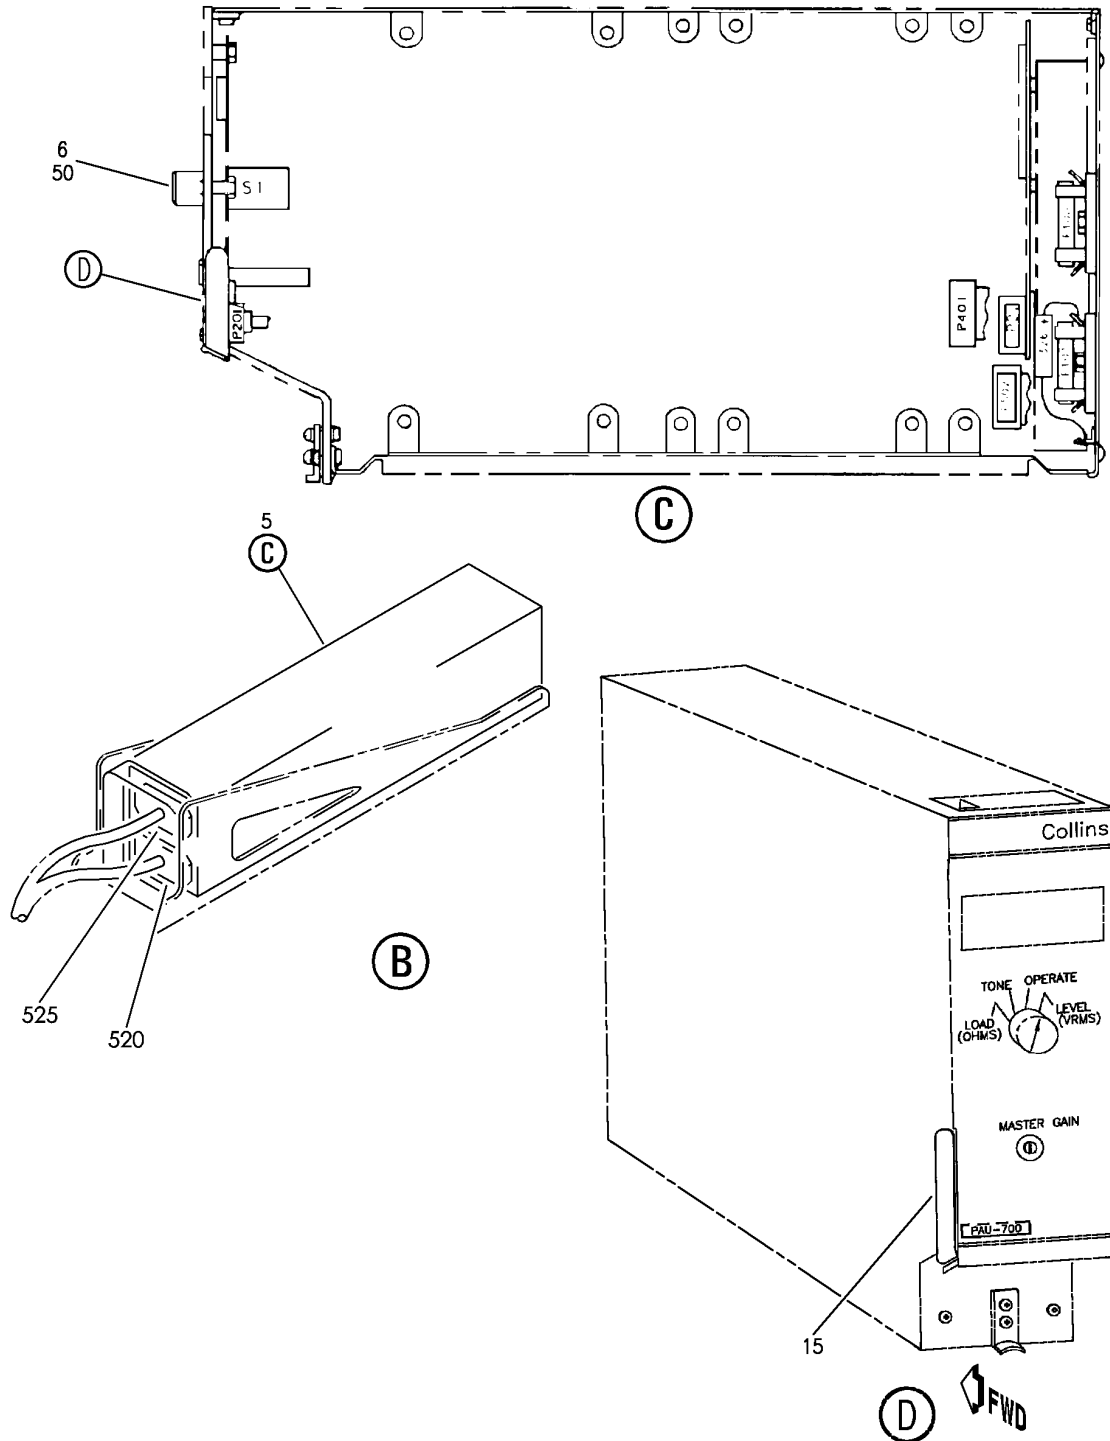

E 23310101 SHT 2 REV 082

EQUIPMENT INSTL PUBLIC ADDRESS AMPL E1 RACK
FIGURE 1 (SHEET 2)

23-31-01-01

HAP
OCT 10/06

23-31-01-01
PAGE 0A

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			EQUIPMENT INSTL PUBLIC ADDRESS AMPL E1 RACK	012200 968999	
- 1	284A0411-233103		EQUIPMENT INSTL-PUBLIC ADDRESS AMPL FOR NHA SEE: 23-30-00-12	012030	RF
- 2	MODREF252144		EQUIPMENT INSTL-PUBLIC ADDRESS AMPL MODULE NUMBER: 284A0411-233103 REV Y	031031	1
- 2	MODREF271847		EQUIPMENT INSTL-PUBLIC ADDRESS AMPL MODULE NUMBER: 284A0411-233103 REV AB	032046 054104 968972	1
- 2	MODREF350443		EQUIPMENT INSTL-PUBLIC ADDRESS AMPL MODULE NUMBER: 284A0411-233103 REV AD	047053 105200 973999	1
10	622-5342-101		.AMPLIFIER ASSY-PASS. ADDRESS SUPPLIER CODE: V4V792 FUNCTIONAL DESCRIPTION: SENDS OUT THE HIGHEST PRIORITY AUDIO TO ALL SPEAKERS IN THE PASSENGER COMPARTMENT. ELECTRICAL EQUIP NUMBER: M00063 COMPONENT MAINT MANUAL REF: 23-32-70	012013 015030	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-01
 FIG. 01
 PAGE 1
 FEB 15/09

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
10	622-5342-101		.AMPLIFIER ASSY-PASS. ADDRESS (CUSTOMER FURNISHED) SUPPLIER CODE: V4V792 FUNCTIONAL DESCRIPTION: SENDS OUT THE HIGHEST PRIORITY AUDIO TO ALL SPEAKERS IN THE PASSENGER COMPARTMENT. ELECTRICAL EQUIP NUMBER: M00063 WIRING DIAGRAM REF: 233101 COMPONENT MAINT MANUAL REF: 23-32-70 MAINTENANCE MANUAL REF: 23-31-01	014014 031200 968999	1
15	651-1811-001		..PLATE-IDENT SUPPLIER CODE: V4V792 USED ON: 622-5342-101	012200 968999	1
50	646-4695-001		..KN0B- SUPPLIER CODE: V4V792 OPTIONAL PART: 281-0628-270 V86797 USED ON: 622-5342-101	012200 968999	1
50	RB67-0		..KN0B-281-0628-270 SUPPLIER CODE: V86797 OPTIONAL PART: 646-4695-001 V4V792 USED ON: 622-5342-101	012200 968999	1
- 55	AN565F4H3		ATTACHING PARTS ..SETSCREW	012200 968999	2
- 502	286A0131-079		-----*----- WIRE BUNDLE ASSY-E1-3 SHELF	012030	RF
- 506	286A0131-165		WIRE BUNDLE ASSY	101105 968999	RF
- 507	286A0131-184		WIRE BUNDLE ASSY-	031046 054100	RF
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-01
FIG. 01
PAGE 2
FEB 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 510	BKA11C07AA01		.PLUG PLATE- SUPPLIER CODE: V71468 SPECIFICATION NUMBER: BCREFA1345 OPTIONAL PART: S611C07AA01 V59610 NIC66F11C07AA01 V00779 OVERLENGTH PART NUMBER: BACC66F11C07AA01 ELECTRICAL EQUIP NUMBER: D02639 WIRING DIAGRAM REF: 233101 233102 ATTACHING PARTS	012046 054105 968999	1
- 517	NAS1801-06		.SCREW- POSITION DATA: FAR SIDE SIZE DETERMINED ON INSTL.	012046 054105 968999	4
- 518	PLH506CD		.NUT- SUPPLIER CODE: VF0224 SPECIFICATION NUMBER: BACN10YR06CD OPTIONAL PART: H52732-06CD V15653 POSITION DATA: NEAR SIDE -----*-----	012046 054105 968999	4
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-01
 FIG. 01
 PAGE 3
 FEB 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

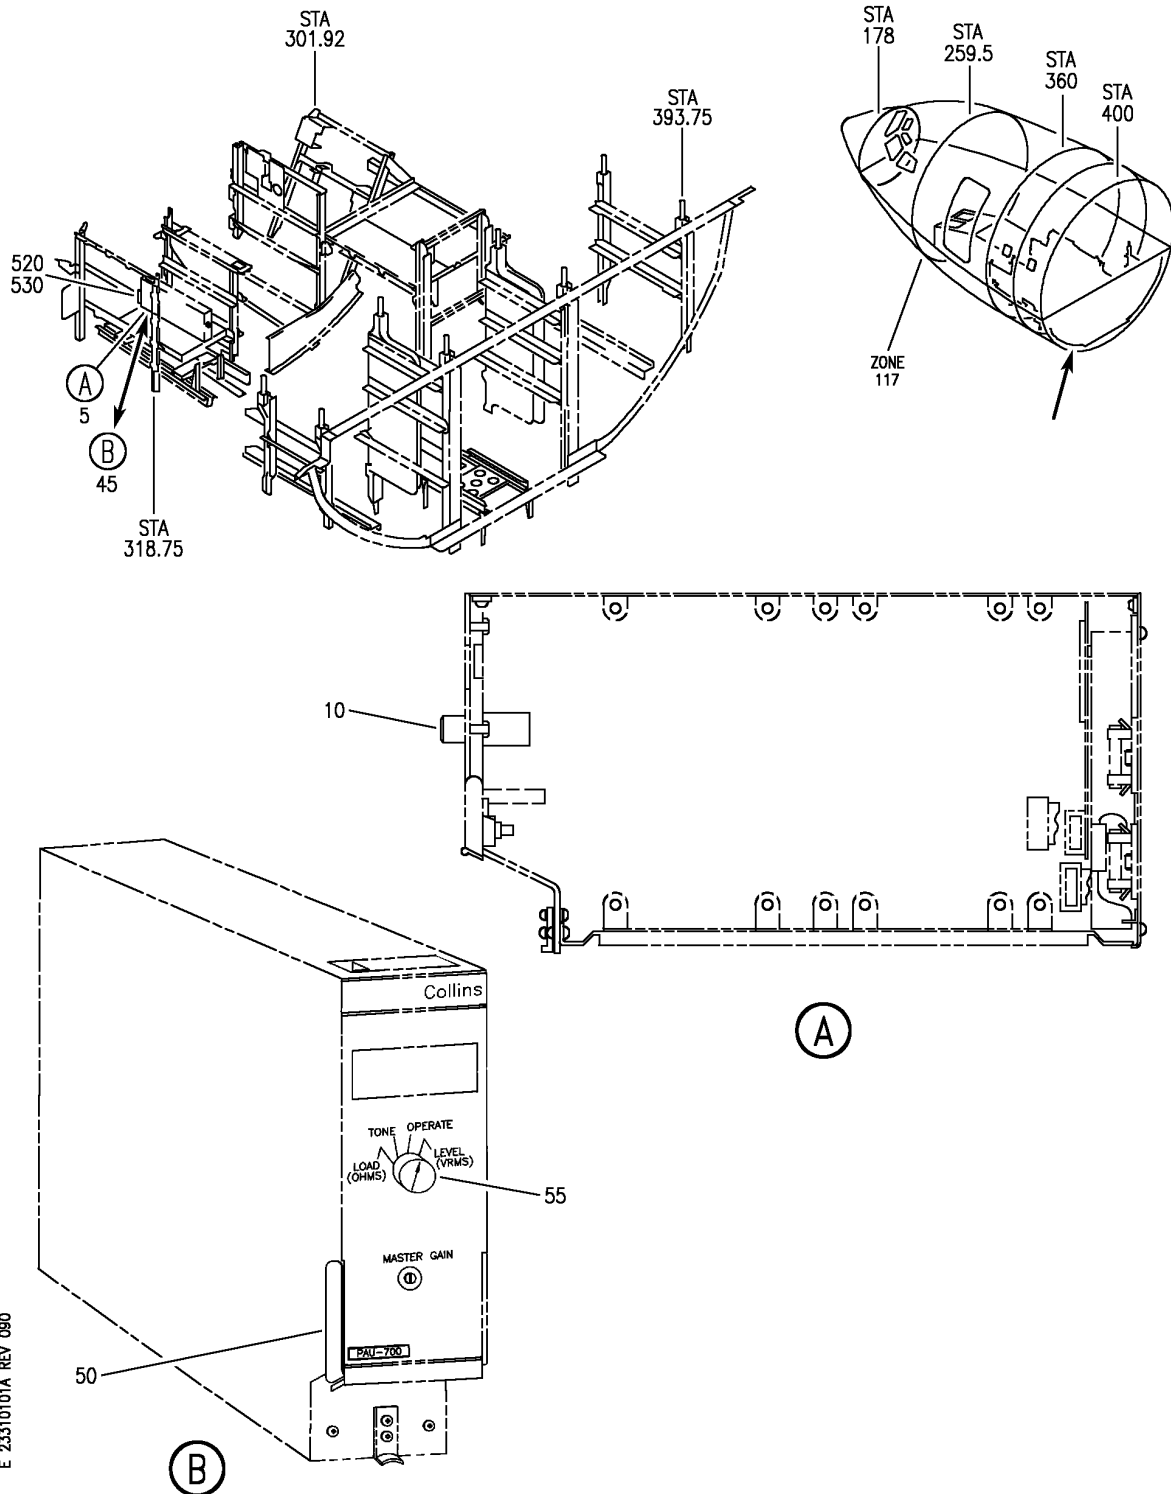

E 23310101A REV 080

EQUIPMENT INSTL-E1 RACK E/E BAY (PASSENGER ADDRESS AMPLIFIER ONLY)
FIGURE 1A

HAP
OCT 10/06

23-31-01-01A

23-31-01-01A
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 A			EQUIPMENT INSTL-E1 RACK E/E BAY (PASSENGER ADDRESS AMPLIFIER ONLY)	001011 201967	
- 1	284A0410-5		EQUIPMENT INSTL-E1 RACK E/E BAY (PASSENGER ADDRESS AMPLIFIER ONLY) FOR NHA/OTHER SYS DET SEE: 25-50-00-08	008011 201967	RF
- 1	284A0410-7		EQUIPMENT INSTL-E1 RACK E/E BAY (PASSENGER ADDRESS AMPLIFIER ONLY) FOR NHA/OTHER SYS DET SEE: 25-50-00-08	001007	RF
5	622-4096-001		.AMPLIFIER ASSY-PASS. ADDRESS SUPPLIER CODE: V4V792 FUNCTIONAL DESCRIPTION: SENDS OUT THE HIGHEST PRIORITY AUDIO TO ALL SPEAKERS IN THE PASSENGER COMPARTMENT. ELECTRICAL EQUIP NUMBER: M00063 COMPONENT MAINT MANUAL REF: 23-32-02 MAINTENANCE MANUAL REF: 23-31-01	201967	1
10	757-0228-001		..KNOB- SUPPLIER CODE: V4V792 ATTACHING PARTS	201967	1
- 15	AN565F8H3		..SETSCREW	201967	2
- 20	544-8763-003		..WASHER- SUPPLIER CODE: V4V792 -----*-----	201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-31-01-01A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-01
 FIG. 01A
 PAGE 1
 OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 A				
45	622-5342-101	. AMPLIFIER ASSY-PASS. ADDRESS SUPPLIER CODE: V4V792 FUNCTIONAL DESCRIPTION: SENDS OUT THE HIGHEST PRIORITY AUDIO TO ALL SPEAKERS IN THE PASSENGER COMPARTMENT. ELECTRICAL EQUIP NUMBER: M00063 COMPONENT MAINT MANUAL REF: 23-32-70 MAINTENANCE MANUAL REF: 23-31-01	001011	1
50	651-1811-001	.. PLATE-IDENT SUPPLIER CODE: V4V792	001011	1
55	646-4695-001	.. KNOB- SUPPLIER CODE: V4V792 OPTIONAL PART: 281-0628-270 V4V792 RB67-0 V86797	001011	1
55	281-0628-270	.. KNOB- SUPPLIER CODE: V86797 OPTIONAL PART: RB67-0 V86797 646-4695-001 V4V792	001011	1
55	RB67-0	.. KNOB- SUPPLIER CODE: V86797 OPTIONAL PART: 646-4695-001 V4V792 281-0628-270 V4V792 ATTACHING PARTS	001011	1
- 60	AN565F4H3	.. SETSCREW -----*-----	001011	2
- 500	286A0131-020	WIRE BUNDLE ASSY	002003	RF
- 501	286A0131-026	WIRE BUNDLE ASSY	006007	RF
- 501	286A0131-042	WIRE BUNDLE ASSY-	201967	RF
- 503	286A0131-079	WIRE BUNDLE ASSY	008011	RF
MISSING ITEM NUMBERS NOT APPLICABLE				

- ITEM NOT ILLUSTRATED

HAP

23-31-01-01A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-01
FIG. 01A
PAGE 2
OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 A					
- 504	286A0131-086		WIRE BUNDLE ASSY	001001	RF
- 504	286A0131-092		WIRE BUNDLE ASSY	004005	RF
520	BKA11C07AA01		.PLUG PLATE-	001011	1
			SUPPLIER CODE:	201967	
			V71468		
			SPECIFICATION NUMBER:		
			BCREFA1345		
			OPTIONAL PART:		
			S611C07AA01		
			V59610		
			NIC66F11C07AA01		
			V00779		
			OVERLENGTH PART NUMBER:		
			BACC66F11C07AA01		
			ELECTRICAL EQUIP NUMBER:		
			D02639		
530	DPAMA32-33S		.PLUG-	201967	1
			SUPPLIER CODE:		
			V71468		
			ELECTRICAL EQUIP NUMBER:		
			D00121		
			WIRING DIAGRAM REF:		
			233101		
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-01-01A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-01
 FIG. 01A
 PAGE 3
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

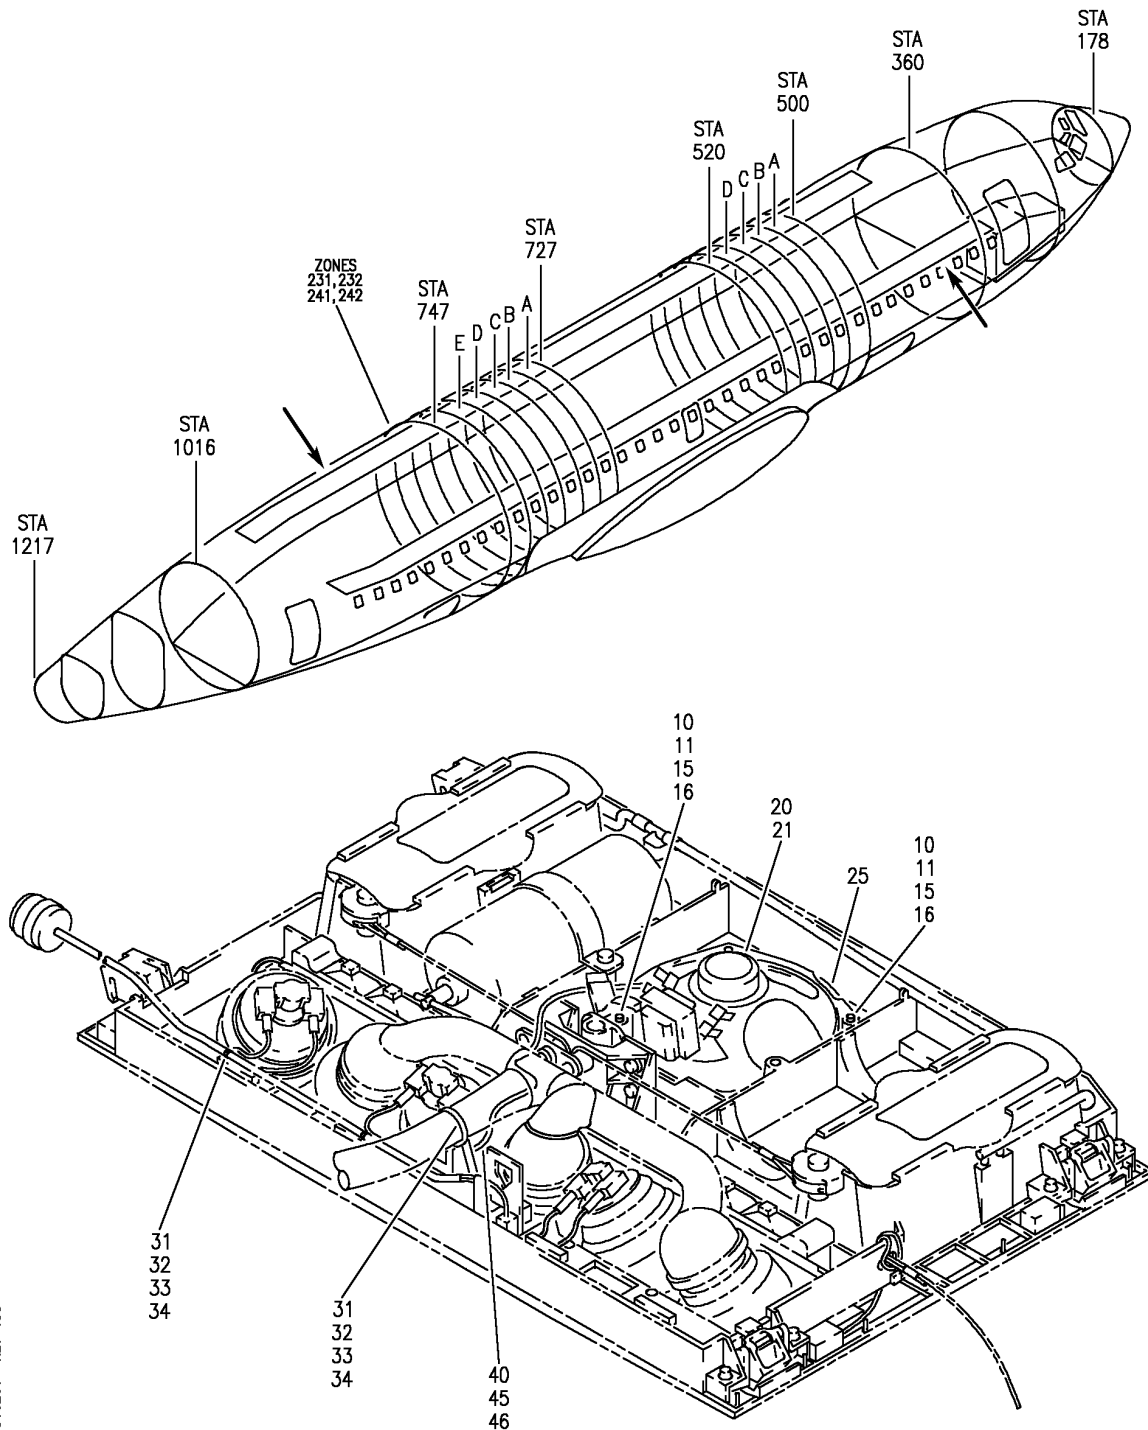

E 23310201 REV 155

SERVICE UNIT ASSY-PASS. WITH SPKR AND GASPER (COMMUNICATIONS ONLY)

FIGURE 1

23-31-02-01

HAP
JUN 15/09

23-31-02-01
PAGE 0

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			SERVICE UNIT ASSY-PASS. WITH SPKR AND GASPER (COMMUNICATIONS ONLY)	201967	
- 3	417N3011-201A		SERVICE UNIT ASSY-PASS. WITH SPKR AND GASPER (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-29	201967	RF
- 3	417N3011-401B		SERVICE UNIT ASSY-PASS. WITH 2K SPKR AND GASPER (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-29	201967	RF
- 5	417N3011-202SP		SERVICE UNIT ASSY-PASS. WITH SPKR AND GASPER (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 QUALIFIED I/W DATA: COLOR SUBJECT TO CUSTOMER PREFERENCE FOR NHA/OTHER SYS DET SEE: 25-23-61-29	201967	RF
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-02-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 01
 PAGE 1
 OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 5	417N3011-402SP		SERVICE UNIT ASSY-PASS. WITH 2K SPKR AND GASPER (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 QUALIFIED I/W DATA: COLOR SUBJECT TO CUSTOMER PREFERENCE	201967	RF
10	NAS514P832-11P		.SCREW	201967	2
15	BACN10YJ08		.NUT	201967	2
20	RDAM8018		.LOUDSPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M10976 INTER/ACROSS MODEL I/W P/N: RDAM8005A VOFF57	201967	1
25	417N3104-2		.GASKET-SPKR MANUFACTURED FROM: SH RUBATEX R310V 0.125 X 7.0 IN DIA SPARES ORDER MATERIAL CODE: 5844067512	201967	1
31	PLT2MM		.STRAP- SUPPLIER CODE: V06383 OPTIONAL PART: PLT2MM2 V06383	201967	AR
31	PLT2MM2		.STRAP- SUPPLIER CODE: V06383 OPTIONAL PART: PLT2MM V06383	201967	AR
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-02-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 01
 PAGE 2
 JUN 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 45	53002		.WIRE BUNDLE- SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-101 USED ON: 417N3011-202SP 417N3011-202A 417N3011-201A 417N3011-201SP 417N3011-401B 417N3011-401SP 417N3011-402B 417N3011-402SP	201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-02-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 01
 PAGE 3
 OCT 15/08

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

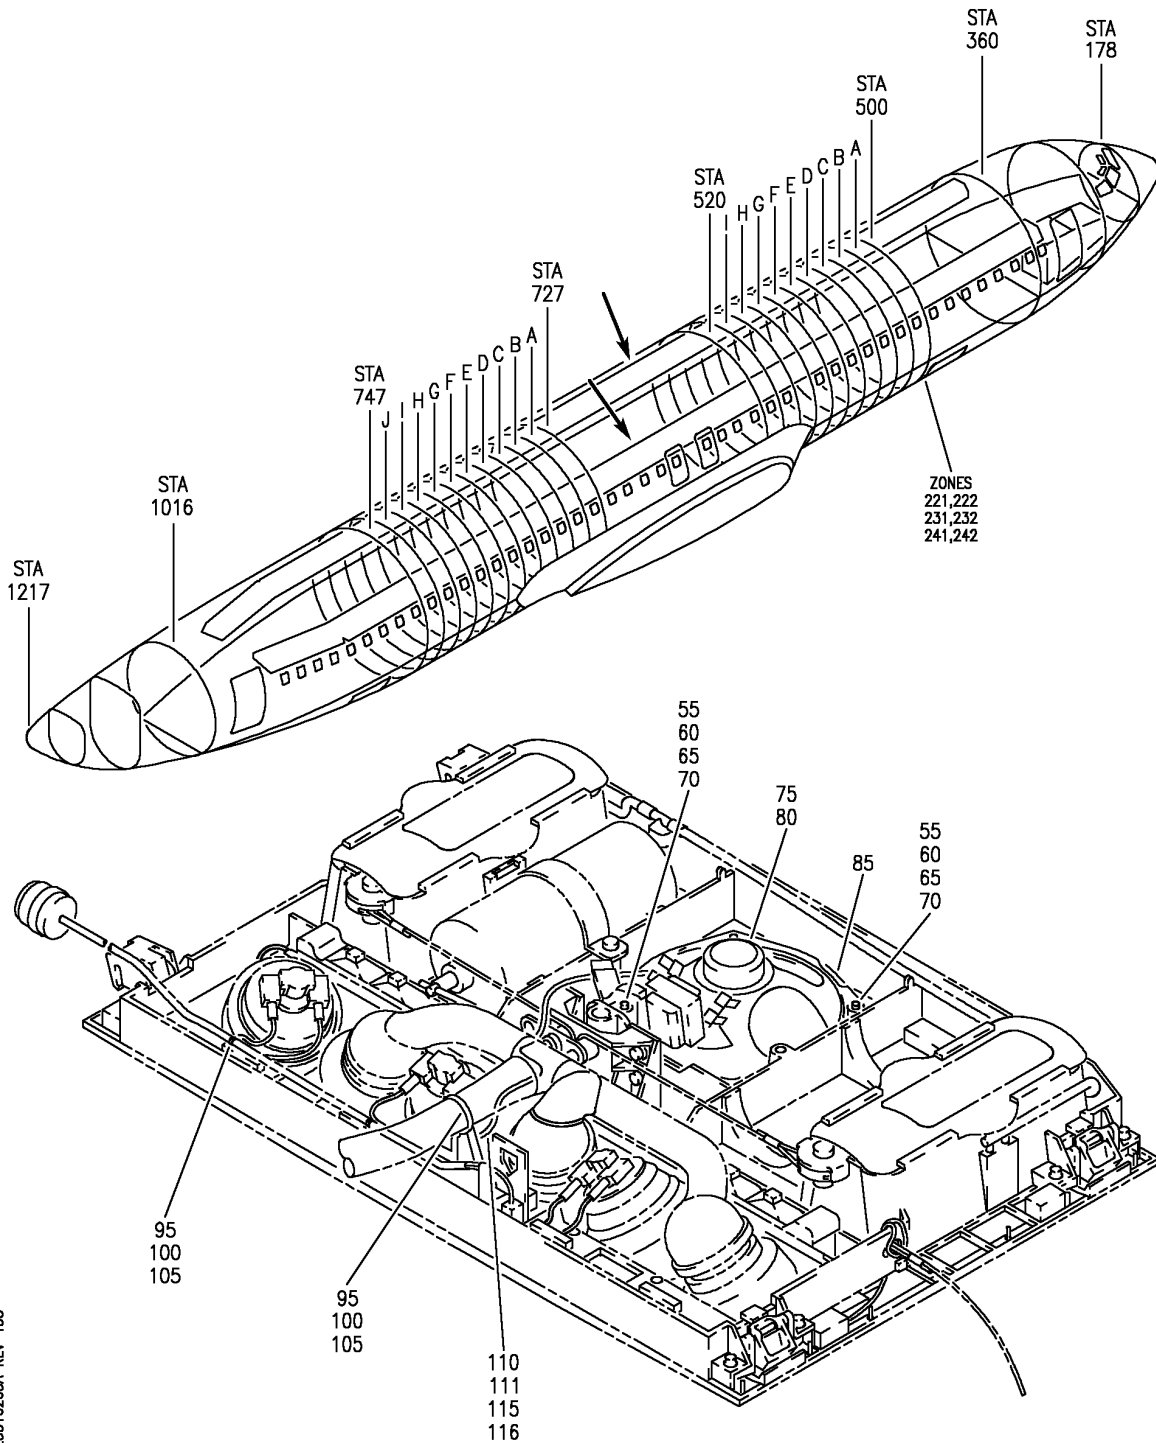

E 23310203A REV 155

SERVICE UNIT ASSY-WITH SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)
 FIGURE 3A

23-31-02-03A

HAP
 JUN 15/09

23-31-02-03A
 PAGE 0

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3A			SERVICE UNIT ASSY-WITH SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)	001030	
- 1	417N3011-201A		SERVICE UNIT ASSY-WITH SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-04 25-23-61-07A 25-23-61-22A 25-23-61-53A	001016	RF
- 1	417N3011-401B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-04 25-23-61-07A 25-23-61-22A 25-23-61-53A	001016	RF
- 1	417N3011-401B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-57	017030	RF
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-31-02-03A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 03A
 PAGE 1
 FEB 10/07

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3A					
- 1	417N3011-201A		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-57	017030	RF
- 10	417N3011-202SP		SERVICE UNIT ASSY-WITH SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 QUALIFIED I/W DATA: COLOR SUBJECT TO CUSTOMER PREFERENCE FOR NHA/OTHER SYS DET SEE: 25-23-61-04 25-23-61-07A 25-23-61-22A 25-23-61-53A	001016	RF
- 10	417N3011-402B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-57	017030	RF
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-31-02-03A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 03A
 PAGE 2
 FEB 10/07

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3A - 10	417N3011-202A		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-57	017030	RF
- 15	417N3011-202SP		SERVICE UNIT ASSY-WITH SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: RH STA 431.5 ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 PRE SERVICE BULLETIN: 25-1360 FOR NHA/OTHER SYS DET SEE: 25-23-61-07A	005005	RF
- 20	417N3011-202SP		SERVICE UNIT ASSY-WITH SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: RH STA 402.5 AND 460.5 ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 POST SERVICE BULLETIN: 25-1360 FOR NHA/OTHER SYS DET SEE: 25-23-61-07A	005005	RF
55	NAS514P832-11P	.SCREW		001030	2
65	BACN10YJ08	.NUT		001030	2
75	RDAM8018	.SPEAKER-		001030	1
		SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M10976 INTER/ACROSS MODEL I/W P/N: RDAM8005A VOFF57			
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-02-03A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 03A
 PAGE 3
 FEB 10/07

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
R R R R R R	3A 85 417N3104-2	.GASKET-SPKR MANUFACTURED FROM: SH RUBATEX R310V 0.125 X 7.0 IN DIA SPARES ORDER MATERIAL CODE: 5844067512	001030	1
	95 PLT2MM	.STRAP- SUPPLIER CODE: V06383 OPTIONAL PART: PLT2MM2 V06383	001030	AR
	95 PLT2MM2	.STRAP- SUPPLIER CODE: V06383 OPTIONAL PART: PLT2MM V06383	001030	AR
	115 53002	.WIRE BUNDLE- SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-101 USED ON: 417N3011-201A 417N3011-201SP 417N3011-202A 417N3011-202SP 417N3011-401B 417N3011-401SP 417N3011-402B 417N3011-402SP	001030	1
MISSING ITEM NUMBERS NOT APPLICABLE				

— ITEM NOT ILLUSTRATED


HAP

23-31-02-03A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 03A
 PAGE 4
 JUN 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

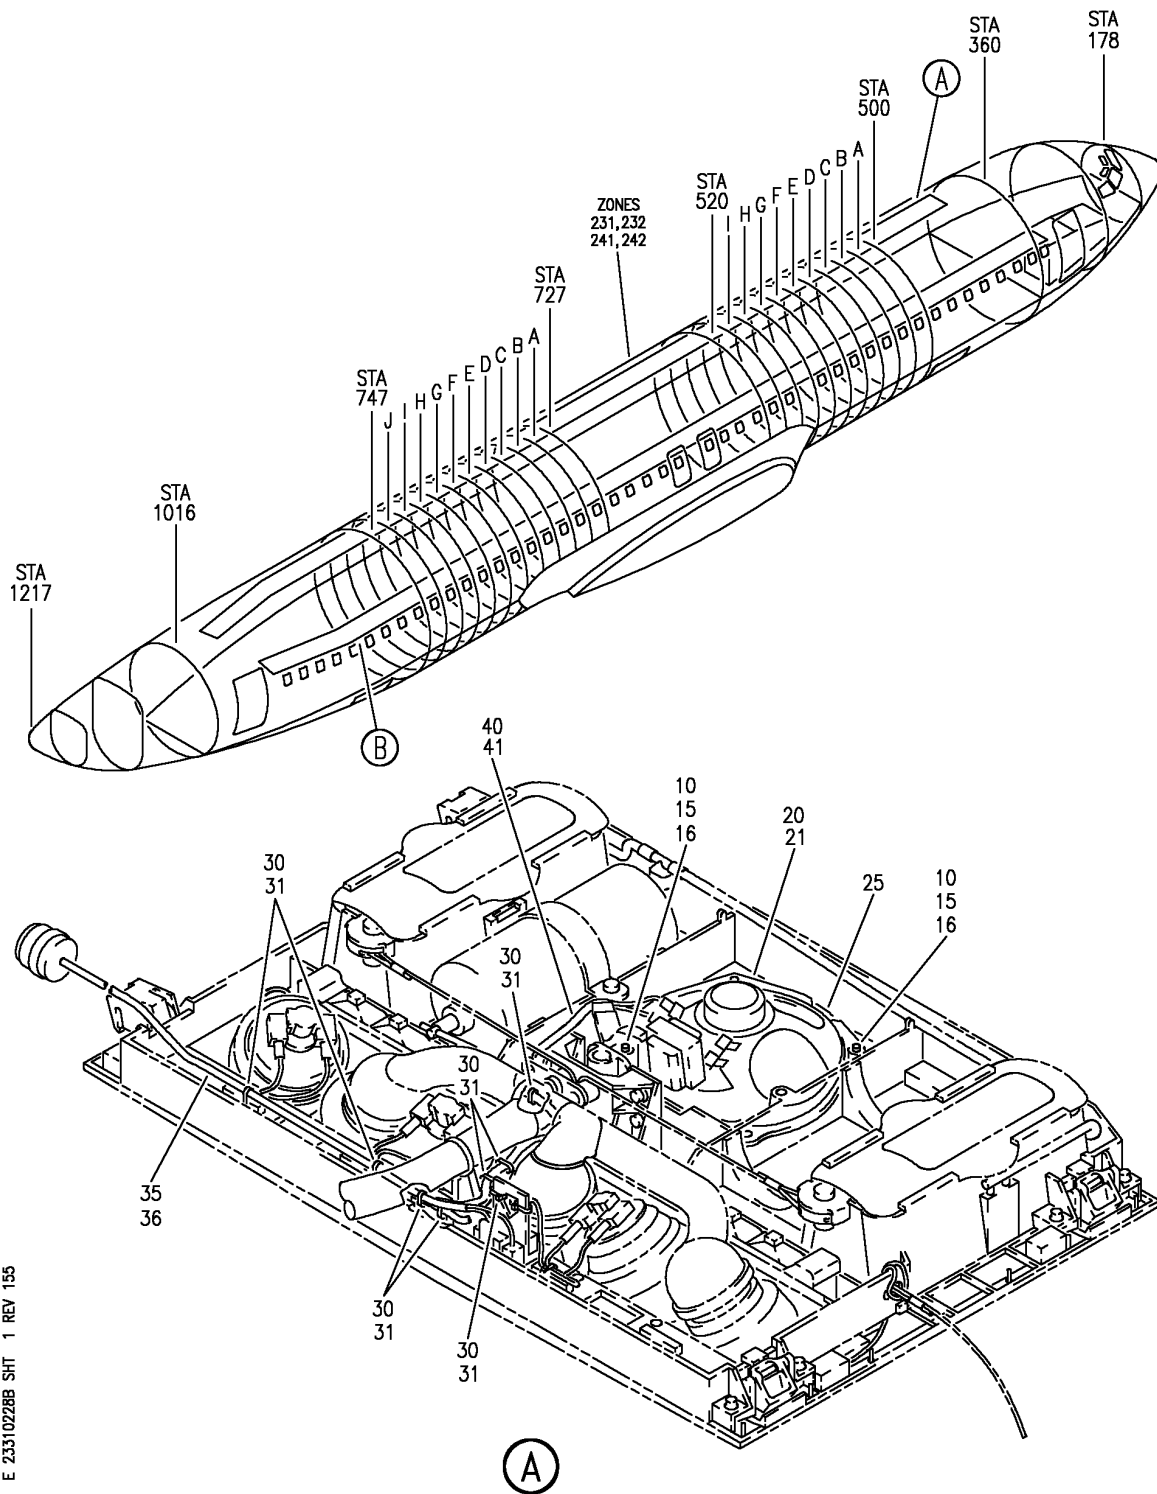

E 23310228B SHT 1 REV 155


SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)
FIGURE 28B (SHEET 1)

23-31-02-28B

HAP
JUN 15/09

23-31-02-28B
PAGE 0

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

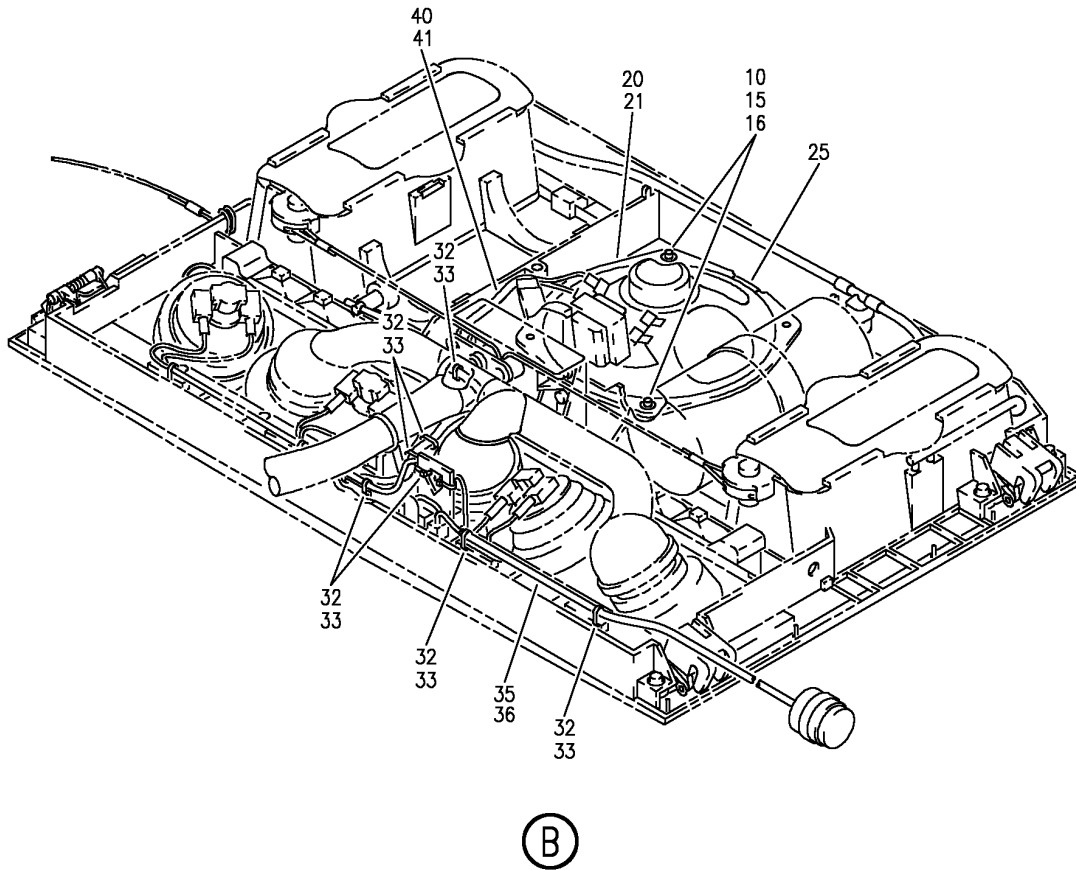

E 23310228B SHT 2 REV 155

SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)
FIGURE 28B (SHEET 2)

HAP
JUN 15/09

23-31-02-28B

23-31-02-28B
PAGE 0A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
28B			SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)	001037 039040	
- 1	417N3011-601B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-70M	031037 039040	RF
- 3	417N3011-601B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-57	017030	RF
- 3	417N3011-601SP		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-04 25-23-61-07A 25-23-61-22A 25-23-61-53A	001016	RF
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-02-28B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 28B
 PAGE 1
 OCT 15/08

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
28B - 5	417N3011-602B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-70M	031037 039040	RF
- 7	417N3011-602B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-57	017030	RF
- 7	417N3011-602SP		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-04 25-23-61-07A 25-23-61-22A 25-23-61-53A	001016	RF
10	NAS514P832-11P		.SCREW	001004 006030	2
10	NAS514P832-11P		.SCREW	005005 031037 039040	2
15	BACN10YJ08		.NUT	001004 006030	2
15	BACN10YJ08		.NUT	005005 031037 039040	2
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-02-28B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
FIG. 28B
PAGE 2
OCT 15/08

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
28B 20 20 25 30 30 30	RDAM8018	.	SPEAKER- SUPPLIER CODE: V0FF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M10976	001004 006030	1
	RDAM8018	.	SPEAKER- SUPPLIER CODE: V0FF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M10976	005005 031037 039040	1
	417N3104-2	.	GASKET-SPKR MANUFACTURED FROM: SH RUBATEX R310V 0.125 X 7.0 IN DIA SPARES ORDER MATERIAL CODE: 5844067512	001037 039040	1
	PLT2MM	.	STRAP- SUPPLIER CODE: V06383 POSITION DATA: LH SIDE OPTIONAL PART: PLT2MM2 V06383	001030	AR
	PLT2MM2	.	STRAP- SUPPLIER CODE: V06383 POSITION DATA: LH SIDE OPTIONAL PART: PLT2MM V06383	001030	AR
	PLT2MM	.	STRAP- SUPPLIER CODE: V06383 POSITION DATA: LH SIDE OPTIONAL PART: PLT2MM2 V06383	031037 039040	AR
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-31-02-28B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
FIG. 28B
PAGE 3
JUN 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
28B 30	PLT2MM2	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: LH SIDE OPTIONAL PART: PLT2MM V06383	031037 039040	AR
32	PLT2MM2	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: RH SIDE OPTIONAL PART: PLT2MM V06383	001004 006037 039040	AR
32	PLT2MM	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: RH SIDE OPTIONAL PART: PLT2MM2 V06383	001004 006037 039040	AR
32	PLT2MM2	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: RH SIDE OPTIONAL PART: PLT2MM V06383	005005	AR
32	PLT2MM	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: RH SIDE OPTIONAL PART: PLT2MM2 V06383	005005	AR
35	53002	.WIRE BUNDLE-	SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-101	001004 006030	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-31-02-28B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 28B
 PAGE 4
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
28B					
35	53002		.WIRE BUNDLE- SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-101	005005 031037 039040	1
40	53251		.WIRE BUNDLE- SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-203	001004 006030	1
40	53251		.WIRE BUNDLE- SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-203	005005 031037 039040	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-02-28B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 28B
 PAGE 5
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

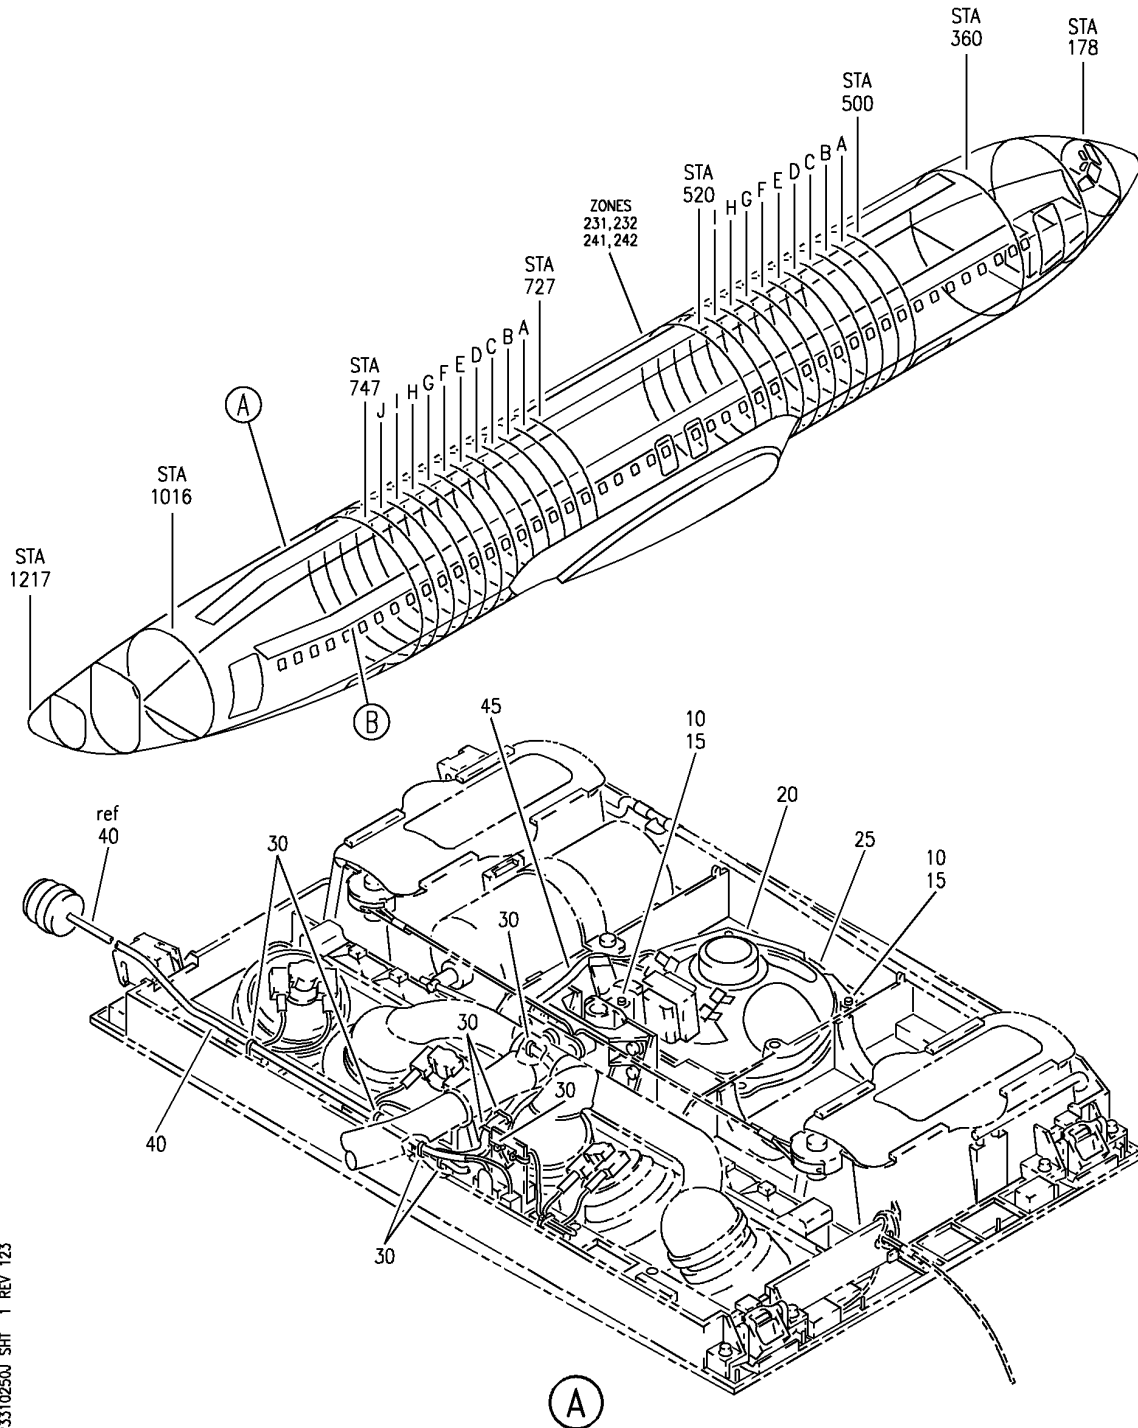

E 23310250J SHT 1 REV 123

SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)
FIGURE 50J (SHEET 1)


HAP
OCT 15/08

23-31-02-50J

23-31-02-50J
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

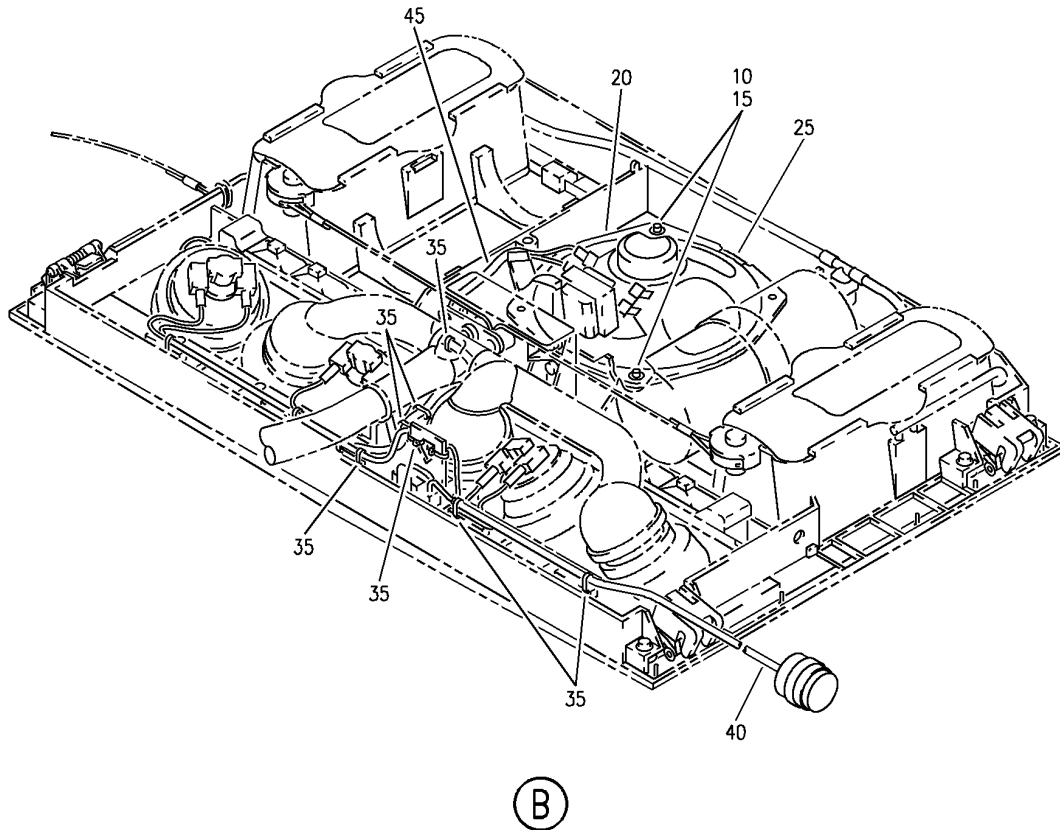

E 23310250J SHT 2 REV 123

SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)
FIGURE 50J (SHEET 2)

23-31-02-50J

HAP
OCT 15/08

23-31-02-50J
PAGE 0A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50J			SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)	048048	
- 1	417N3011-601B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-77Z	048048	RF
- 5	417N3011-602B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-77Z	048048	RF
10	NAS514P832-11P		.SCREW	048048	2
15	BACN10YJ08		.NUT	048048	2
20	RDAM8018		.SPEAKER- SUPPLIER CODE: V0FF57 SPECIFICATION NUMBER: 10-62232-01	048048	1
R R R R R R	25 417N3104-2		.GASKET-SPKR MANUFACTURED FROM: SH RUBATEX R310V 0.125 X 7.0 IN DIA SPARES ORDER MATERIAL CODE: 5844067512	048048	1
	30 PLT2MM2		.STRAP- SUPPLIER CODE: V06383 POSITION DATA: LH SIDE	048048	AR
	30 PLT2MM		.STRAP- SUPPLIER CODE: V06383 POSITION DATA: LH SIDE	048048	AR
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-02-50J

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
FIG. 50J
PAGE 1
JUN 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50J					
35	PLT2MM2		.STRAP- SUPPLIER CODE: V06383 POSITION DATA: RH SIDE	048048	AR
35	PLT2MM		.STRAP- SUPPLIER CODE: V06383 POSITION DATA: RH SIDE	048048	AR
40	53251		.WIRE BUNDLE- SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-203	048048	1
45	53002		.WIRE BUNDLE- SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-101	048048	1
MISSING ITEM NUMBERS NOT APPLICABLE					


— ITEM NOT ILLUSTRATED

HAP

23-31-02-50J


BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 50J
 PAGE 2
 OCT 15/08

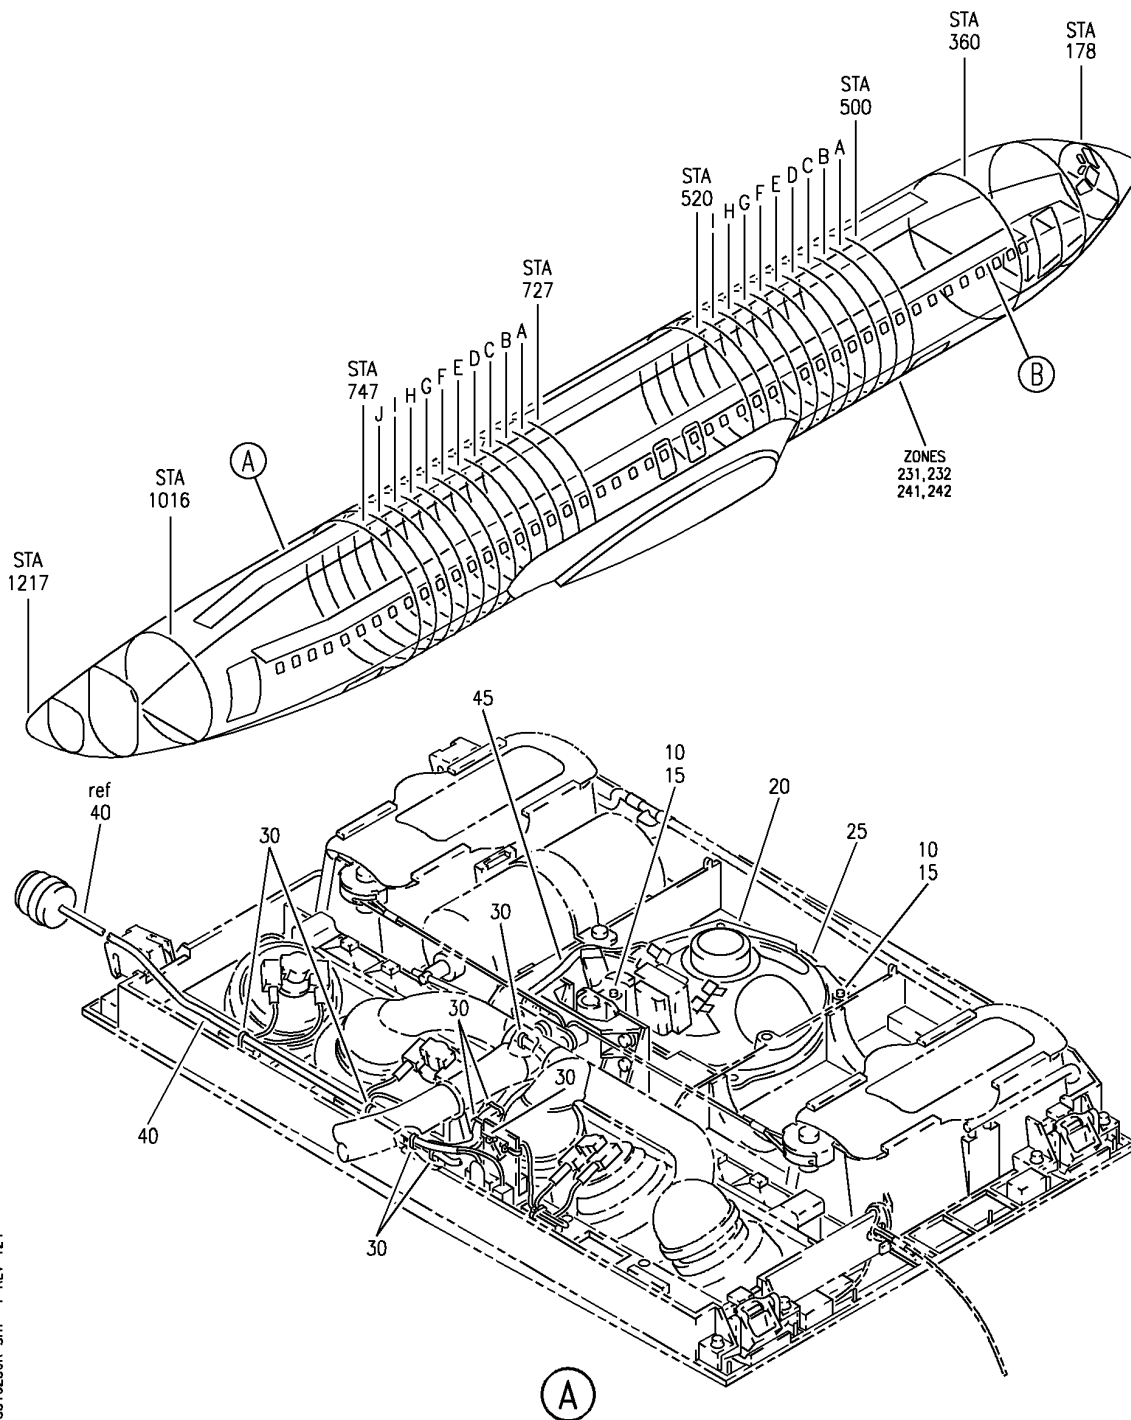

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

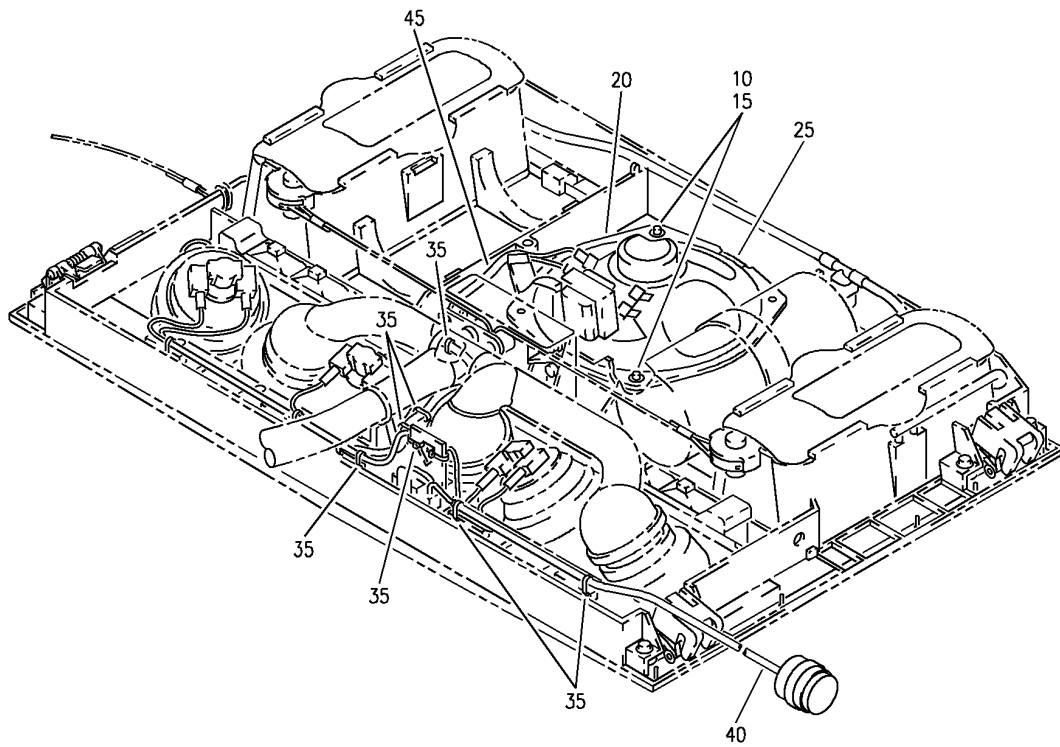

(B)

E 23310250R SHT 2 REV 124

SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)
FIGURE 50R (SHEET 2)

23-31-02-50R

HAP
FEB 10/07

23-31-02-50R
PAGE 0A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50R					
- 1	417N3011-601B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)	038038 041047 049100	RF
			SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)	038038 041047 049100	
			POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-72G 25-23-61-75H		
- 5	417N3011-602B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)	038038 041047 049100	RF
			SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)	038038 041047 049100	
			POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-72G 25-23-61-75H		
10	NAS514P832-11P		.SCREW	038038 041047 049100	2
15	BACN10YJ08		.NUT	038038 041047 049100	2
20	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01	038038 041047 049100	1
25	417N3104-2		.GASKET-SPKR MANUFACTURED FROM: SH RUBATEX R310V 0.125 X 7.0 IN DIA SPARES ORDER MATERIAL CODE: 5844067512	038038 041047 049100	1
30	PLT2MM2		.STRAP- SUPPLIER CODE: V06383 POSITION DATA: LH SIDE	038038 041047 049100	AR
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-02-50R

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
FIG. 50R
PAGE 1
JUN 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
50R					
30	PLT2MM	.	STRAP- SUPPLIER CODE: V06383 POSITION DATA: LH SIDE	038038 041047 049100	AR
35	PLT2MM2	.	STRAP- SUPPLIER CODE: V06383 POSITION DATA: RH SIDE OPTIONAL PART: PLT2MM V06383	038038 041047 049100	AR
35	PLT2MM	.	STRAP- SUPPLIER CODE: V06383 POSITION DATA: RH SIDE OPTIONAL PART: PLT2MM2 V06383	038038 041047 049100	AR
40	53251	.	WIRE BUNDLE- SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-203	038038 041047 049100	1
45	53002	.	WIRE BUNDLE- SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-101	038038 041047 049100	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-02-50R

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 50R
 PAGE 2
 JUN 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

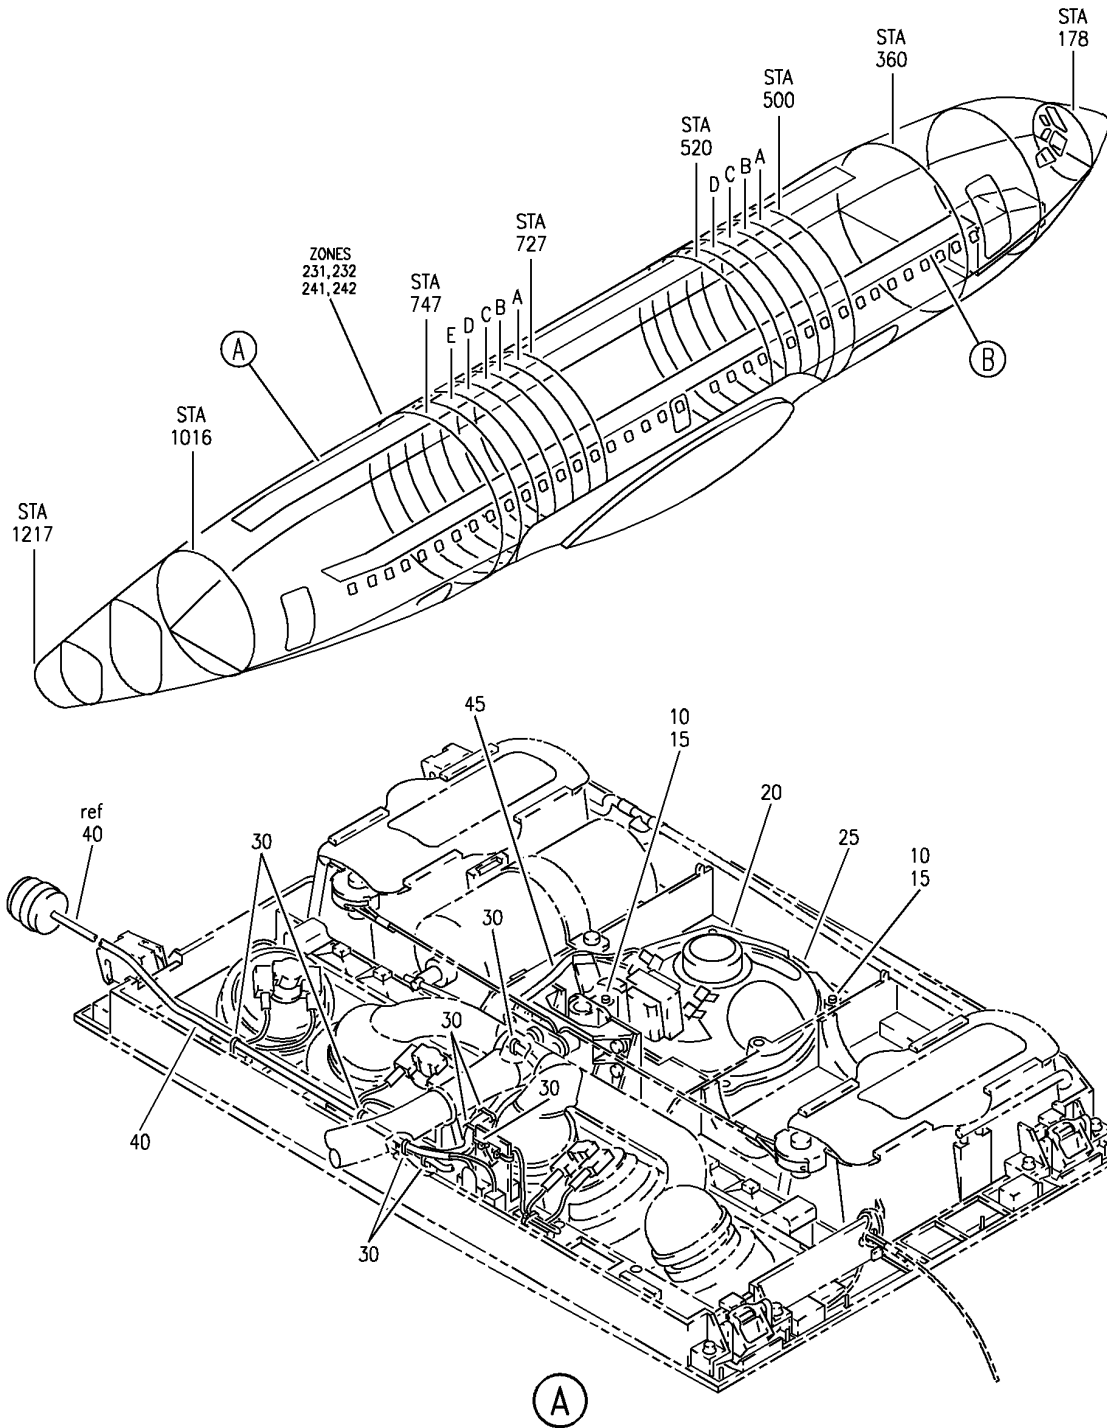

E 23310251B SHT 1 REV 126

SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)
FIGURE 51B (SHEET 1)


HAP
FEB 10/07

23-31-02-51B

23-31-02-51B
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

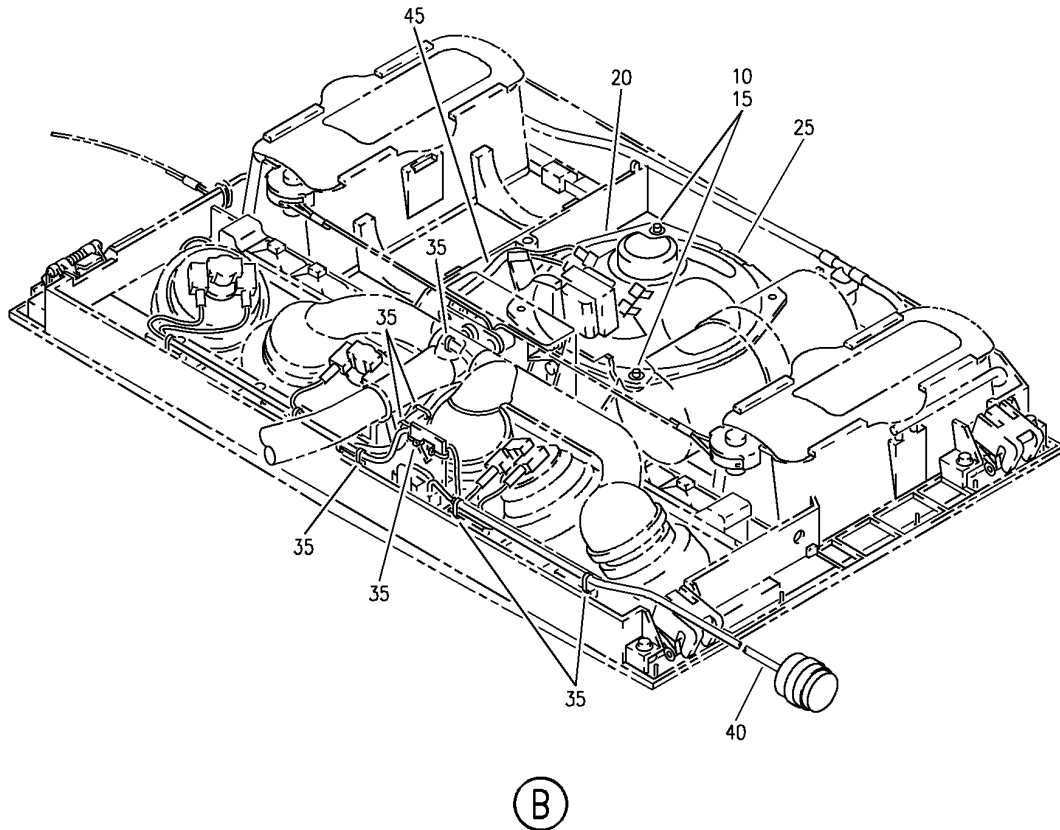

E 23310251B SHT 2 REV 126

SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)
FIGURE 51B (SHEET 2)

HAP
FEB 10/07

23-31-02-51B

23-31-02-51B
PAGE 0A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
51B			SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY)	101200 968999	
- 1	417N3011-601B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-72T	101200 968999	RF
- 5	417N3011-602B		SERVICE UNIT ASSY-WITH 2K SPKR AND GASPER PASS. (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-72T	101200 968999	RF
10	NAS514P832-11P		.SCREW	101200 968999	2
15	BACN10YJ08		.NUT	101200 968999	2
20	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01	101200 968999	1
25	417N3104-2		.GASKET-SPKR MANUFACTURED FROM: SH RUBATEX R310V 0.125 X 7.0 IN DIA SPARES ORDER MATERIAL CODE: 5844067512	101200 968999	1
30	PLT2MM2		.STRAP- SUPPLIER CODE: V06383 POSITION DATA: LH SIDE	101200 968999	AR
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-02-51B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
FIG. 51B
PAGE 1
JUN 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
51B 30	PLT2MM	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: LH SIDE	101200 968999	AR
35	PLT2MM2	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: RH SIDE	101200 968999	AR
35	PLT2MM	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: RH SIDE	101200 968999	AR
40	53251	.WIRE BUNDLE-	SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-203	101200 968999	1
45	53002	.WIRE BUNDLE-	SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-101	101200 968999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-02-51B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 51B
 PAGE 2
 JUN 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

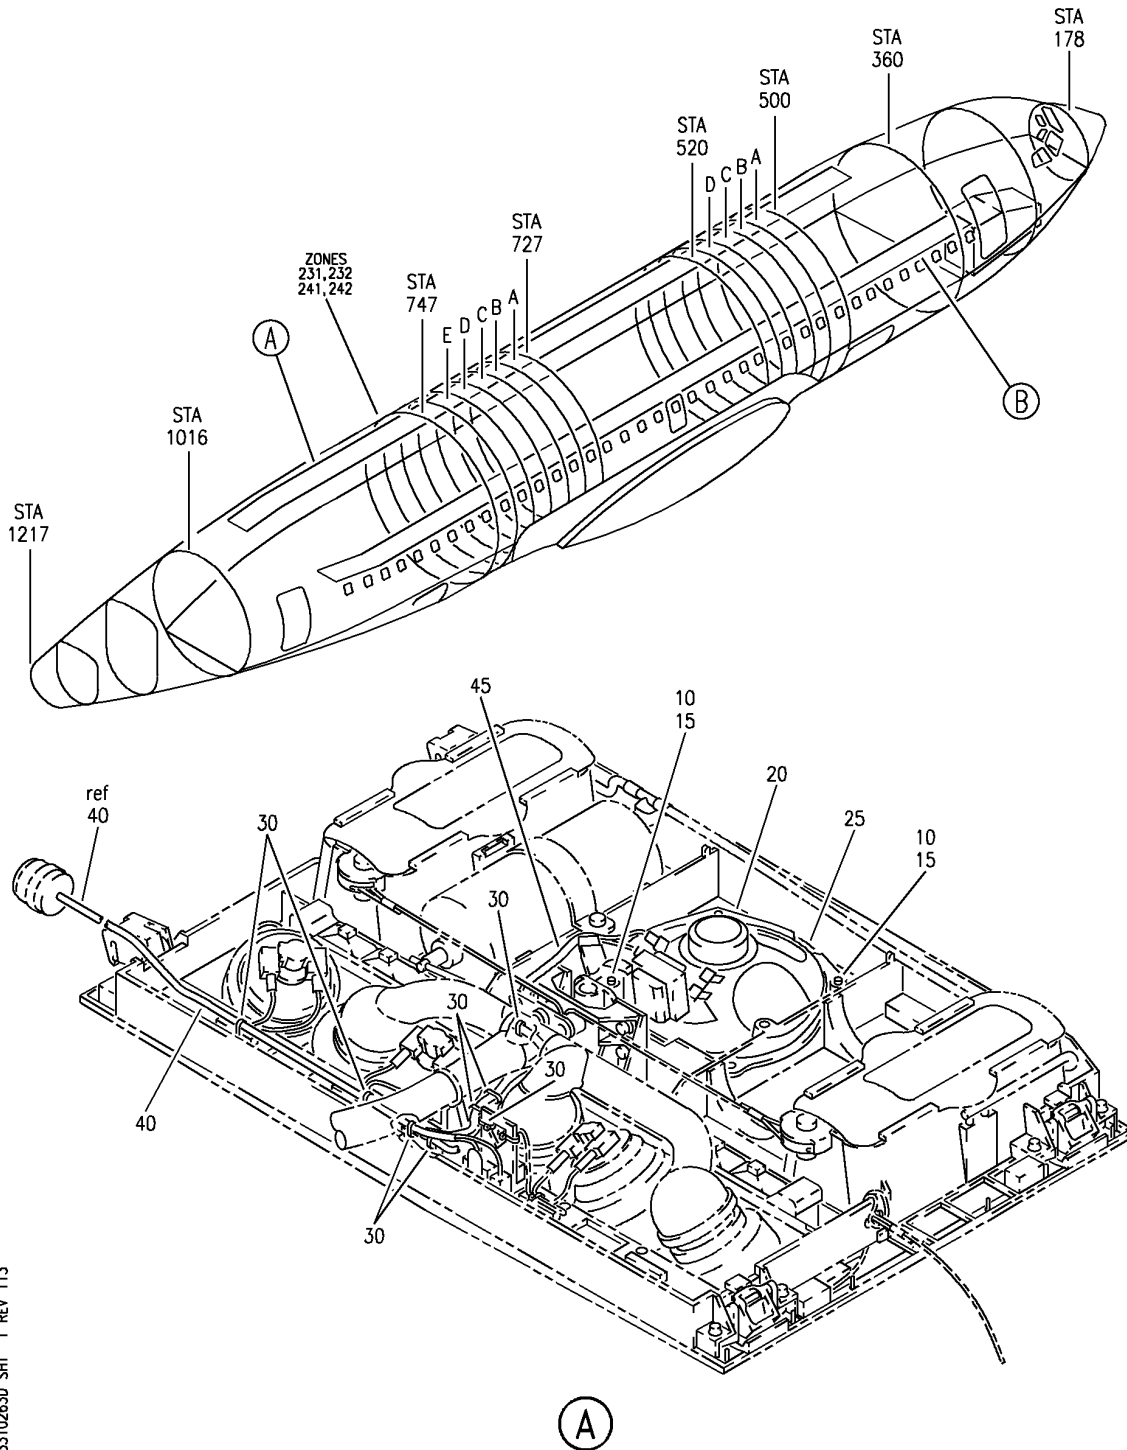

E 23310263D SHT 1 REV 113

SERVICE UNIT ASSY-PASS. WITH 2K SPKR AND GASPER (COMMUNICATIONS ONLY)
FIGURE 63D (SHEET 1)


HAP
OCT 15/08

23-31-02-63D

23-31-02-63D
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

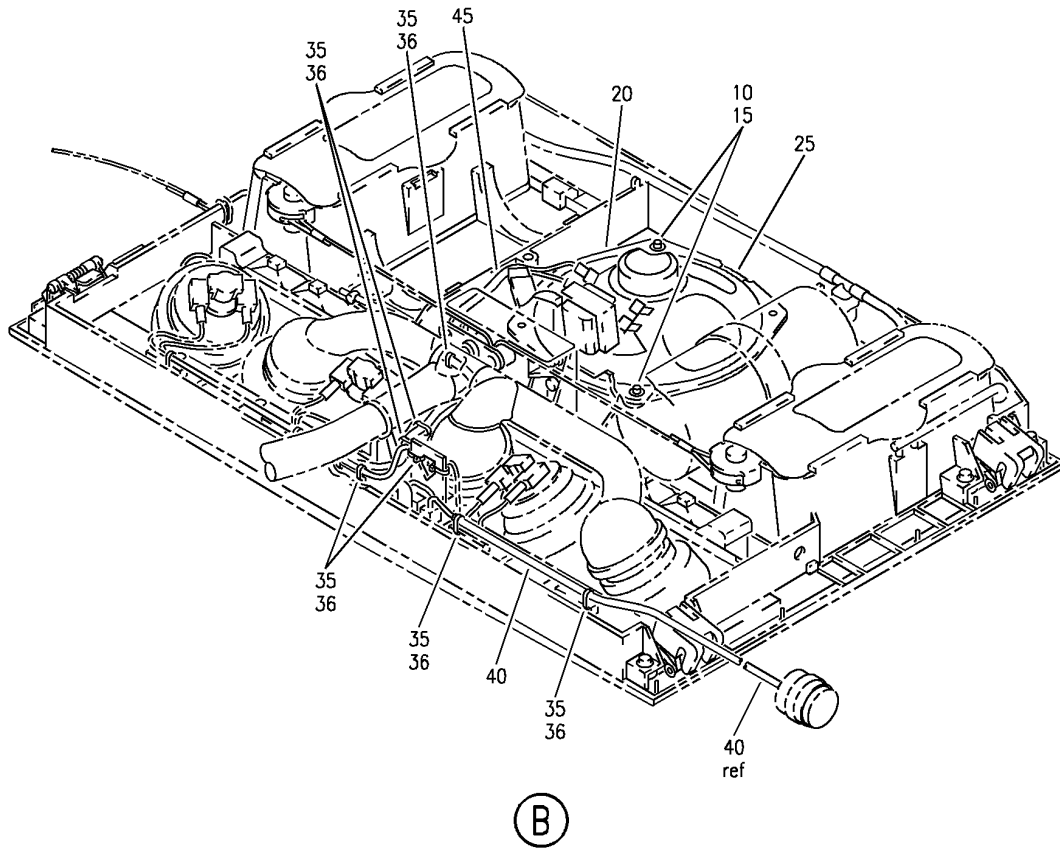

(B)

E 23310263D SHT 2 REV 113

SERVICE UNIT ASSY-PASS. WITH 2K SPKR AND GASPER (COMMUNICATIONS ONLY)
FIGURE 63D (SHEET 2)

23-31-02-63D

HAP
OCT 15/08

23-31-02-63D
PAGE 0A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
63D			SERVICE UNIT ASSY-PASS. WITH 2K SPKR AND GASPER (COMMUNICATIONS ONLY)	201967	
- 1	417N3011-601SP		SERVICE UNIT ASSY-PASS. WITH 2K SPKR AND GASPER (COMMUNICATIONS ONLY) POSITION DATA: LH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-29	201967	RF
- 5	417N3011-602SP		SERVICE UNIT ASSY-PASS. WITH 2K SPKR AND GASPER (COMMUNICATIONS ONLY) POSITION DATA: RH ELECTRICAL EQUIP NUMBER: M10973 COMPONENT MAINT MANUAL REF: 25-23-38 FOR NHA/OTHER SYS DET SEE: 25-23-61-29	201967	RF
10	NAS514P832-11P		.SCREW	201967	2
15	BACN10YJ08		.NUT	201967	2
20	RDAM8018		.SPEAKER- SUPPLIER CODE: V0FF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M10976	201967	1
R R R R R R	25 417N3104-2		.GASKET-SPKR MANUFACTURED FROM: SH RUBATEX R310V 0.125 X 7.0 IN DIA SPARES ORDER MATERIAL CODE: 5844067512	201967	1
	30 PLT2MM		.STRAP- SUPPLIER CODE: V06383 POSITION DATA: LH SIDE OPTIONAL PART: PLT2MM2 V06383	201967	AR
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-02-63D

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
FIG. 63D
PAGE 1
JUN 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
63D 30	PLT2MM2	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: LH SIDE OPTIONAL PART: PLT2MM V06383	201967	AR
35	PLT2MM	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: RH SIDE OPTIONAL PART: PLT2MM2 V06383	201967	AR
35	PLT2MM2	.STRAP-	SUPPLIER CODE: V06383 POSITION DATA: RH SIDE OPTIONAL PART: PLT2MM V06383	201967	AR
40	53251	.WIRE BUNDLE-	SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-203	201967	1
45	53002	.WIRE BUNDLE-	SUPPLIER CODE: V16115 SPECIFICATION NUMBER: S417N313-101	201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-02-63D

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-02
 FIG. 63D
 PAGE 2
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

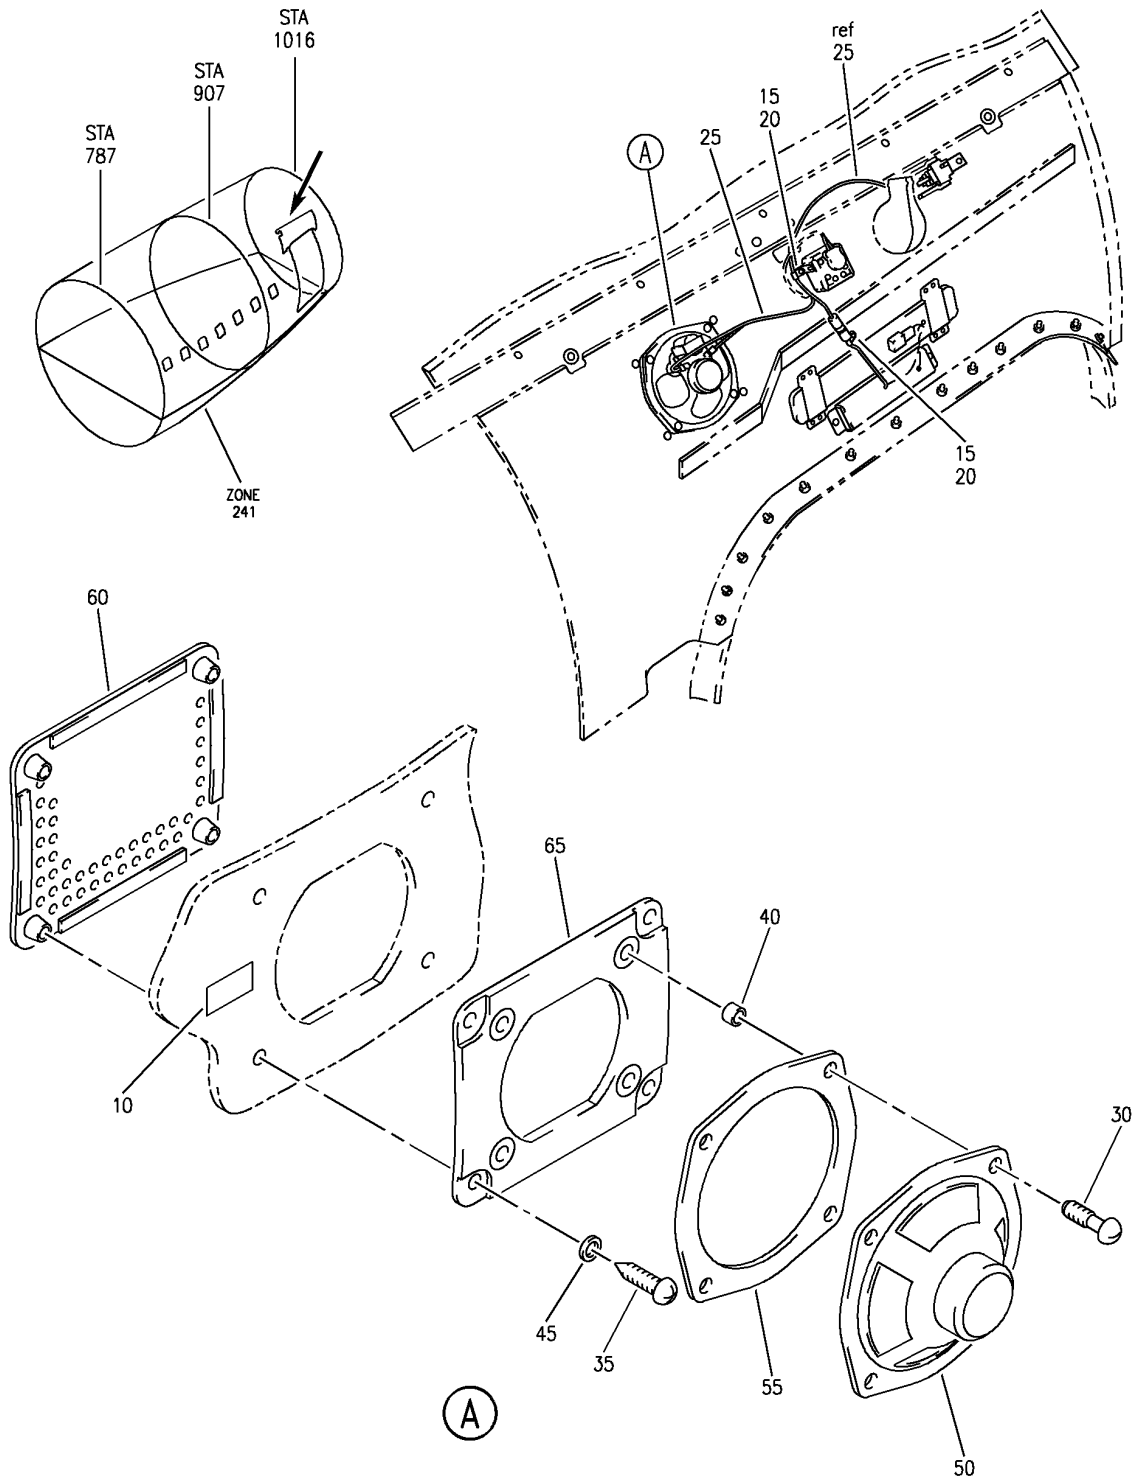

E 23310302 REV 123

PANEL ASSY-AFT LH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 2

23-31-03-02

HAP
OCT 10/07

23-31-03-02
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			PANEL ASSY-AFT LH DOORWAY LINING (COMMUNICATIONS ONLY)	001027 201967	
- 1	411A2213-22SP		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: LH FOR NHA/OTHER SYS DET SEE: 25-21-24-12	001027 201967	RF
10	BAC27DEL1299		.DECAL- PLACARD CONTENT: M1212 SPEAKER	001027 201967	1
15	BACS12FA3K5		.SCREW	001027 201967	RF
20	BACC10DK2		.CLAMP	001027 201967	RF
25	286A0452-001		.WIRE BUNDLE ASSY	001027 201967	RF
30	BACS12FA3K7		.SCREW	001027 201967	4
35	MS21207-6-10		.SCREW	001027 201967	4
40	NAS1057T3-025		.SPACER	001027 201967	4
45	BACW10CT5J		.WASHER	001027 201967	4
50	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 INTER/ACROSS MODEL I/W P/N: RDAM8005A VOFF57	001027 201967	1
50	RDAM8005A		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101	001027 201967	1
55	411A2228-1SP		.GASKET-	001027 201967	1
60	411A2226-2SP		.GRILL-	001027 201967	1
65	411A2218-22		.SPACER ASSY	001027 201967	1
- 70	SL6224-3A		..INSERT- SUPPLIER CODE: V97393	001027 201967	4
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-03-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
 FIG. 02
 PAGE 1
 OCT 15/08

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2 75	411A2228-7		. . SPACER	001027 201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED



HAP

23-31-03-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
 FIG. 02
 PAGE 2
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

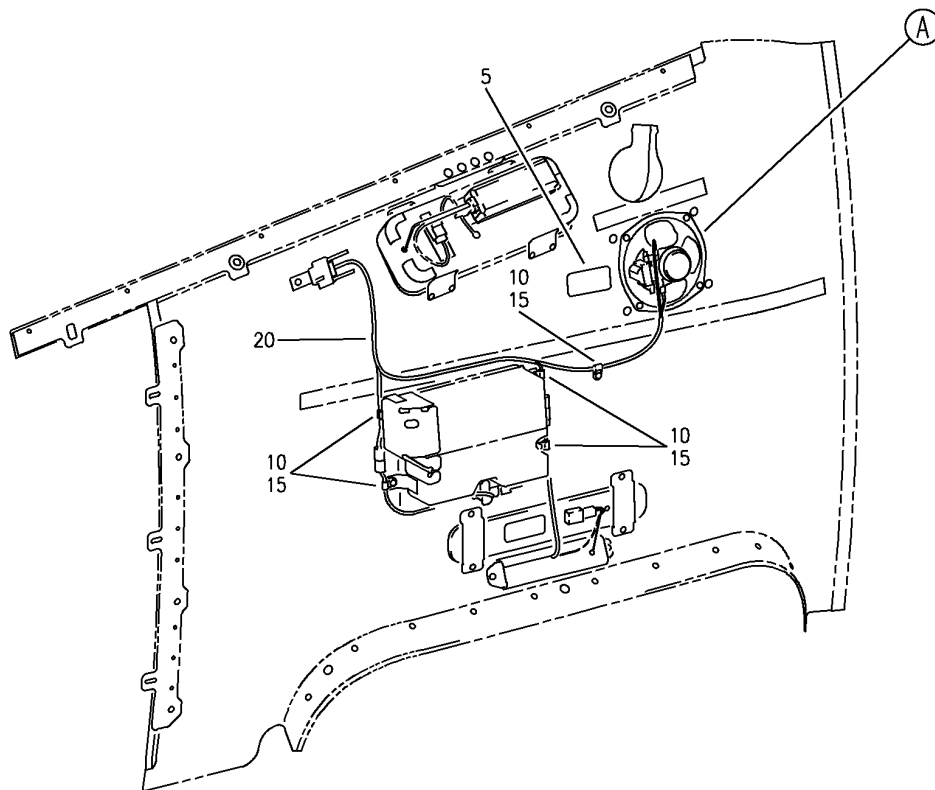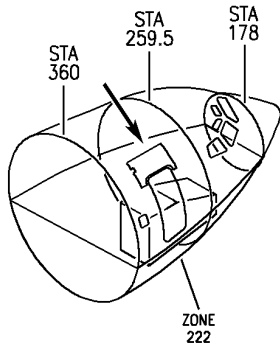

E 23310313A SHT 1 REV 125

PANEL ASSY-FWD RH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 13A (SHEET 1)


23-31-03-13A

HAP
FEB 10/07

23-31-03-13A
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

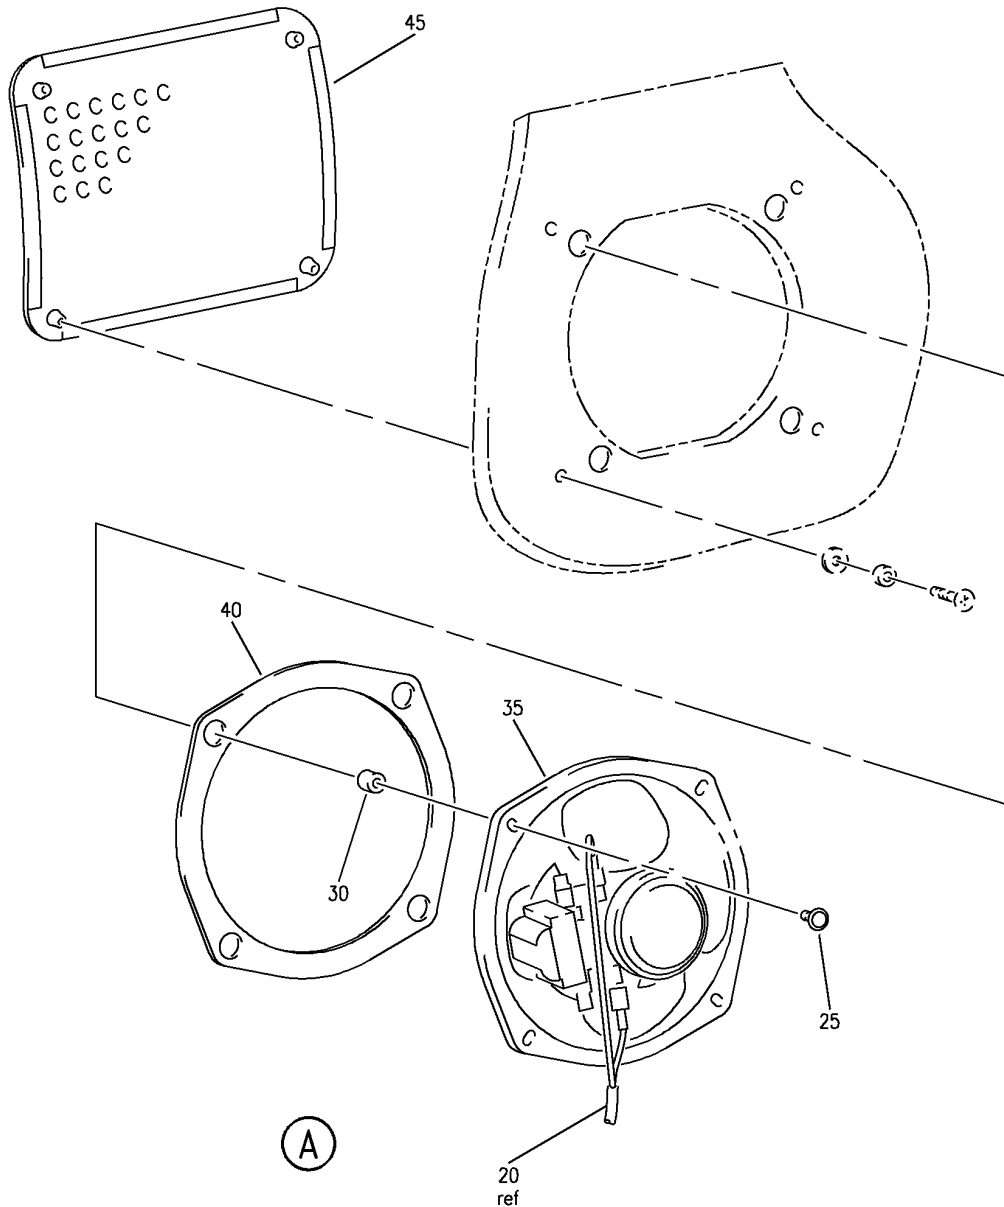

E 23310313A SHT 2 REV 125

PANEL ASSY-FWD RH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 13A (SHEET 2)

23-31-03-13A

HAP
FEB 10/07

23-31-03-13A
PAGE 0A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
13A			PANEL ASSY-FWD RH DOORWAY LINING (COMMUNICATIONS ONLY)	001027 201967	
- 1	411A2212-21B		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: FWD RH FOR NHA/OTHER SYS DET SEE: 25-21-34-01	001001 006007	RF
- 1	411A2212-27B		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: FWD RH FOR NHA/OTHER SYS DET SEE: 25-21-34-01	002005 008011 201967	RF
- 1	411A2212-35B		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: FWD RH FOR NHA/OTHER SYS DET SEE: 25-21-34-01	012027	RF
5	BAC27DEL1298		.MARKER- PLACARD CONTENT: M1464 SPEAKER	001027 201967	1
10	BACS12FA3K5		.SCREW	001027 201967	RF
15	BACC10DK2		.CLAMP	001027 201967	RF
20	286A0342-002		.WIRE BUNDLE ASSY	001027 201967	RF
25	BACS12FA3K7		.SCREW	001027 201967	4
30	NAS1057T3-025		.SPACER	001027 201967	4
35	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M01464	001027 201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-03-13A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
 FIG. 13A
 PAGE 1
 OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
13A 35	RDAM8005A		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101 ELECTRICAL EQUIP NUMBER: M01464 MAINTENANCE MANUAL REF: 23-31-03	001027 201967	1
40	411A2228-1A		.GASKET	001027 201967	1
45	411A2226-1A		.GRILL	001027 201967	1
			ATTACHING PARTS		
- 50	MS21207-6-6		.SCREW	001027 201967	4
- 55	BACW10CT5J		.WASHER	001011 201967	4
- 55	BACW10EG5J		.WASHER	012027	4
- 60	BACW10P75AL		.WASHER	001027 201967	4
			-----*-----		
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-03-13A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
 FIG. 13A
 PAGE 2
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

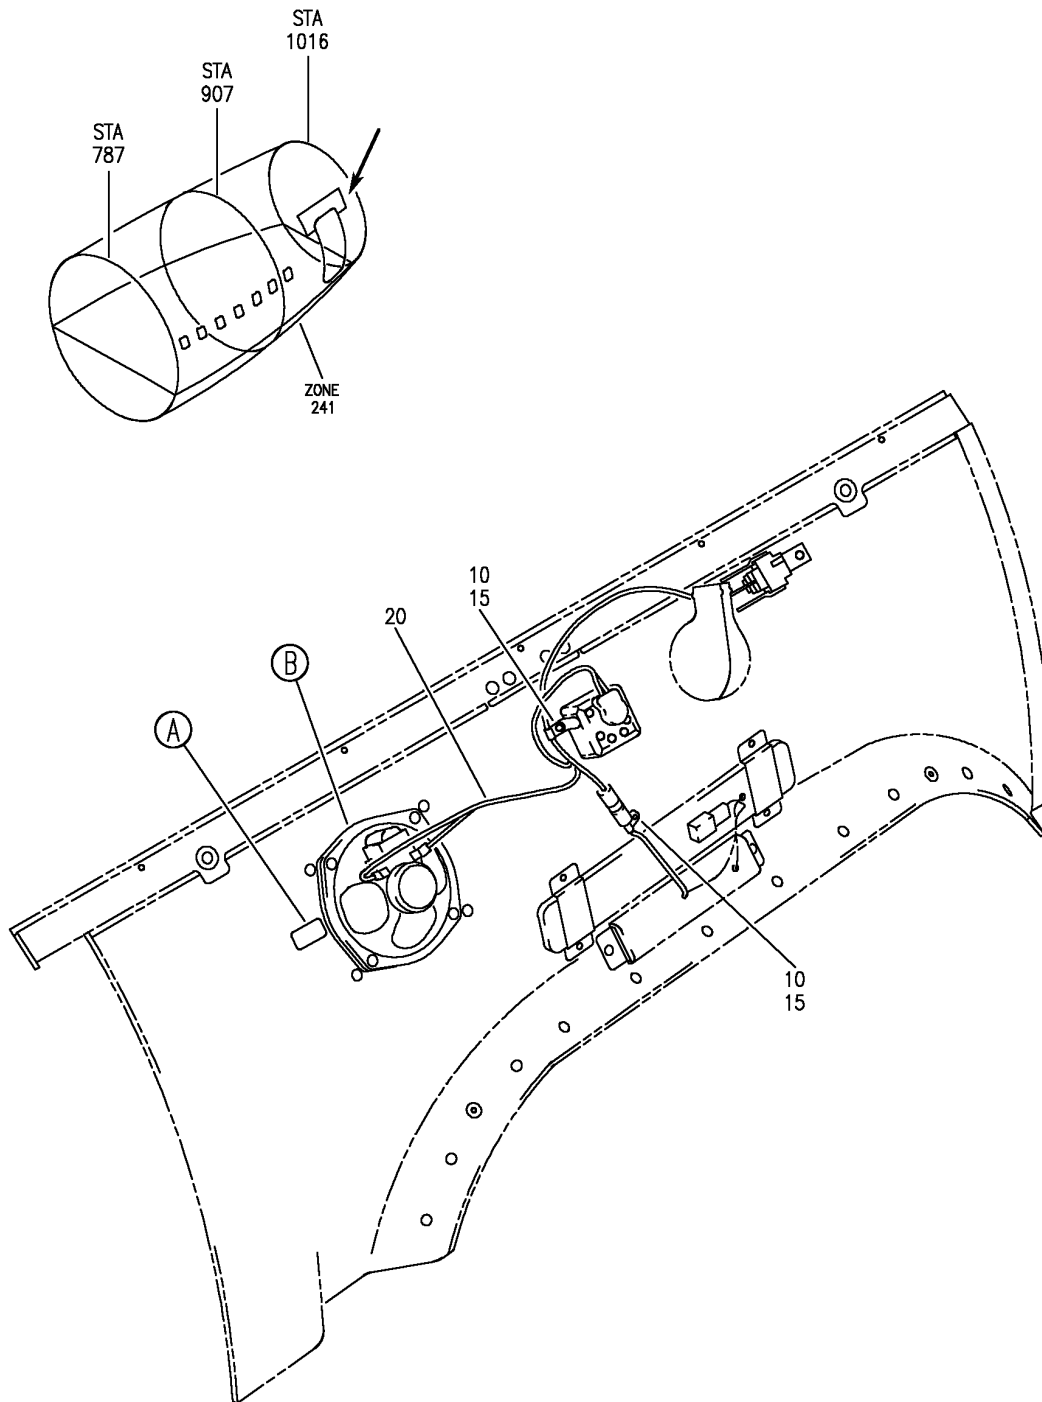


E 23310324 SHT 1 REV 124

PANEL ASSY-AFT LH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 24 (SHEET 1)

23-31-03-24

HAP
FEB 10/07

23-31-03-24
PAGE 0

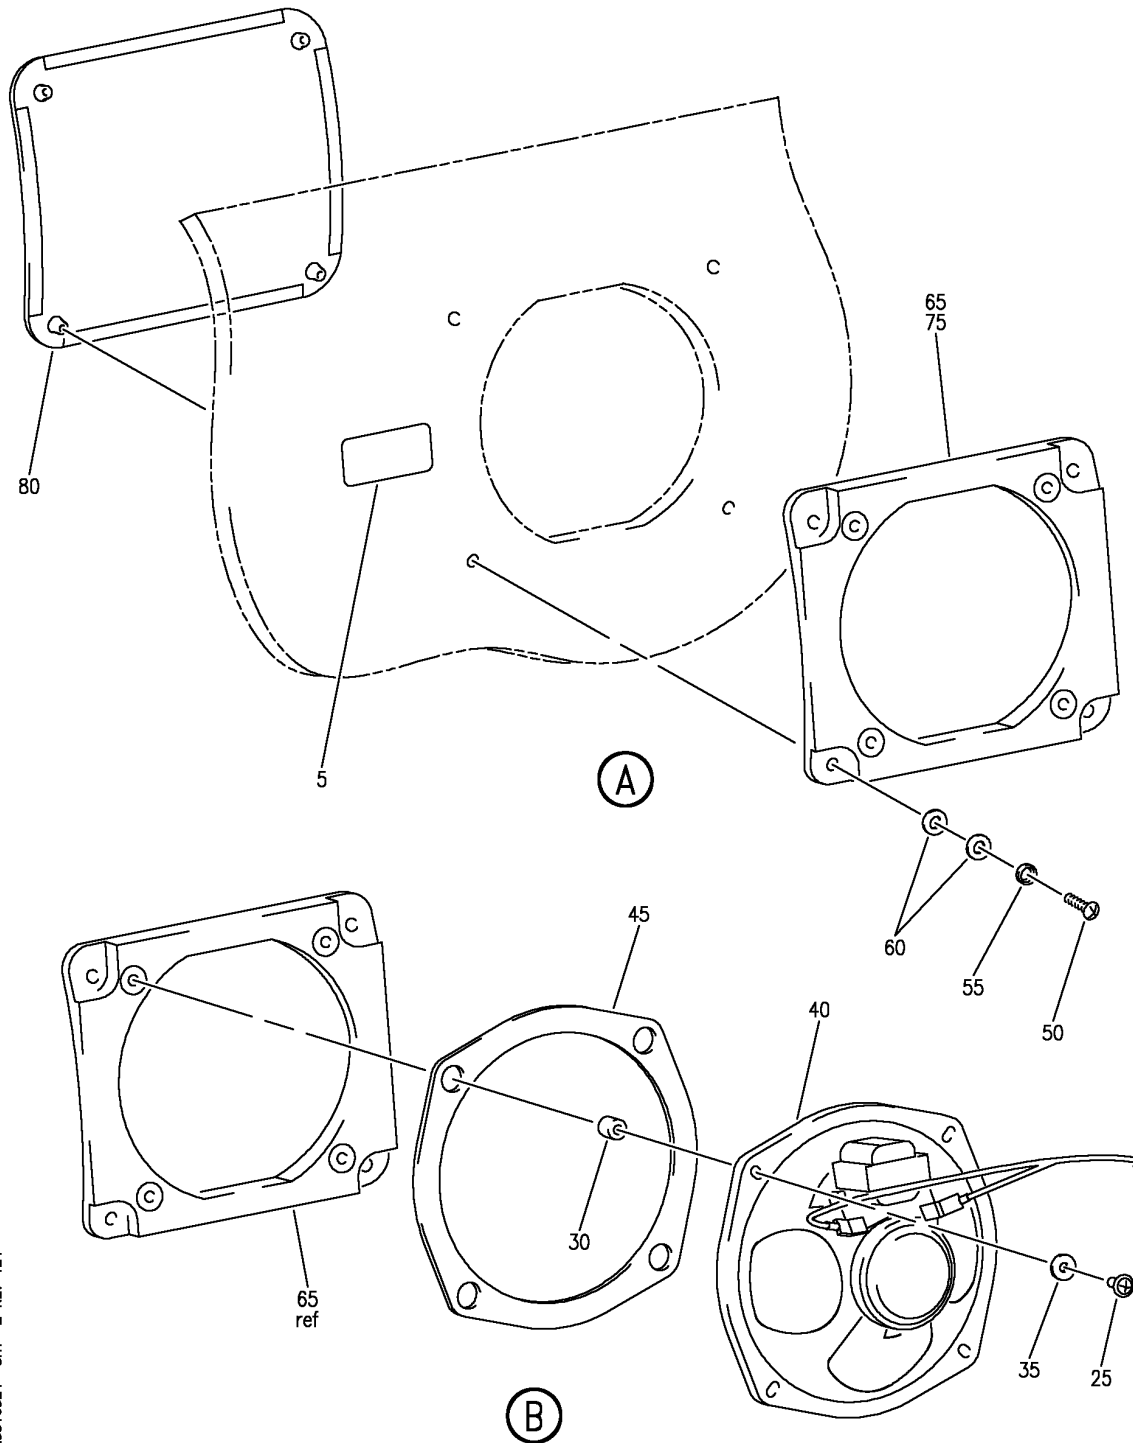

E 23310324 SHT 2 REV 124

PANEL ASSY-AFT LH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 24 (SHEET 2)

23-31-03-24

HAP
FEB 10/07

23-31-03-24
PAGE 0A

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
24			PANEL ASSY-AFT LH DOORWAY LINING (COMMUNICATIONS ONLY)	028200 968999	
R - 1	411A2213-29B		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: AFT LH FOR NHA/OTHER SYS DET SEE: 25-21-24-01	028200 968999	RF
R					
R					
R					
R					
	5	BAC27DEL1299	.DECAL- PLACARD CONTENT: M1212 SPEAKER	028200 968999	1
	10	BACS12FA3K5	.SCREW	028200 968999	RF
	15	BACC10DK3	.CLAMP- OPTIONAL PART: BACC10DK4	028200 968999	RF
	15	BACC10DK4	.CLAMP- OPTIONAL PART: BACC10DK3	028200 968999	RF
	20	286A0452-004	.WIRE BUNDLE ASSY	028200 968999	RF
	25	BACS12CK3-8	.SCREW	028200 968999	4
	30	NAS1057T3-025	.SPACER	028200 968999	4
R	35	BACW10EC3C	.WASHER	028200 968999	4
R	40	RDAM8018	.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 INTER/ACROSS MODEL I/W P/N: RDAM8005A VOFF57	028200 968999	1
R	45	411A2228-1A	.GASKET	028200 968999	1
R	50	MS51861-26	.SCREW	028200 968999	4
	55	BACW10EG5J	.WASHER	028200 968999	4
	60	BACW10P75AL	.WASHER	028200 968999	8
	65	411A2218-22	.SPACER ASSY	028200 968999	1
-	70	SL6224-3A	..INSERT- SUPPLIER CODE: V97393	028200 968999	4
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-03-24

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
FIG. 24
PAGE 1
JUN 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

	FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
R R	24					
	75	411A2228-7	. .	SPACER	028200 968999	1
	80	411A2226-2A	. GRILL		028200 968999	1
MISSING ITEM NUMBERS NOT APPLICABLE						


— ITEM NOT ILLUSTRATED

HAP

23-31-03-24
 BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
 FIG. 24
 PAGE 2
 JUN 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

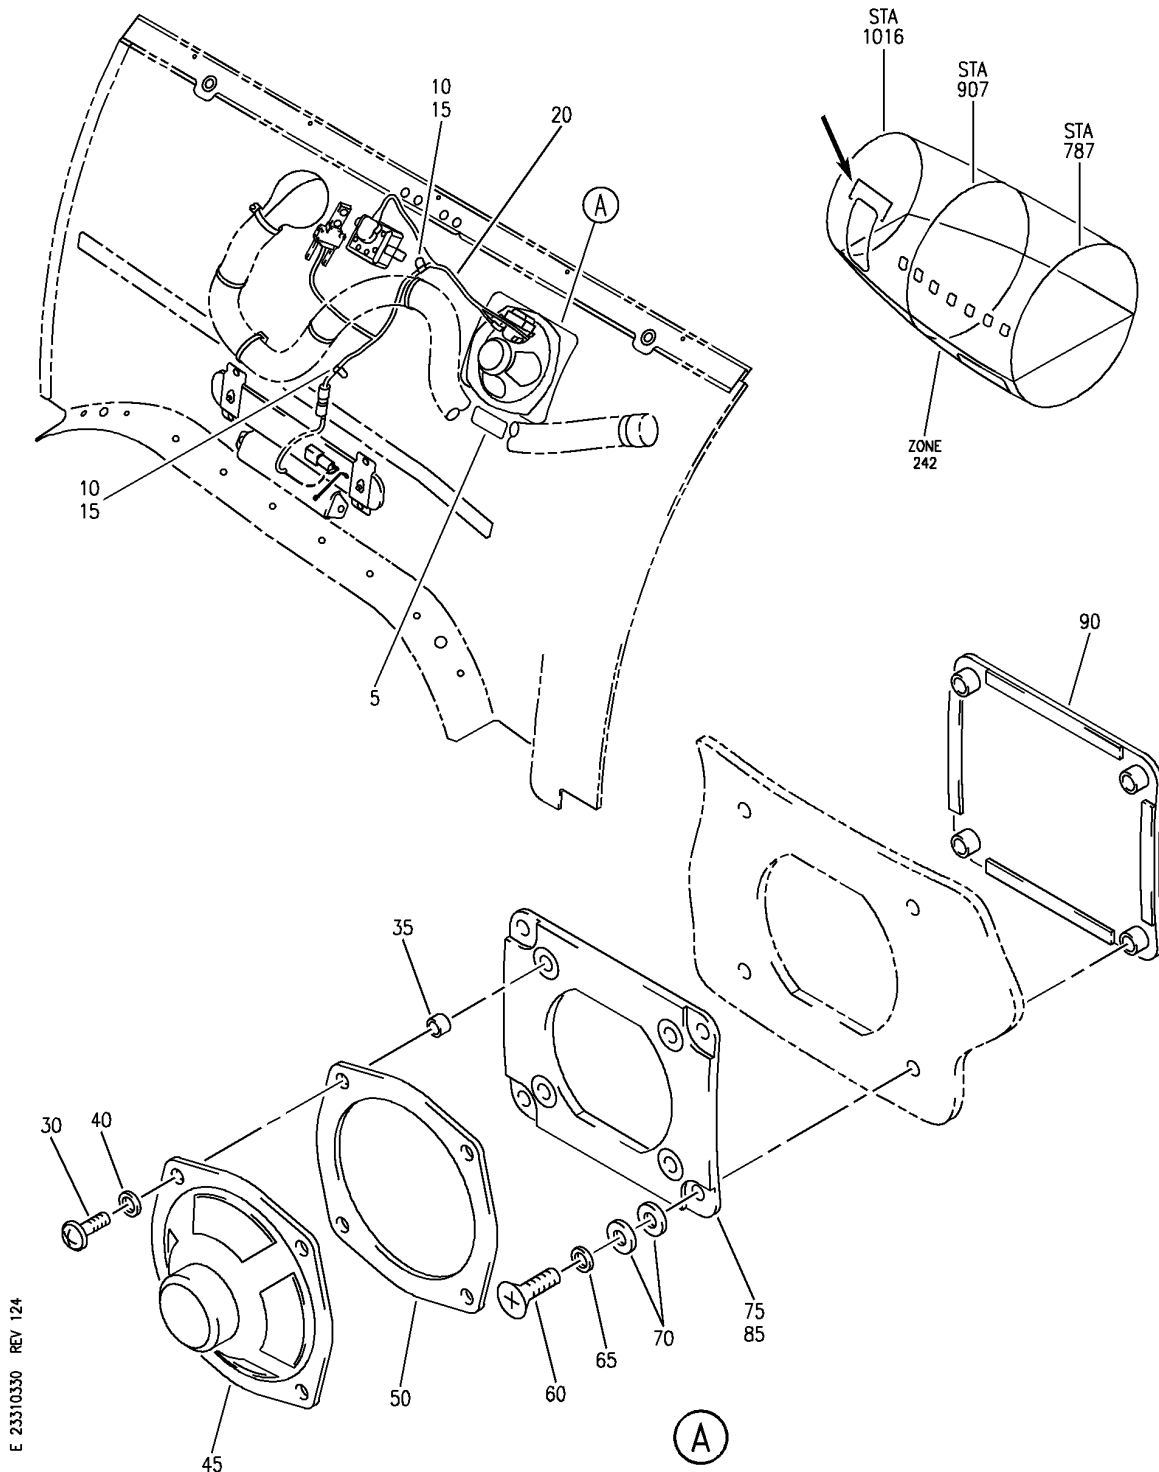

E 23310330 REV 124

PANEL ASSY-AFT RH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 30

23-31-03-30

HAP
FEB 10/07

23-31-03-30
PAGE 0

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
30			PANEL ASSY-AFT RH DOORWAY LINING (COMMUNICATIONS ONLY)	028200 968999	
- 1	411A2214-39SP		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: AFT RH FOR NHA/OTHER SYS DET SEE: 25-21-24-22	028200 968999	RF
5	BAC27DEL1300		.DECAL- PLACARD CONTENT: M1213 SPEAKER	028200 968999	1
10	BACS12FA3K5		.SCREW	028200 968999	RF
15	BACC10DK3		.CLAMP- OPTIONAL PART: BACC10DK4	028200 968999	RF
15	BACC10DK4		.CLAMP- OPTIONAL PART: BACC10DK3	028200 968999	RF
20	286A0442-005		.WIRE BUNDLE ASSY	028200 968999	RF
30	BACS12CK3-8		.SCREW	028200 968999	4
35	NAS1057T3-025		.SPACER	028200 968999	4
40	BACW10EC3C		.WASHER	028200 968999	4
45	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M01213 WIRING DIAGRAM REF: 233104 MAINTENANCE MANUAL REF: 23-31-03 INTER/ACROSS MODEL I/W P/N: RDAM8005A VOFF57	028200 968999	1
50	411A2228-1SP		.GASKET	028200 968999	1
60	MS51861-26		.SCREW	028200 968999	4
65	BACW10EG5J		.WASHER	028200 968999	4
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-03-30

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
FIG. 30
PAGE 1
JUN 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
30					
70	BACW10P75AL	.	WASHER	028200 968999	8
75	411A2218-23	.	SPACER ASSY	028200 968999	1
- 80	SL6224-3A	..	INSERT- SUPPLIER CODE: V97393	028200 968999	4
85	411A2228-8	..	SPACER	028200 968999	1
90	411A2226-2SP	.	GRILL	028200 968999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-03-30

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
 FIG. 30
 PAGE 2
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

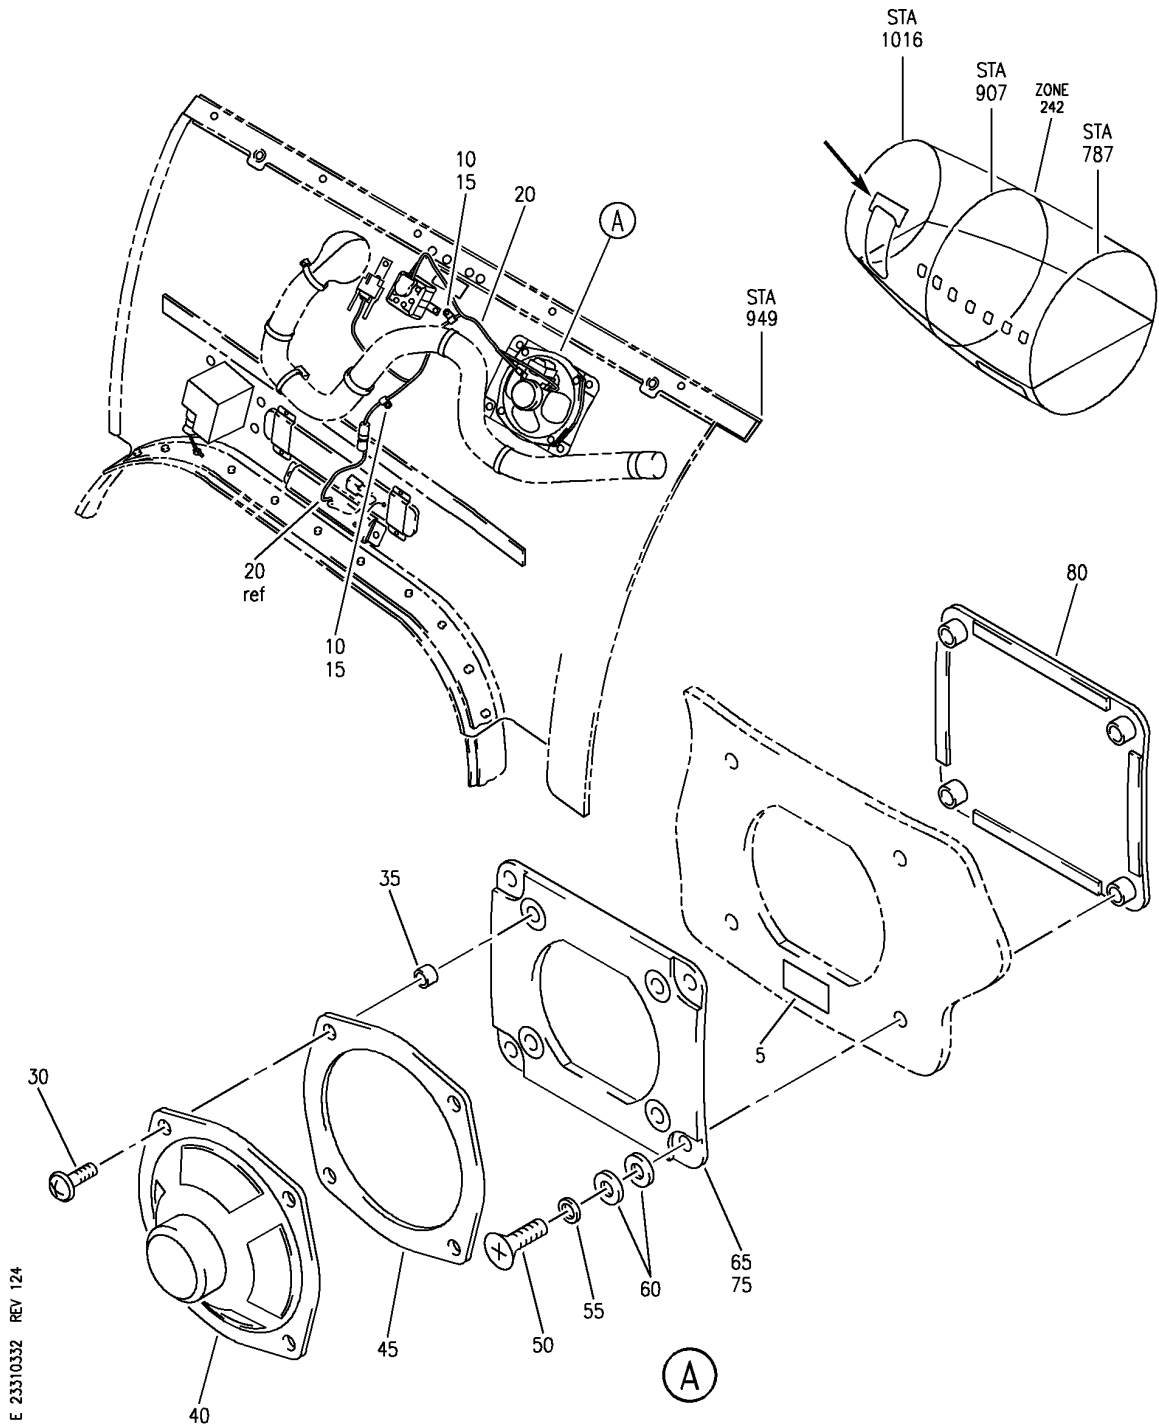

E 23310332 REV 124

PANEL ASSY-AFT RH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 32

23-31-03-32

HAP
FEB 10/07

23-31-03-32
PAGE 0

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
32			PANEL ASSY-AFT RH DOORWAY LINING (COMMUNICATIONS ONLY)	001027 201967	
- 1	411A2214-19SP		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: AFT RH FOR NHA/OTHER SYS DET SEE: 25-21-24-04	001027 201967	RF
5	BAC27DEL1300		.DECAL- PLACARD CONTENT: M1213 SPEAKER	001027 201967	1
10	BACS12FA3K5		.SCREW	001027 201967	RF
15	BACC10DK2		.CLAMP	001027 201967	RF
20	286A0442-001		.WIRE BUNDLE ASSY	001027 201967	RF
30	BACS12FA3K7		.SCREW	001027 201967	4
35	NAS1057T3-025		.SPACER	001027 201967	4
40	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M01213 WIRING DIAGRAM REF: 233104 MAINTENANCE MANUAL REF: 23-31-03 INTER/ACROSS MODEL I/W P/N: RDAM8005A VOFF57	001027 201967	1
45	411A2228-1SP		.GASKET	001027 201967	1
50	MS21207-6-10		.SCREW	001027 201967	4
55	BACW10EG5J		.WASHER	001027 201967	4
60	BACW10P75AL		.WASHER	001027 201967	8
65	411A2218-23		.SPACER ASSY	001027 201967	1
- 70	SL6224-3A		..INSERT- SUPPLIER CODE: V97393	001027 201967	4
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-03-32

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
FIG. 32
PAGE 1
OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
32					
75	411A2228-8	. .	SPACER	001027 201967	1
80	411A2226-2SP	. GRILL		001027 201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					


— ITEM NOT ILLUSTRATED

HAP

23-31-03-32

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
 FIG. 32
 PAGE 2
 OCT 15/08

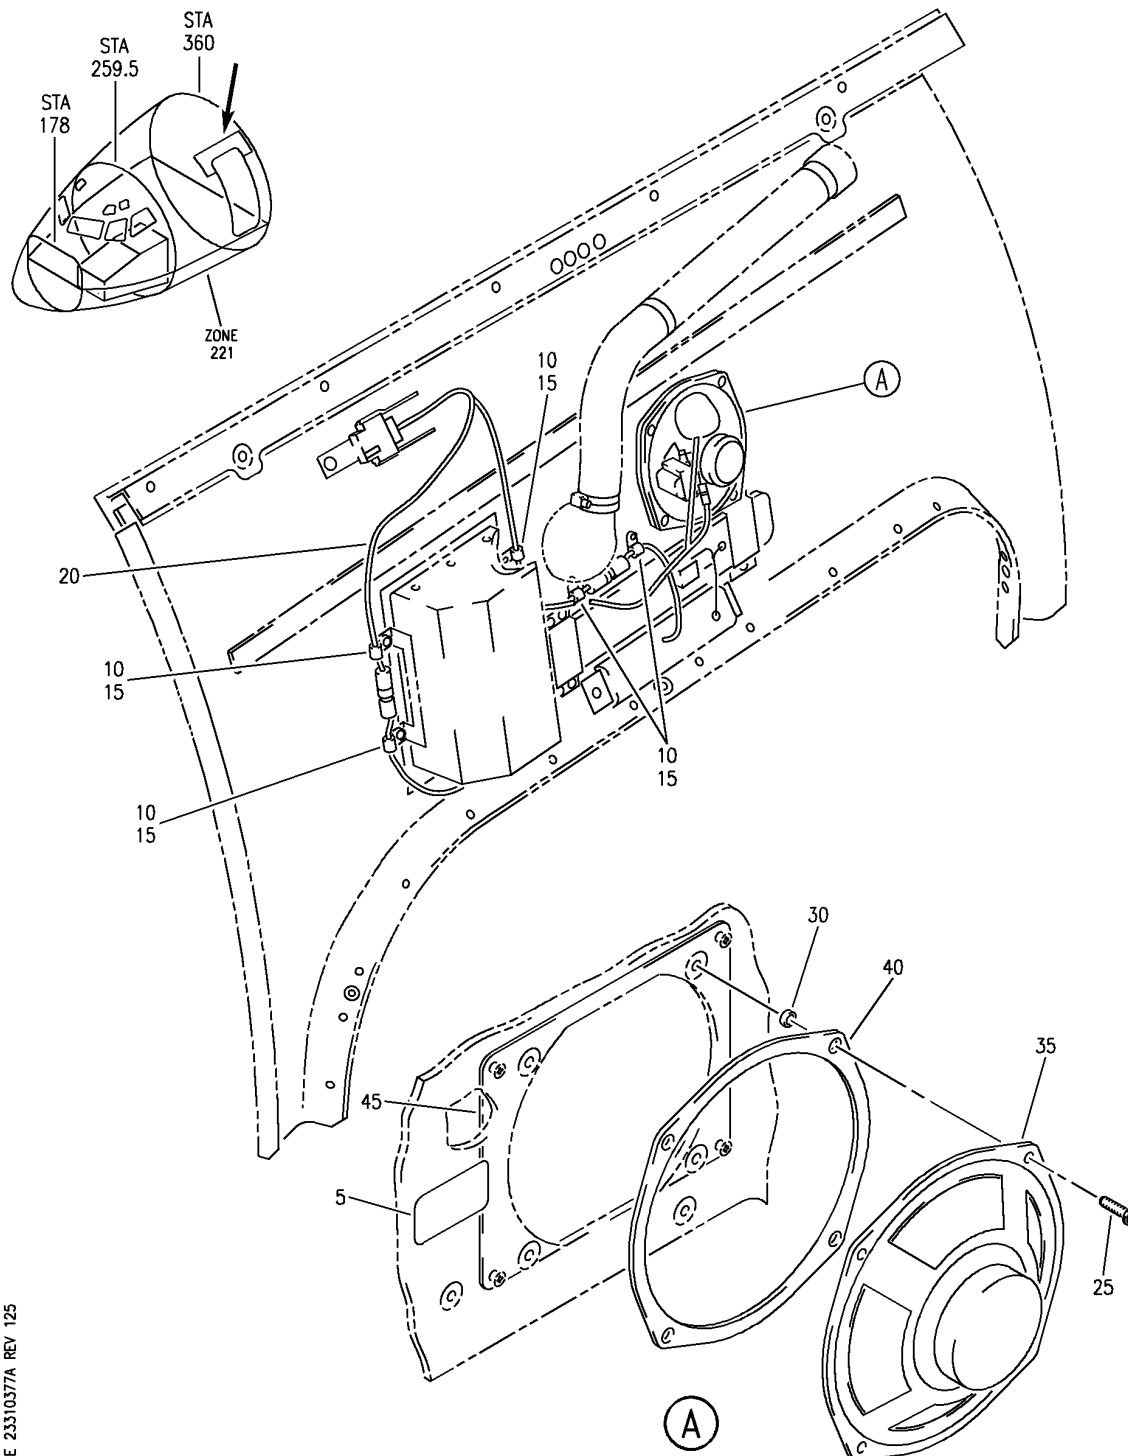

E 23310377A REV 125

PANEL ASSY-FWD LH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 77A

HAP
FEB 10/07

23-31-03-77A

23-31-03-77A
PAGE 0

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
77A			PANEL ASSY-FWD LH DOORWAY LINING (COMMUNICATIONS ONLY)	001027	
- 1	411A2211-41SP		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: FWD LH FOR NHA/OTHER SYS DET SEE: 25-21-30-03	001007	RF
- 1	411A2211-47SP		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: FWD LH FOR NHA/OTHER SYS DET SEE: 25-21-30-03	008027	RF
5	BAC27DEL1297		.DECAL- PLACARD CONTENT: M157 SPEAKER	001027	1
10	BACS12FA3K5		.SCREW	001027	RF
15	BACC10DK2		.CLAMP	001027	RF
20	286A0352-001		.WIRE BUNDLE ASSY	001027	RF
25	BACS12FA3K7		.SCREW	001027	4
30	NAS1057T3-025		.SPACER	001027	4
35	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M01464 WIRING DIAGRAM REF: 233104	001027	1
35	RDAM8005A		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101 ELECTRICAL EQUIP NUMBER: M01464 WIRING DIAGRAM REF: 233104	001027	1
40	411A2228-1SP		.GASKET	001027	1
45	411A2226-1SP		.GRILL-SPKR ATTACHING PARTS	001027	1
- 50	MS21207-6-6		.SCREW -----*-----	001027	4
- 55	BACW10CT5J		.WASHER	001027	4
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-03-77A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
FIG. 77A
PAGE 1
FEB 10/07

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
77A					
- 60	BACW10P75AL		ATTACHING PARTS . WASHER -----*-----	001027	4
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-03-77A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
 FIG. 77A
 PAGE 2
 FEB 10/07

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

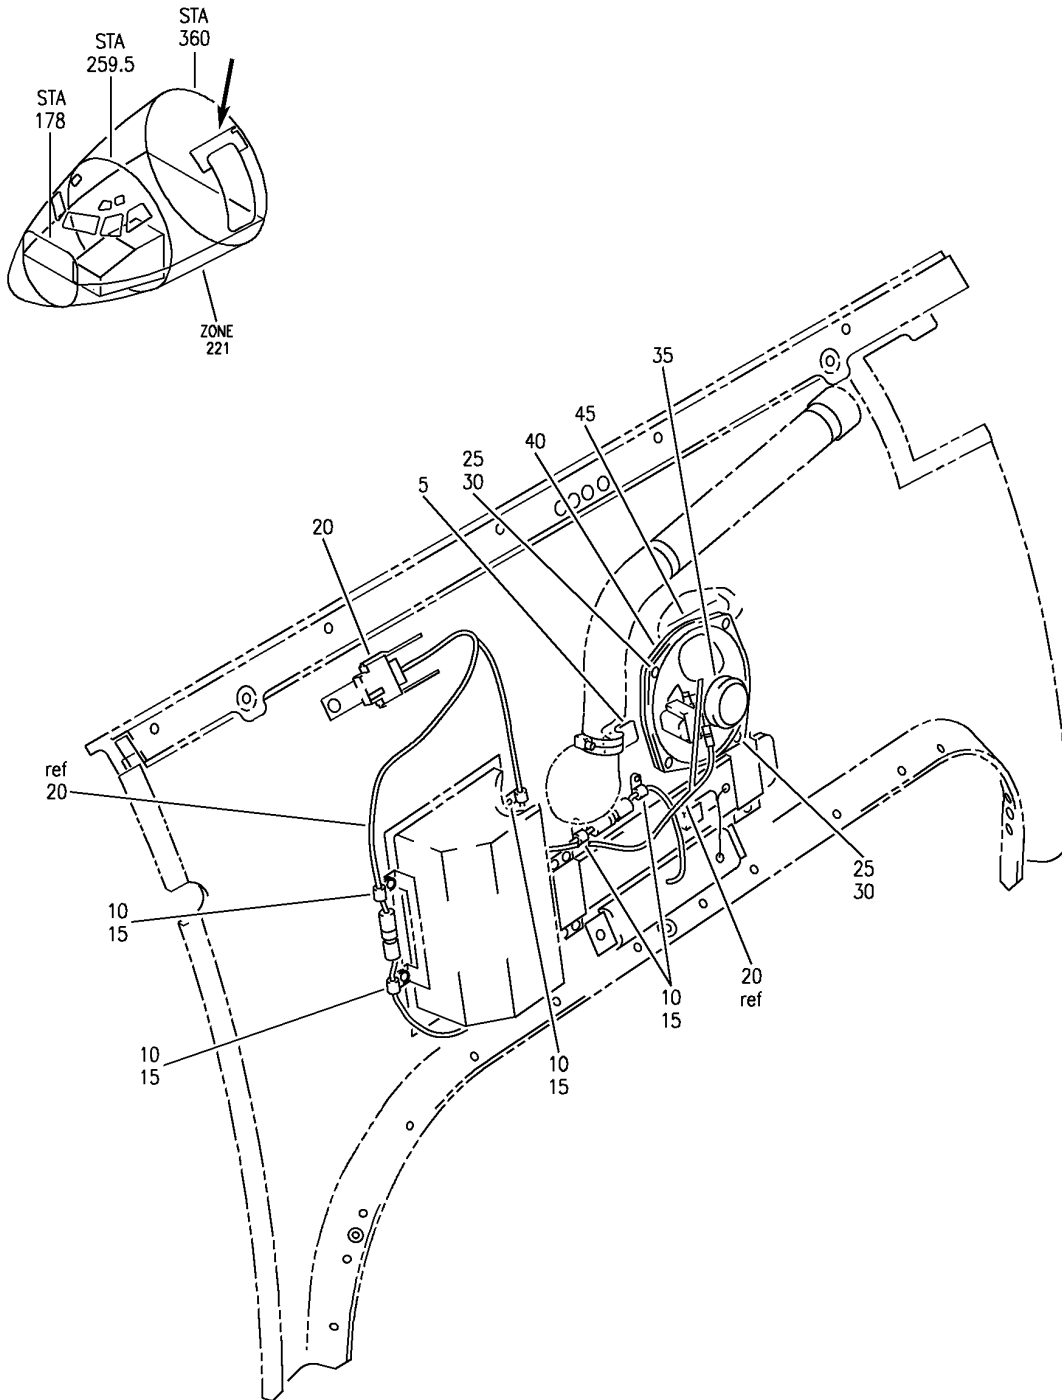

E 23310389B REV 125

PANEL ASSY-FWD LH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 89B

23-31-03-89B

HAP
OCT 15/08

23-31-03-89B
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
89B			PANEL ASSY-FWD LH DOORWAY LINING (COMMUNICATIONS ONLY)	201967	
- 1	411A2211-50SP		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: FWD LH FOR NHA/OTHER SYS DET SEE: 25-21-30-89B	201967	RF
5	BAC27DEL1297		.DECAL- PLACARD CONTENT: M157 SPEAKER	201967	1
10	BACS12FA3K5		.SCREW	201967	RF
15	BACC10DK2		.CLAMP	201967	RF
20	286A0352-001		.WIRE BUNDLE ASSY	201967	RF
25	BACS12FA3K7		.SCREW	201967	4
30	NAS1057T3-025		.SPACER	201967	4
35	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M02642	201967	1
35	RDAM8005A		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M02642	201967	1
40	411A2228-1SP		.GASKET	201967	1
45	411A2226-1SP		.GRILL-SPKR ATTACHING PARTS	201967	1
- 50	MS21207-6-6		.SCREW	201967	4
- 55	BACW10CT5J		.WASHER	201967	4
- 60	BACW10P75AL		.WASHER -----*-----	201967	4
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-03-89B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
 FIG. 89B
 PAGE 1
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

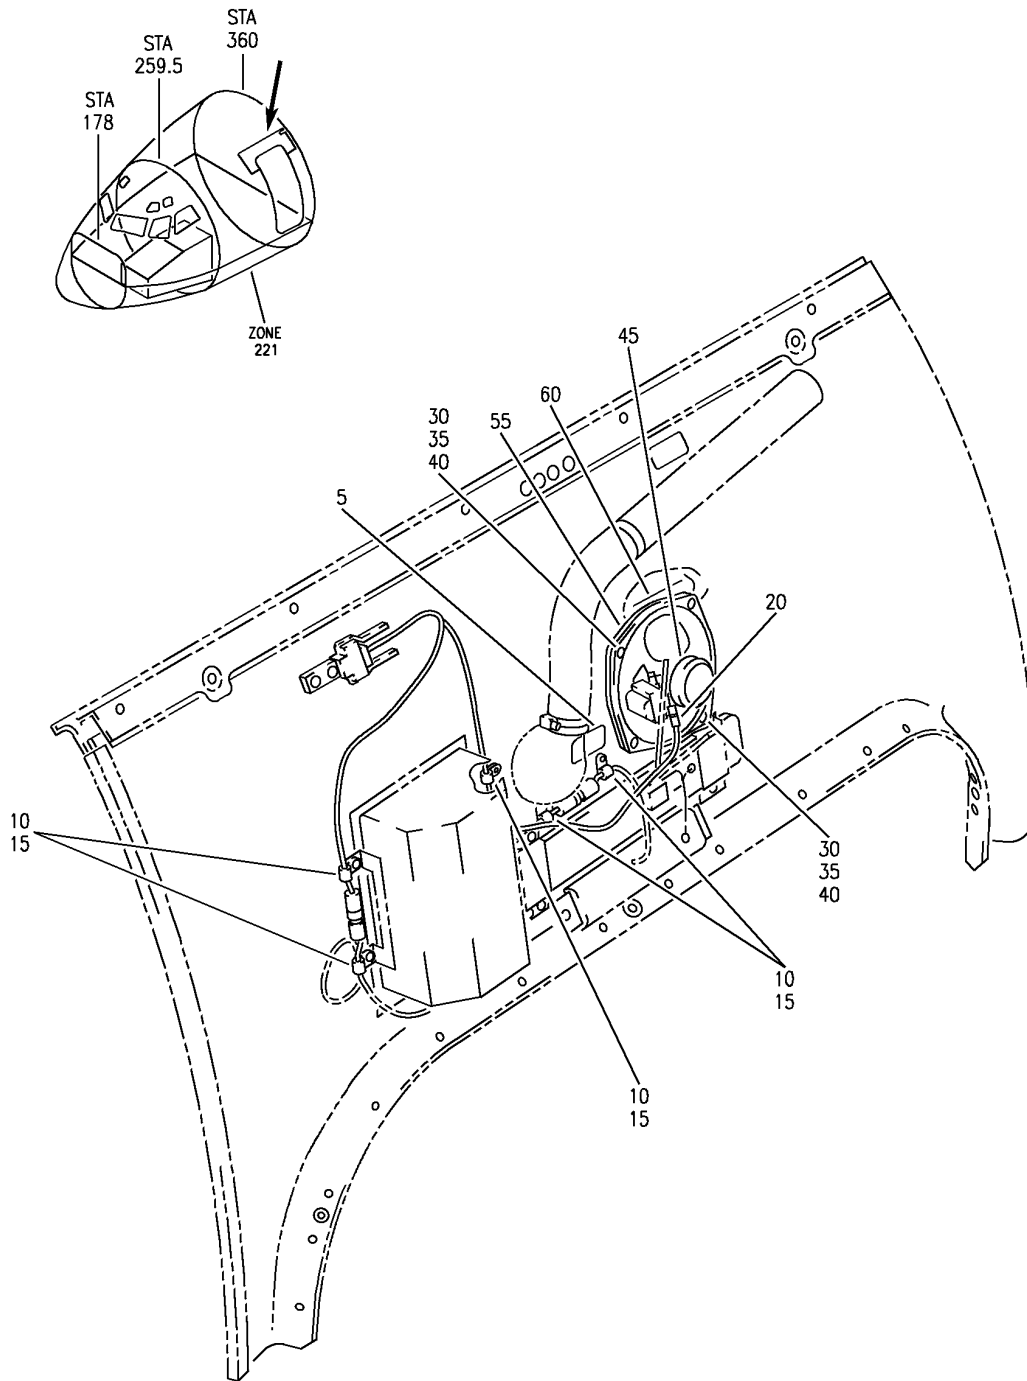

E 23310389D REV 125

PANEL ASSY-FWD LH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 89D

23-31-03-89D

HAP
FEB 10/07

23-31-03-89D
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
R R R R R R	89D		PANEL ASSY-FWD LH DOORWAY LINING (COMMUNICATIONS ONLY)	031200 968999	
	- 1	411A2211-71B	PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: FWD LH FOR NHA/OTHER SYS DET SEE: 25-21-30-89D	031200 968999	RF
	5	BAC27DEL1297	.DECAL- PLACARD CONTENT: M157 SPEAKER	031200 968999	1
	10	BACS12FA3K5	.SCREW	031200 968999	RF
	15	BACC10DK3	.CLAMP- OPTIONAL PART: BACC10DK4	031200 968999	RF
	15	BACC10DK4	.CLAMP- OPTIONAL PART: BACC10DK3	031200 968999	RF
	20	286A0352-004	.WIRE BUNDLE ASSY	031200 968999	RF
	30	BACS12CK3-8	.SCREW	031200 968999	4
	35	NAS1057T3-025	.SPACER	031200 968999	4
	40	MS35338-157	.WASHER	031200 968999	4
	45	RDAM8018	.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M01213 WIRING DIAGRAM REF: 233104	031200 968999	1
	45	RDAM8005A	.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101 ELECTRICAL EQUIP NUMBER: M01464 WIRING DIAGRAM REF: 233104	031200 968999	1
	55	411A2228-1A	.GASKET	031200 968999	1
			MISSING ITEM NUMBERS NOT APPLICABLE		


- ITEM NOT ILLUSTRATED

HAP

23-31-03-89D

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
FIG. 89D
PAGE 1
JUN 15/09




— ITEM NOT ILLUSTRATED

23-31-03-89D

23-31-03
FIG. 89D
PAGE 2
JUN 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

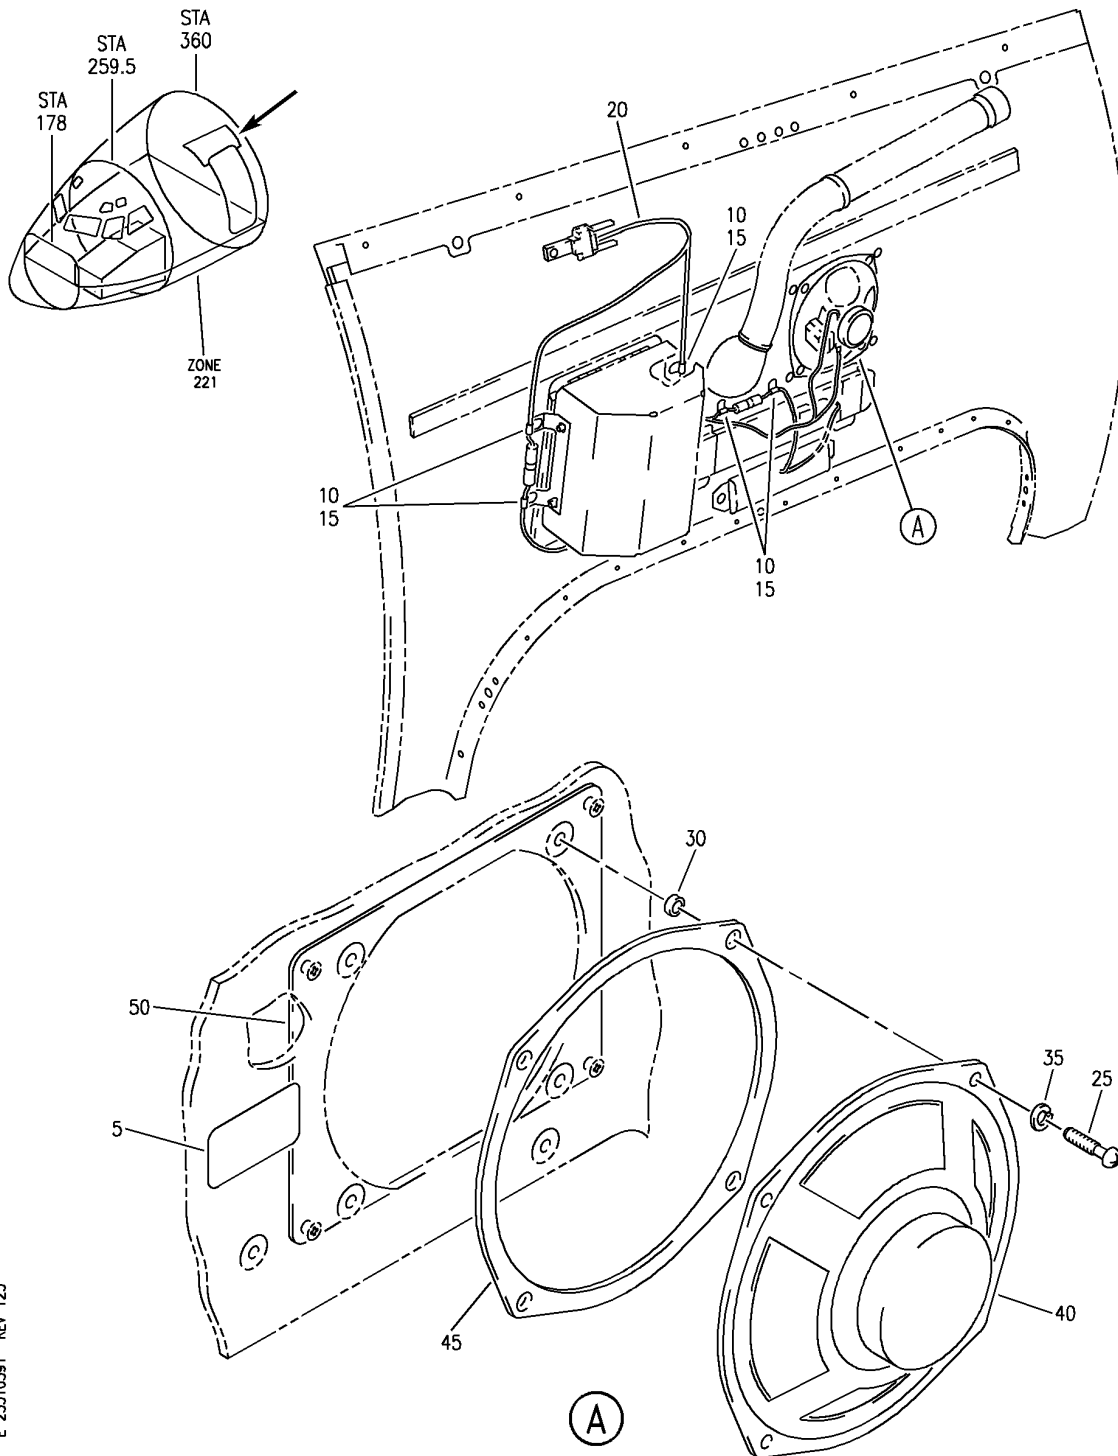

E 23310391 REV 125

PANEL ASSY-FWD LH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 91

23-31-03-91

HAP
FEB 10/07

23-31-03-91
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
91			PANEL ASSY-FWD LH DOORWAY LINING (COMMUNICATIONS ONLY)	028030	
- 1	411A2211-69SP		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: FWD LH FOR NHA/OTHER SYS DET SEE: 25-21-30-91	028030	RF
5	BAC27DEL1297		.DECAL- PLACARD CONTENT: M157 SPEAKER	028030	1
10	BACS12FA3K5		.SCREW	028030	RF
15	BACC10DK4		.CLAMP- OPTIONAL PART: BACC10DK3	028030	RF
15	BACC10DK3		.CLAMP- OPTIONAL PART: BACC10DK4	028030	RF
20	286A0352-004		.WIRE BUNDLE ASSY	028030	RF
25	BACS12CK3-8		.SCREW	028030	4
30	NAS1057T3-025		.SPACER	028030	4
35	MS35338-157		.WASHER	028030	4
40	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M00157	028030	1
40	RDAM8005A		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101 ELECTRICAL EQUIP NUMBER: M00157	028030	1
45	411A2228-1SP		.GASKET	028030	1
50	411A2226-1SP		.GRILL-SPKR ATTACHING PARTS	028030	1
- 55	MS21207-6-6		.SCREW	028030	4
- 60	BACW10EG5J		.WASHER	028030	4
- 65	BACW10P75AL		.WASHER -----*-----	028030	4
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-03-91

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
FIG. 91
PAGE 1
FEB 10/07

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

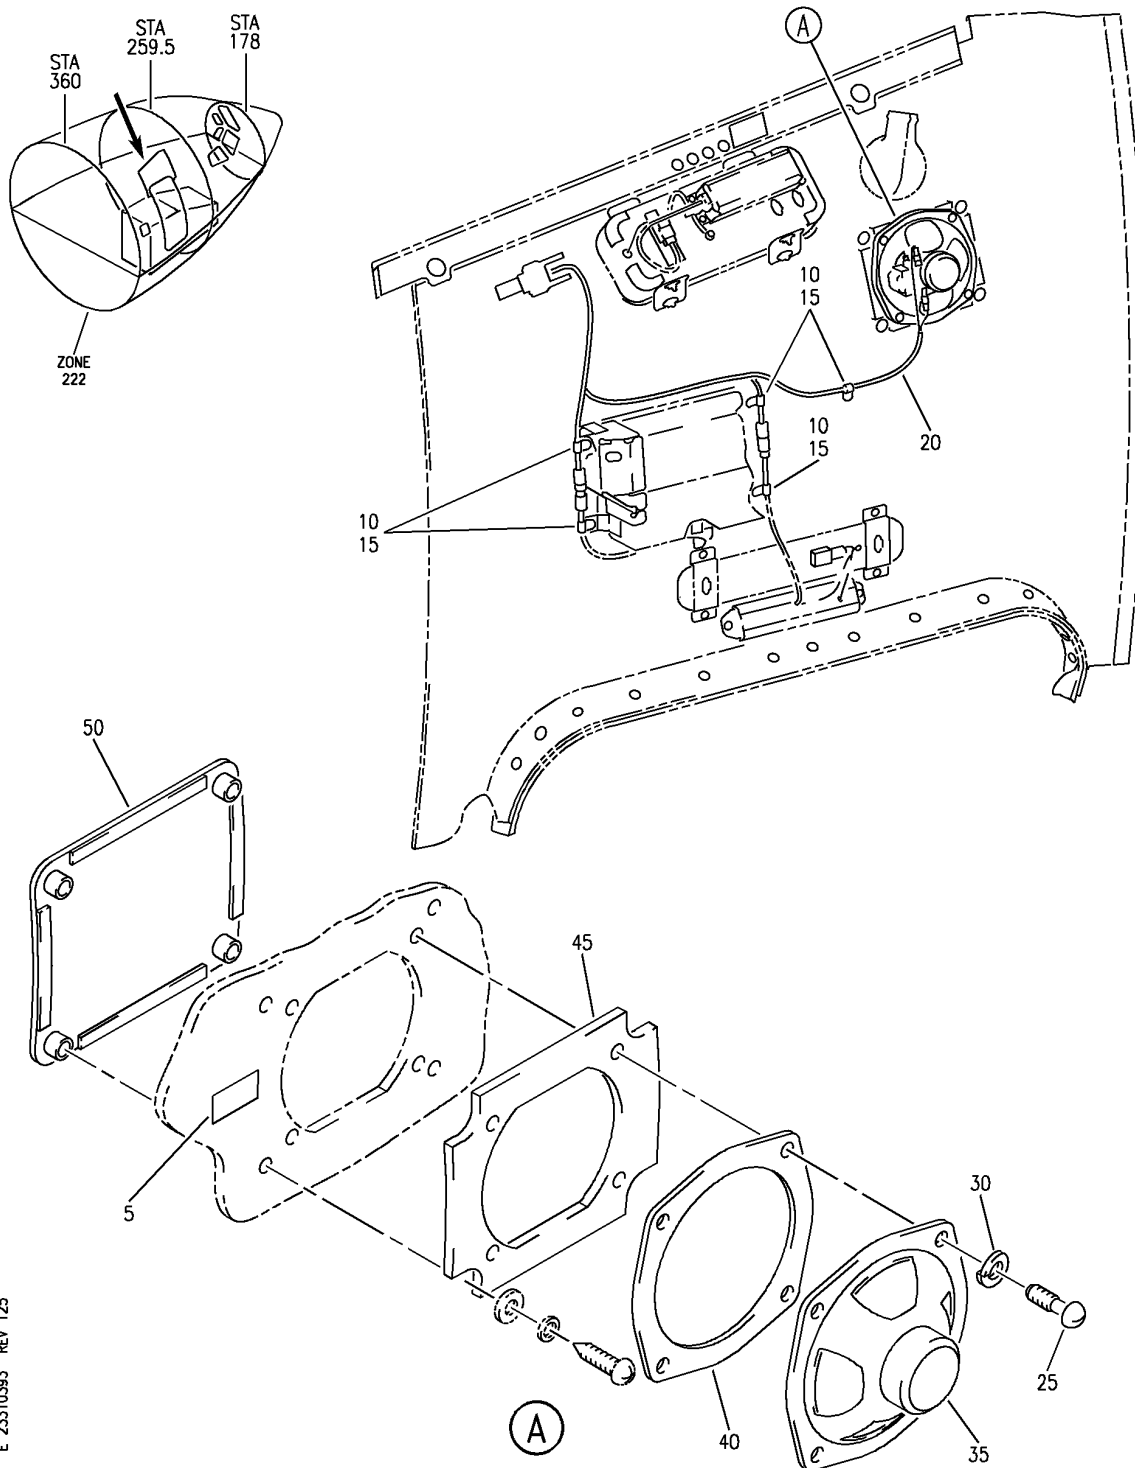

E 23310393 REV 125

PANEL ASSY-FWD RH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 93

23-31-03-93

HAP
FEB 10/07

23-31-03-93
PAGE 0

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
93			PANEL ASSY-FWD RH DOORWAY LINING (COMMUNICATIONS ONLY)	028036	
- 1	411A2212-52B		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: FWD RH FOR NHA/OTHER SYS DET SEE: 25-21-34-93	028036	RF
5	BAC27DEL1298		.MARKER- PLACARD CONTENT: M1464 SPEAKER	028036	1
10	BACS12FA3K5		.SCREW	028036	RF
15	BACC10DK3		.CLAMP- OPTIONAL PART: BACC10DK4	028036	RF
15	BACC10DK4		.CLAMP- OPTIONAL PART: BACC10DK3	028036	RF
20	286A0342-007		.WIRE BUNDLE ASSY	028036	RF
25	BACS12CK3-13		.SCREW	028036	4
30	MS35338-157		.WASHER	028036	4
35	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M01464 MAINTENANCE MANUAL REF: 23-31-03	028036	1
35	RDAM8005A		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101 ELECTRICAL EQUIP NUMBER: M01464 MAINTENANCE MANUAL REF: 23-31-03	028036	1
40	411A2228-1A		.GASKET	028036	1
45	411A2228-16		.FOAM-SPKR	028036	1
50	411A2226-1A		.GRILL-SPKR ATTACHING PARTS	028036	1
- 55	MS21207-6-6		.SCREW	028036	4
- 60	BACW10CT5J		.WASHER	028036	4
- 65	BACW10P75AL		.WASHER -----*-----	028036	4
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED



HAP

23-31-03-93

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
FIG. 93
PAGE 1
JUN 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

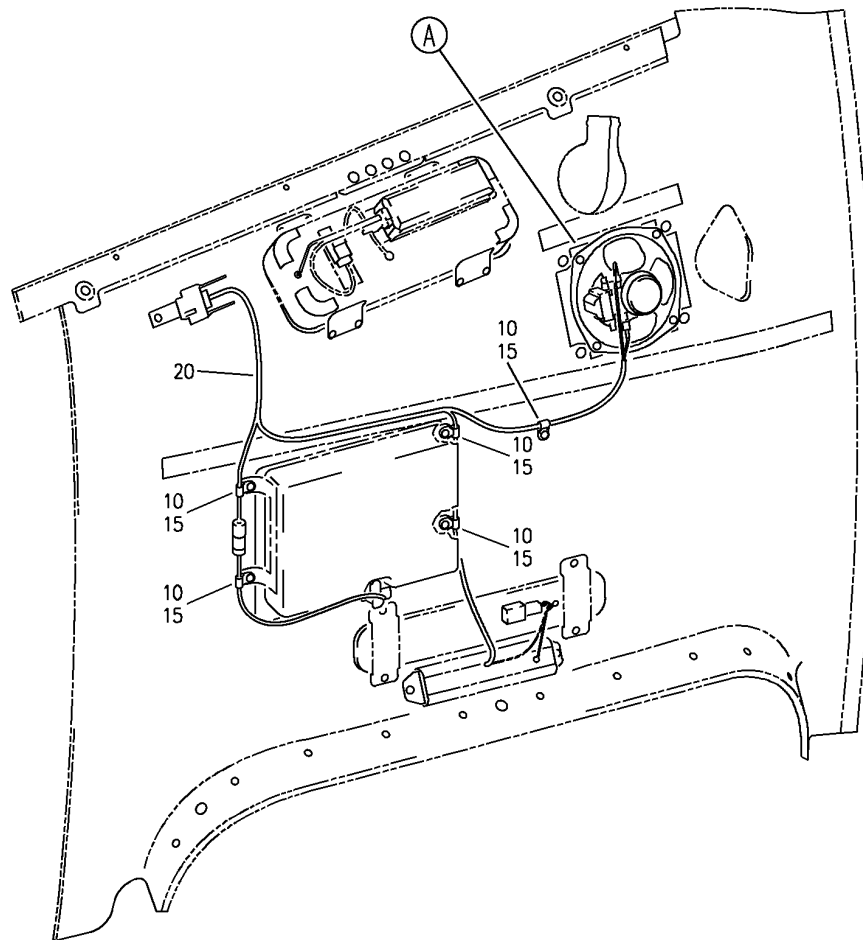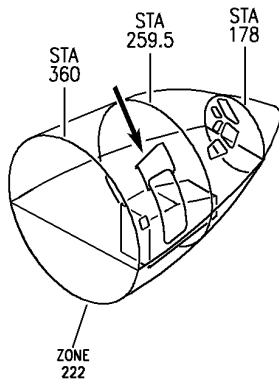

E 23310393A SHT 1 REV 125

PANEL ASSY-FWD RH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 93A (SHEET 1)


23-31-03-93A

HAP
FEB 10/07

23-31-03-93A
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

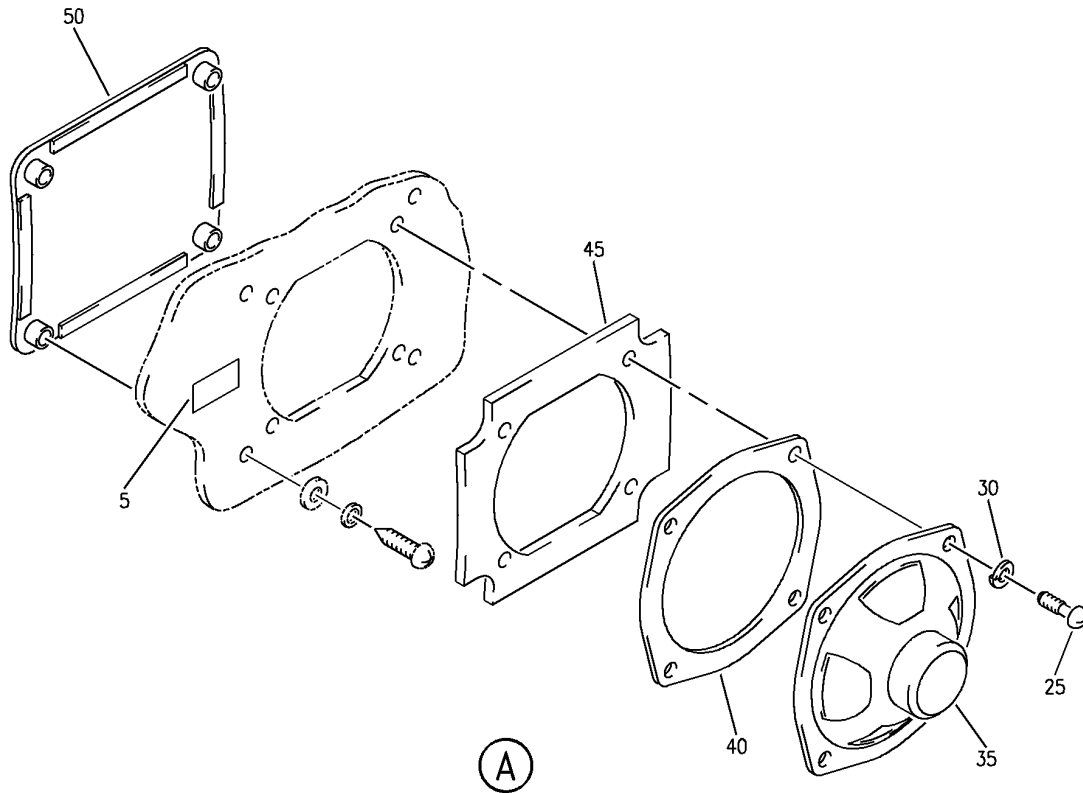

E 23310393A SHT 2 REV 125

PANEL ASSY-FWD RH DOORWAY LINING (COMMUNICATIONS ONLY)
FIGURE 93A (SHEET 2)

23-31-03-93A

HAP
FEB 10/07

23-31-03-93A
PAGE 0A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
93A			PANEL ASSY-FWD RH DOORWAY LINING (COMMUNICATIONS ONLY)	037200 968999	
- 1	411A2212-76SP		PANEL ASSY-DOORWAY LINING (COMMUNICATIONS ONLY) POSITION DATA: FWD RH FOR NHA/OTHER SYS DET SEE: 25-21-34-93A	037200 968999	RF
5	BAC27DEL1298		.MARKER- PLACARD CONTENT: M1464 SPEAKER	037200 968999	1
10	BACS12FA3K5		.SCREW	037200 968999	RF
15	BACC10DK3		.CLAMP- OPTIONAL PART: BACC10DK4	037200 968999	RF
15	BACC10DK4		.CLAMP- OPTIONAL PART: BACC10DK3	037200 968999	RF
20	286A0342-007		.WIRE BUNDLE ASSY	037200 968999	RF
25	BACS12CK3-13		.SCREW	037200 968999	4
30	BACW10EC3C		.WASHER	037200 968999	4
35	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: M01464 MAINTENANCE MANUAL REF: 23-31-03	037200 968999	1
35	RDAM8005A		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101 ELECTRICAL EQUIP NUMBER: M01464 MAINTENANCE MANUAL REF: 23-31-03	037200 968999	1
40	411A2228-1SP		.GASKET	037200 968999	1
45	411A2228-16		.FOAM-SPKR	037200 968999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-03-93A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
FIG. 93A
PAGE 1
OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
93A					
50	411A2226-1SP		.GRILL-SPKR	037200 968999	1
			ATTACHING PARTS		
- 55	MS21207-6-6		.SCREW	037200 968999	4
- 60	BACW10P75AL		.WASHER	037200 968999	4
- 65	BACW10EG5J		.WASHER	037200 968999	4
			-----*-----		
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-03-93A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-03
 FIG. 93A
 PAGE 2
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

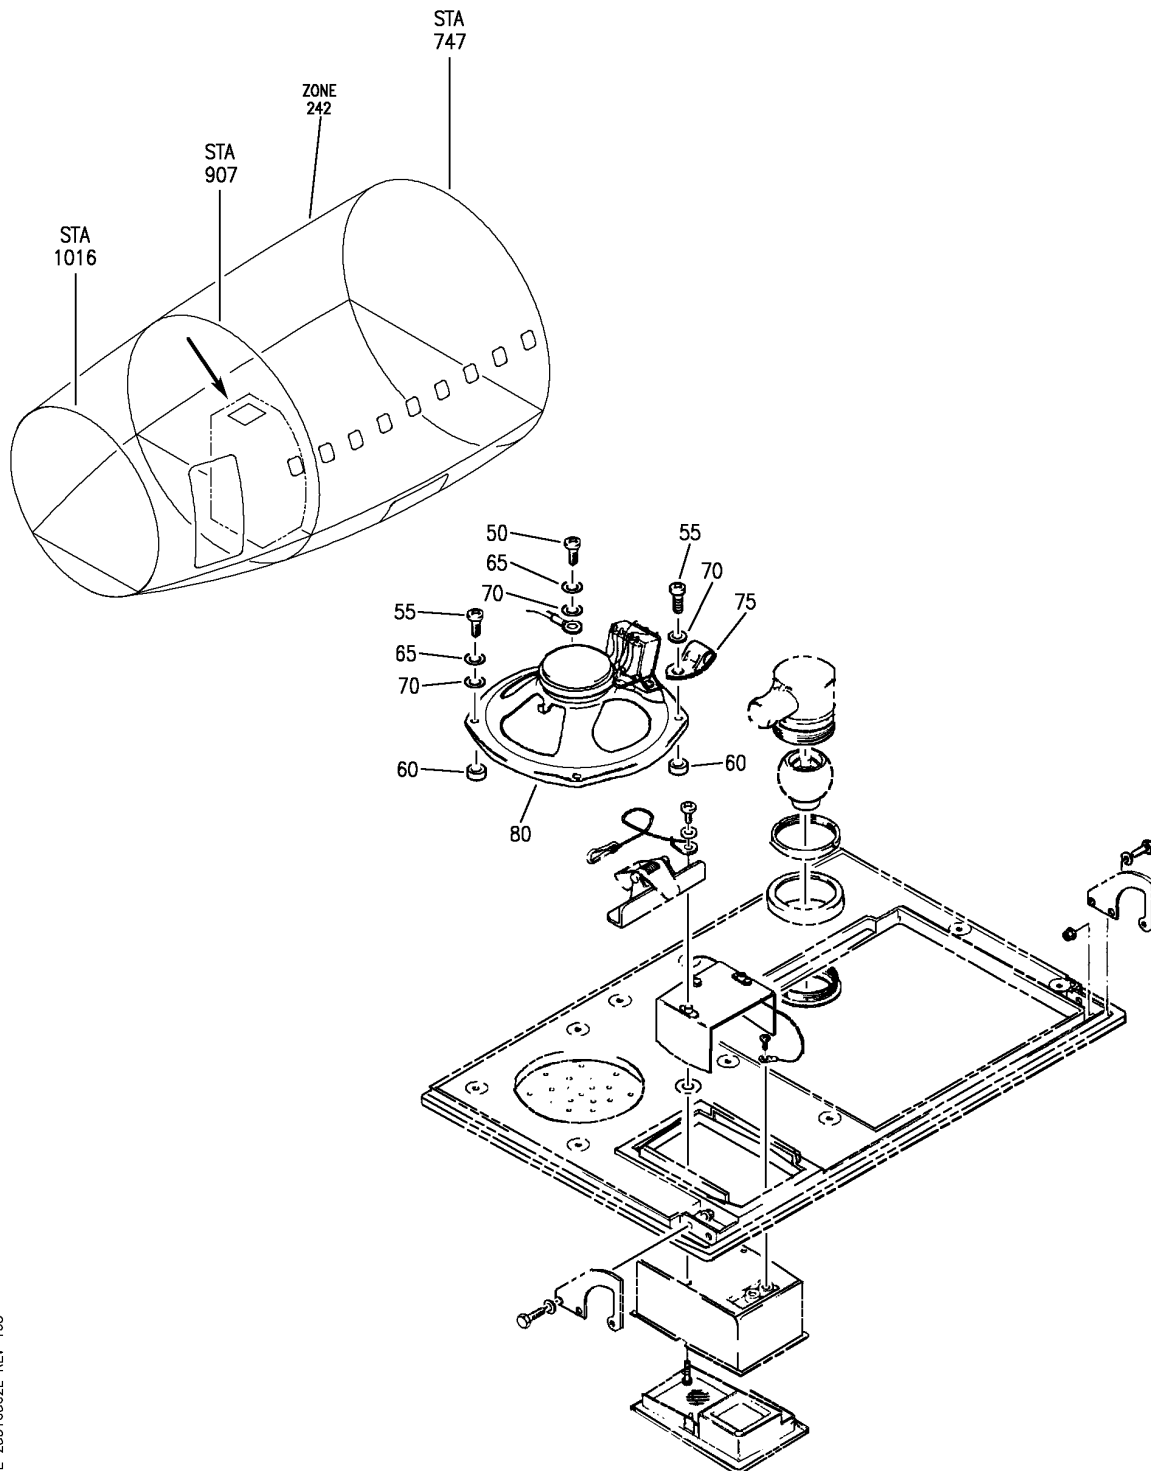

E 23310502L REV 103

SERVICE UNIT ASSY-PASS. LAV E (COMMUNICATIONS ONLY)
FIGURE 2L

23-31-05-02L

HAP
OCT 10/06

23-31-05-02L
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2L			SERVICE UNIT ASSY-PASS. LAV E (COMMUNICATIONS ONLY)	006007	
- 1	C22502-571-313		SERVICE UNIT ASSY-PASS. LAV E (COMMUNICATIONS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-41-40-01M	006007	RF
50	MS27039-0810		.SCREW-S11	006007	1
55	MS27039-0809		.SCREW	006007	3
60	SP47X		.WASHER-SPR	006007	3
65	SP122C		.WASHER	006007	4
70	C22102-949-101		.SPACER- SUPPLIER CODE: VU3384	006007	4
75	BACC10DK6		.CLAMP	006007	1
80	RDAM8005A		.SPEAKER-MZ107 SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101	006007	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-05-02L

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 02L
 PAGE 1
 OCT 10/06

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

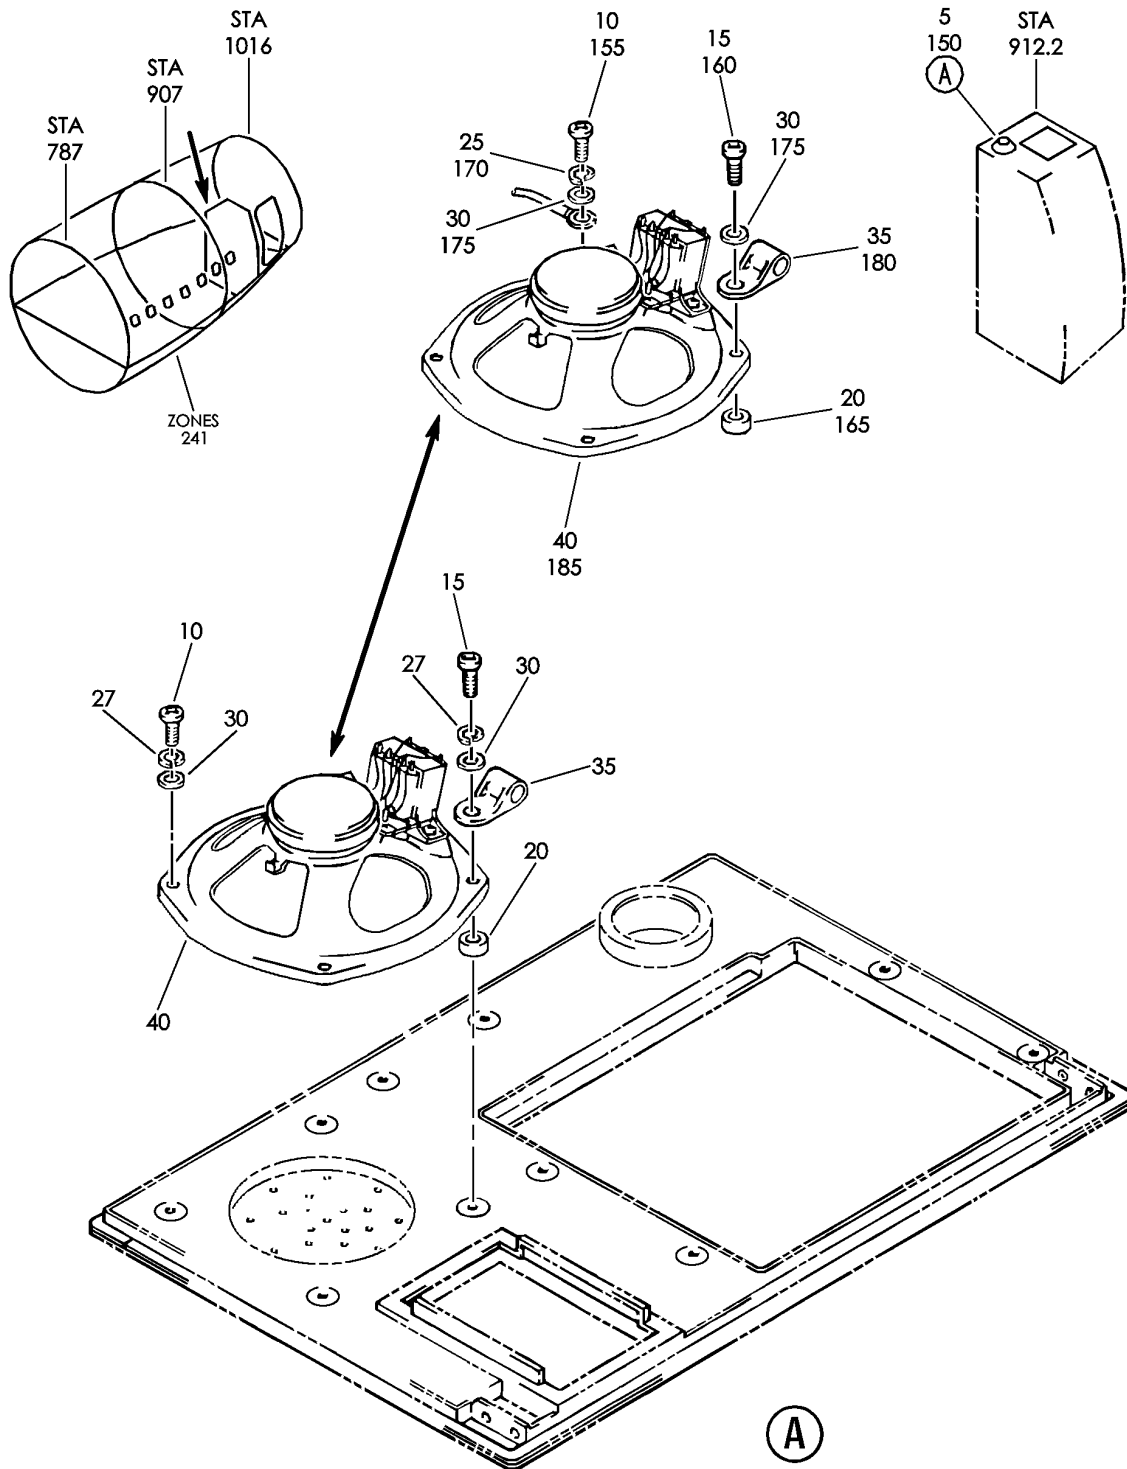

E 23310504 REV 054

STRUCTURE INSTL-LAV D AND G (COMMUNICATIONS ONLY)
FIGURE 4

23-31-05-04

HAP
OCT 10/06

23-31-05-04
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4			STRUCTURE INSTL-LAV D AND G (COMMUNICATIONS ONLY)	008013 201967	
- 1	25-44-71-011RF		STRUCTURE INSTL-LAV D (COMMUNICATIONS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-40-01-54	201967	RF
- 1	25-45-07-043RF		STRUCTURE INSTL-LAV D (COMMUNICATIONS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-40-01-59	008013	RF
	5 C22502-571-303		.SERVICE UNIT ASSY-PASS. SUPPLIER CODE: VU3384	201967	RF
	5 C22502-571-313		.SERVICE UNIT ASSY-PASS. SUPPLIER CODE: VU3384	008013	RF
10	MS27039-0810		..SCREW-S11	201967	1
10	MS27039-0812		..SCREW-S11	008013	1
15	MS27039-0809		..SCREW	201967	3
15	MS27039-0810		..SCREW	008013	3
20	C22102-949-101		..SPACER- SUPPLIER CODE: VU3384	008013 201967	4
25	SP47X		..WASHER-	008013 201967	1
30	SP122C		..WASHER-	008013 201967	4
35	BACC10DK6		..CLAMP	008013 201967	1
40	RDAM8005A		..SPEAKER-MZ107 SUPPLIER CODE: V0FF57 SPECIFICATION NUMBER: S222T101-101	008013 201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-05-04

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 04
 PAGE 1
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

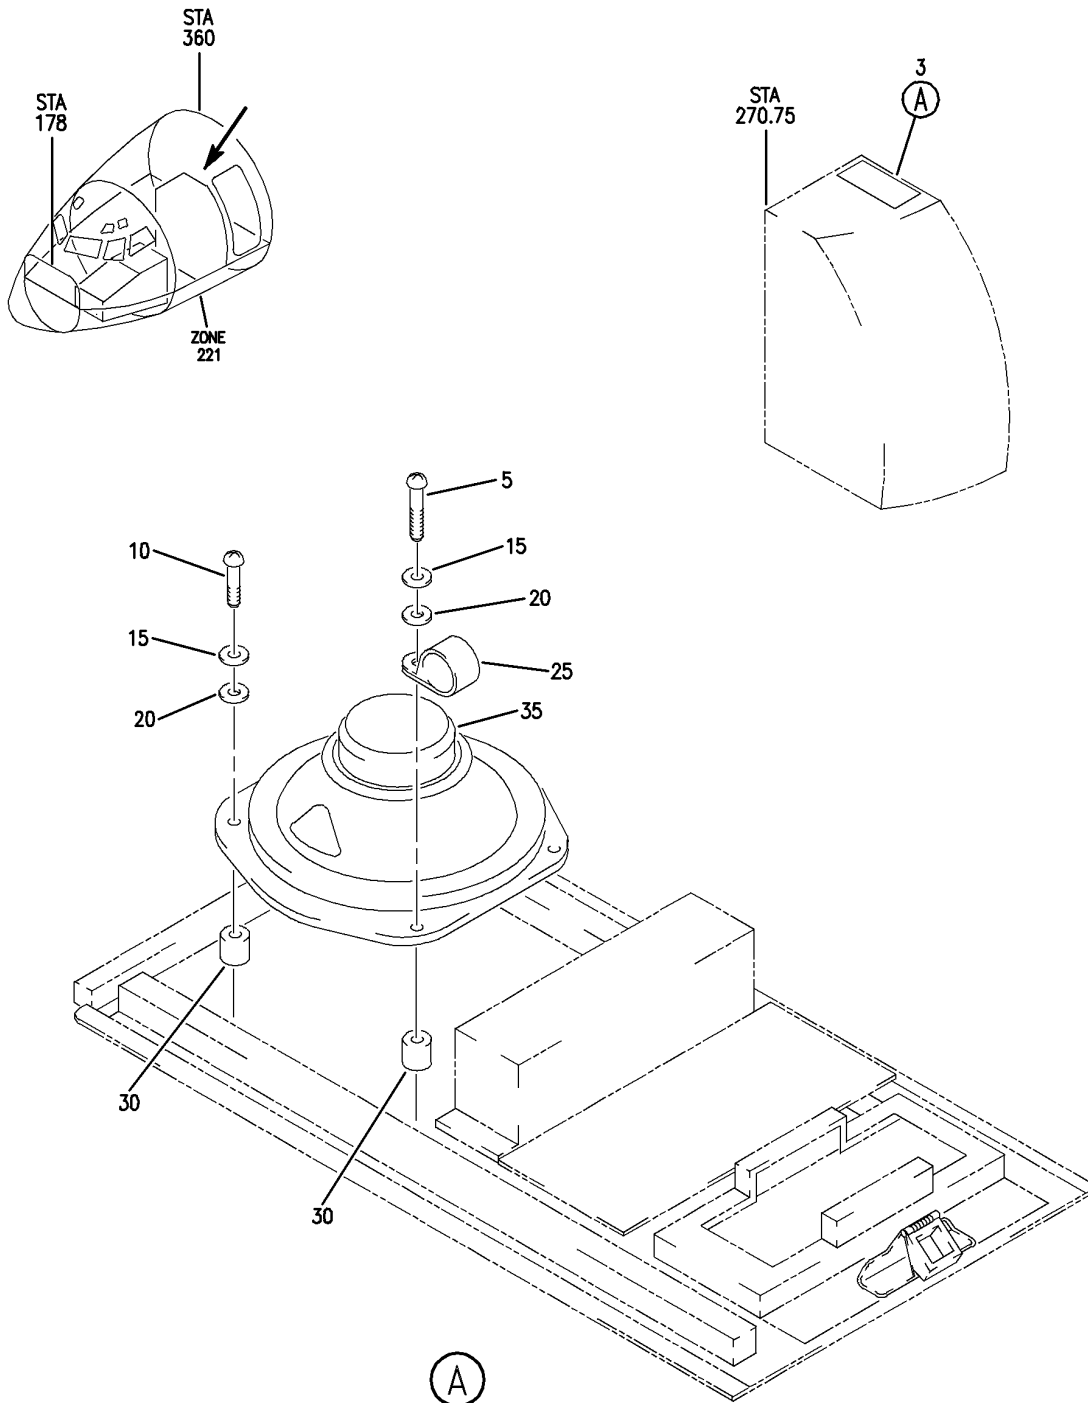

E 23310506 REV 048

STRUCTURE INSTL-LAV A (COMMUNICATIONS ONLY)

FIGURE 6

23-31-05-06

HAP
OCT 10/06

23-31-05-06
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
6			STRUCTURE INSTL-LAV A (COMMUNICATIONS ONLY)	008030	
- 2	25-45-24-009RF		STRUCTURE INSTL-LAV A (COMMUNICATIONS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-40-01-56C	008013	RF
- 2	25-45-24-010RF		STRUCTURE INSTL-LAV A (COMMUNICATIONS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-40-01-56C	014030	RF
4	C22102-101-315		.SERVICE UNIT ASSY- SUPPLIER CODE: VU3384	008030	RF
5	MS27039-0812		..SCREW	008030	1
10	MS27039-0810		..SCREW	008030	3
15	SP47X		..WASHER-SPR	008030	4
20	SP122C		..WASHER-	008030	4
25	BACC10DK4		..CLAMP-P	008030	1
30	C22102-949-103		..SPACER- SUPPLIER CODE: VU3384	008030	4
35	RDAM8005A		..SPEAKER- SUPPLIER CODE: V0FF57 SPECIFICATION NUMBER: S222T101-101 ELECTRICAL EQUIP NUMBER: MZ00107	008030	1

MISSING ITEM NUMBERS NOT APPLICABLE

- ITEM NOT ILLUSTRATED


HAP

23-31-05-06

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
FIG. 06
PAGE 1
FEB 10/07

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

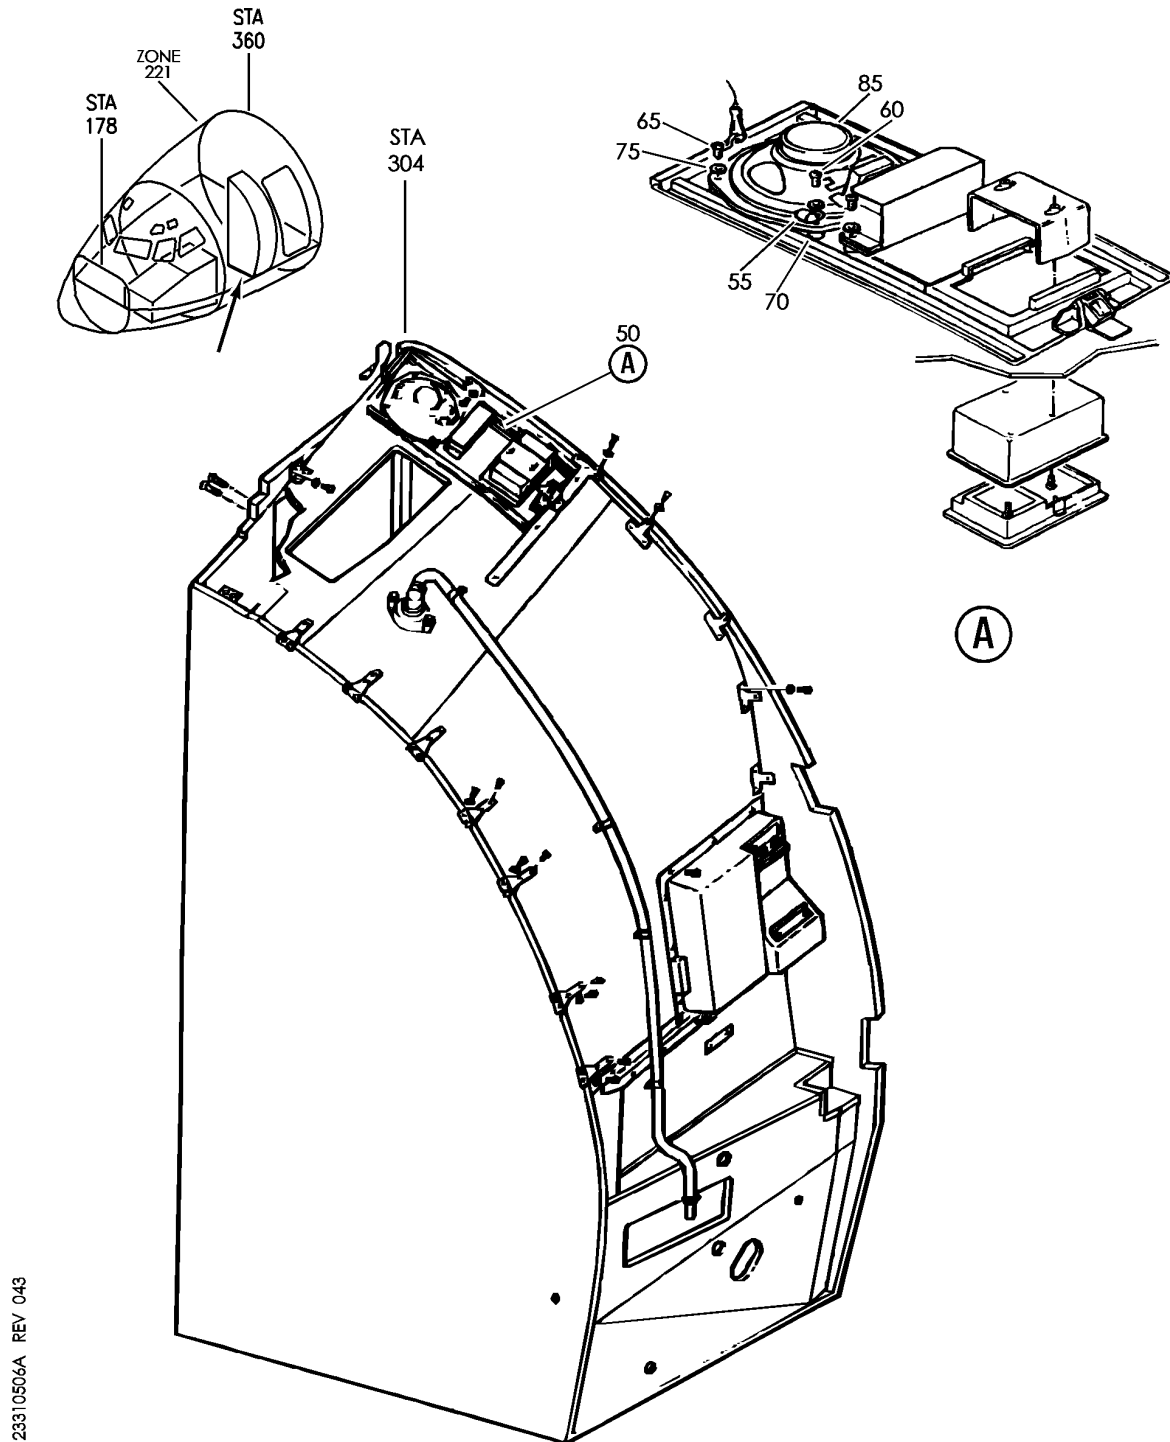

E 23310506A REV 043

STRUCTURE INSTL-LAV A (COMMUNICATIONS ONLY)
FIGURE 6A

23-31-05-06A

HAP
OCT 15/08

23-31-05-06A
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
6A			STRUCTURE INSTL-LAV A (COMMUNICATIONS ONLY)	201967	
- 1	25-45-16-036RF		STRUCTURE INSTL-LAV A (COMMUNICATIONS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-40-01-56A	201967	RF
50	C22102-101-309		.SERVICE UNIT ASSY-PASS. SUPPLIER CODE: VU3384	201967	RF
55	BACC10DK4		..CLAMP	201967	1
60	MS27039-0812		..SCREW	201967	1
65	MS27039-0810		..SCREW	201967	3
70	C22102-949-103		..SPACER- SUPPLIER CODE: VU3384	201967	4
75	SP122C		..WASHER-	201967	4
- 80	SP47X		..WASHER-	201967	1
85	RDAM8005A		..SPEAKER-MZ107 SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101	201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					


- ITEM NOT ILLUSTRATED

HAP

23-31-05-06A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
FIG. 06A
PAGE 1
OCT 15/08

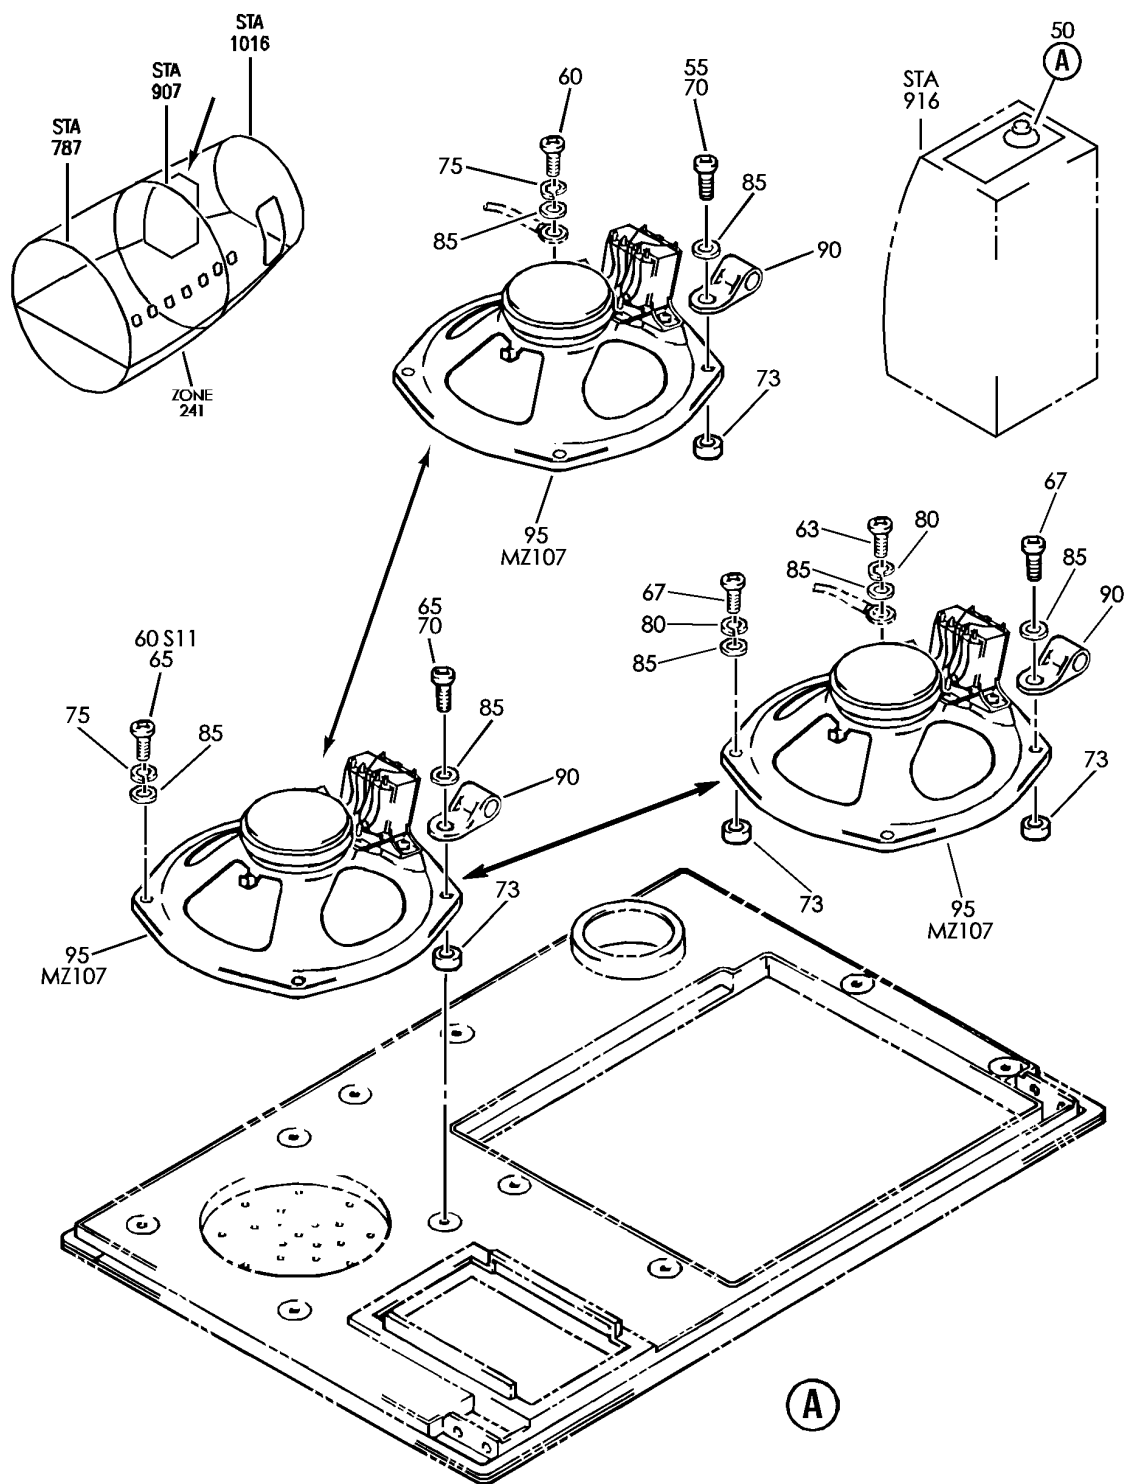

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
7			STRUCTURE INSTL-LAV E AND D (COMMUNICATIONS ONLY)	008030 201967	
- 1	25-45-12-043RF		STRUCTURE INSTL-LAV E (COMMUNICATIONS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-40-01-57B	008030	RF
- 1	25-45-12-054RF		STRUCTURE INSTL-LAV E (COMMUNICATIONS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-40-01-57B	201967	RF
50	C22502-571-313		.SERVICE UNIT ASSY-PASS. SUPPLIER CODE: VU3384	008030 201967	RF
60	MS27039-0810		..SCREW	008030	1
70	MS27039-0809		..SCREW	008030	3
73	C22102-949-101		..SPACER- SUPPLIER CODE: VU3384	008030 201967	4
75	SP47X		..WASHER-	008030	1
85	SP122C		..WASHER-	008030	4
90	BACC10DK6		..CLAMP	008030	1
95	RDAM8005A		..SPEAKER-MZ107 SUPPLIER CODE: V0FF57 SPECIFICATION NUMBER: S222T101-101	008030 201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-05-07

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
FIG. 07
PAGE 1
OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

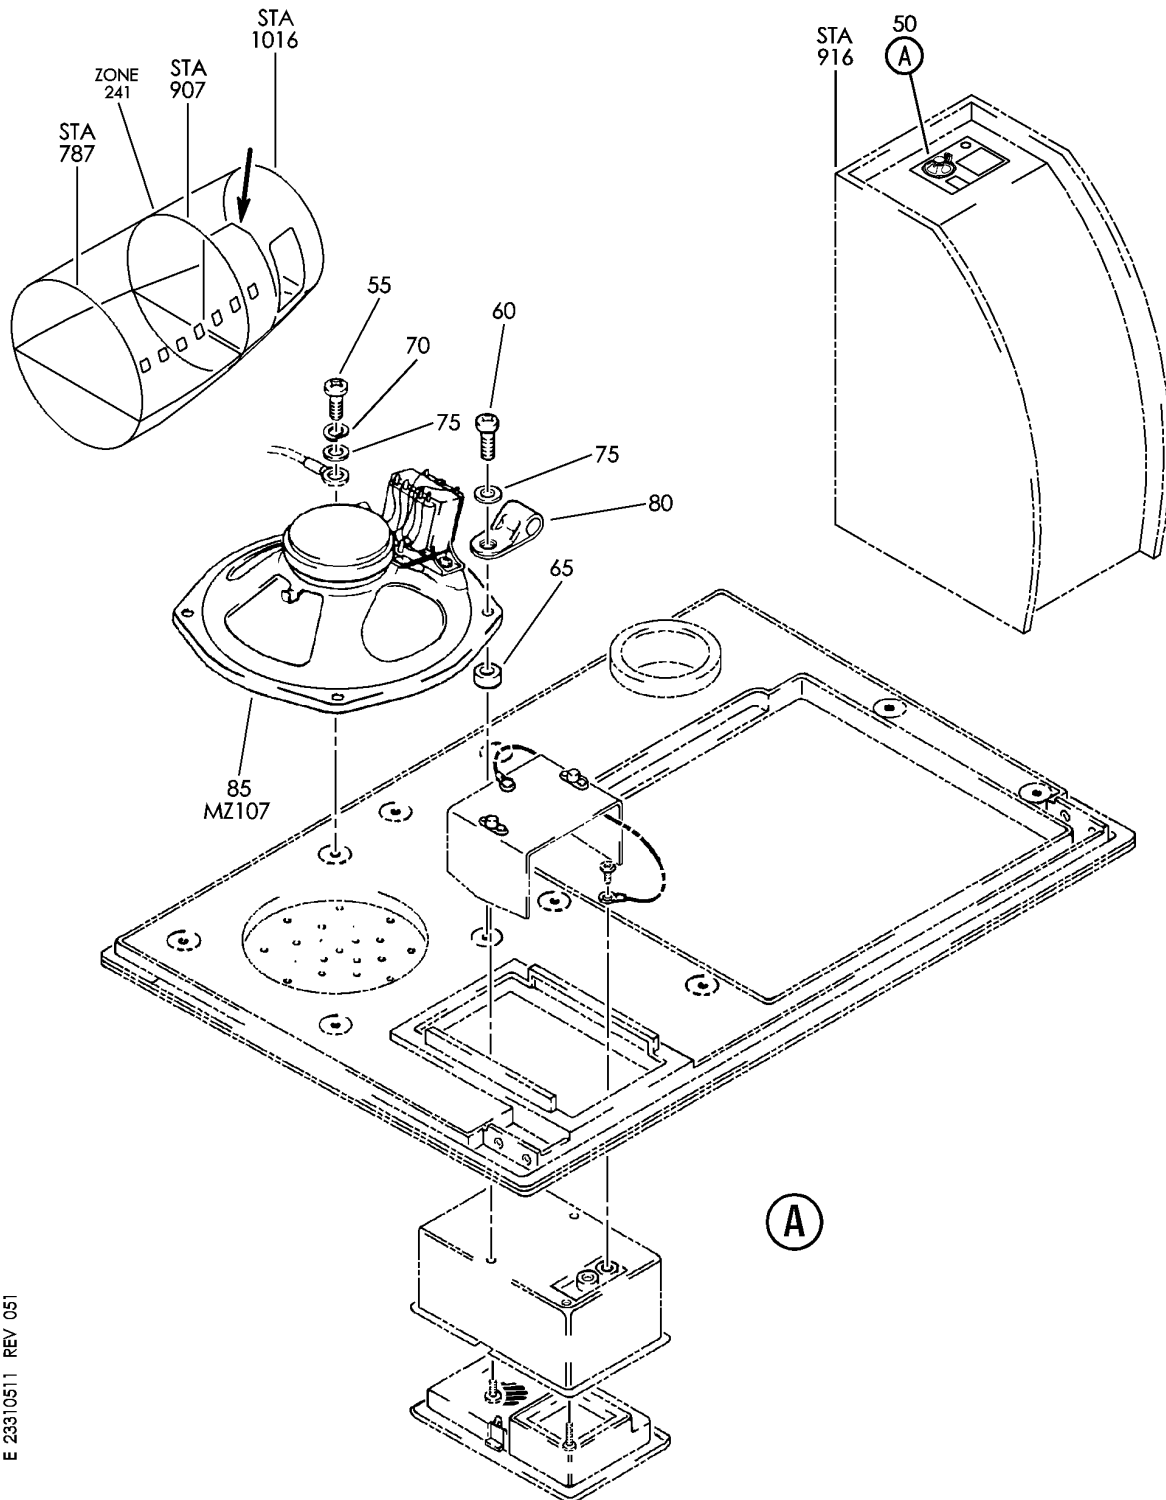

E 23310511 REV 051

STRUCTURE INSTL-LAV D AND G (COMMUNICATION ONLY)
FIGURE 11

23-31-05-11

HAP
OCT 10/06

23-31-05-11
PAGE 0

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
11			STRUCTURE INSTL-LAV D AND G (COMMUNICATION ONLY)	014030	
- 1	25-45-51-053RF		STRUCTURE INSTL-LAV D (COMMUNICATIONS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-40-01-59A	014030	RF
50	C22502-571-313		.SERVICE UNIT ASSY-PASS. SUPPLIER CODE: VU3384	014030	RF
55	MS27039-0812		..SCREW-S11	014030	1
60	MS27039-0810		..SCREW	014030	3
65	C22102-949-101		..SPACER- SUPPLIER CODE: VU3384	014030	4
70	SP47X		..WASHER-	014030	1
75	SP122C		..WASHER-	014030	4
80	BACC10DK6		..CLAMP	014030	1
85	RDAM8005A		..SPEAKER-MZ107 SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101	014030	1
MISSING ITEM NUMBERS NOT APPLICABLE					


- ITEM NOT ILLUSTRATED

HAP

23-31-05-11

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 11
 PAGE 1
 OCT 10/06



23-31-05-21

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
21			STRUCTURE INSTL-LAV D (LAVATORY SPEAKERS ONLY)	006007	
- 1	25-46-88-003RF		STRUCTURE INSTL-LAV D (LAVATORY SPEAKERS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-40-01-69	006007	RF
50	C22502-571-313		.SERVICE UNIT ASSY-PASS. SUPPLIER CODE: VU3384	006007	RF
55	MS27039-0810		..SCREW-S11	006007	1
60	MS27039-0809		..SCREW	006007	3
65	C22102-949-101		..SPACER- SUPPLIER CODE: VU3384	006007	4
70	SP47X		..WASHER-SPR	006007	1
75	SP122C		..WASHER	006007	4
80	BACC10DK6		..CLAMP	006007	1
85	RDAM8005A		..SPEAKER-MZ107 SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101	006007	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-05-21

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 21
 PAGE 1
 OCT 10/06

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

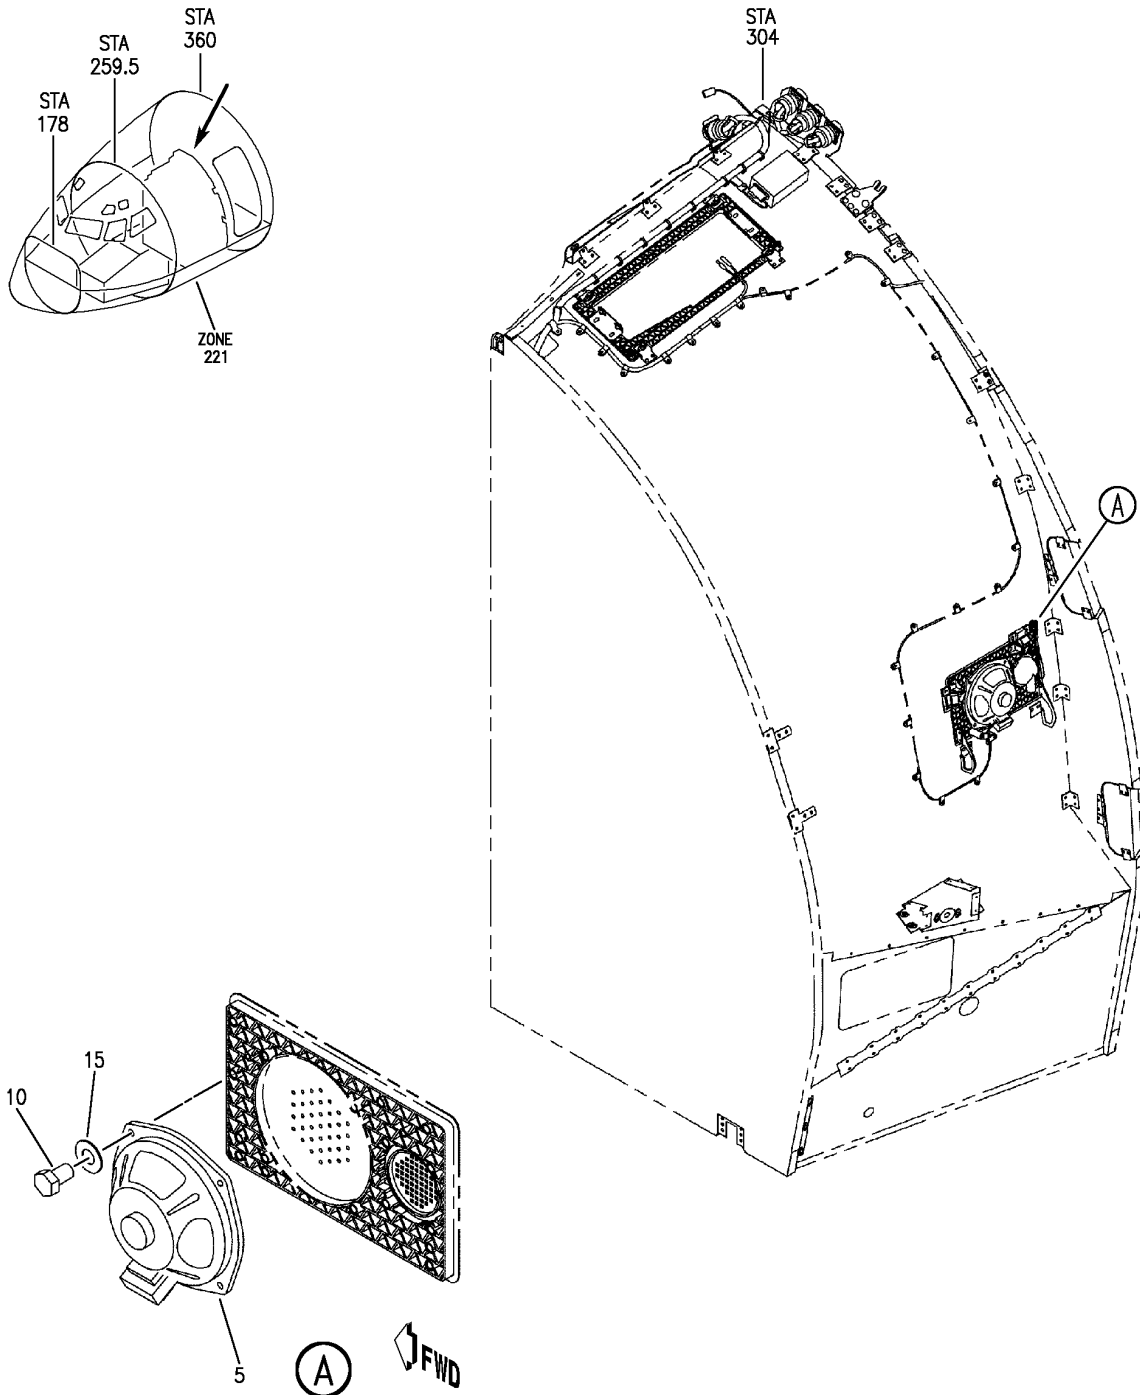

E 23310535C REV 130

ELECTRICAL ASSY-LAV A (COMMUNICATIONS ONLY)
FIGURE 35C

23-31-05-35C

HAP
FEB 15/08

23-31-05-35C
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
35C					
- 1	D72W27050-111		ELECTRICAL ASSY-LAV A (COMMUNICATIONS ONLY) ELECTRICAL ASSY-LAV A (COMMUNICATIONS ONLY) SUPPLIER CODE: VS5825 FOR NHA/OTHER SYS DET SEE: 25-40-01-35C	042046 051052 042046 051052	RF
5	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01 ELECTRICAL EQUIP NUMBER: LS00001 ATTACHING PARTS	042046 051052	1
10	NAS1801-3-7		.SCREW	042046 051052	4
15	NAS1149D0332K		.WASHER	042046 051052	4
			-----*-----		
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-05-35C

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 35C
 PAGE 1
 FEB 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

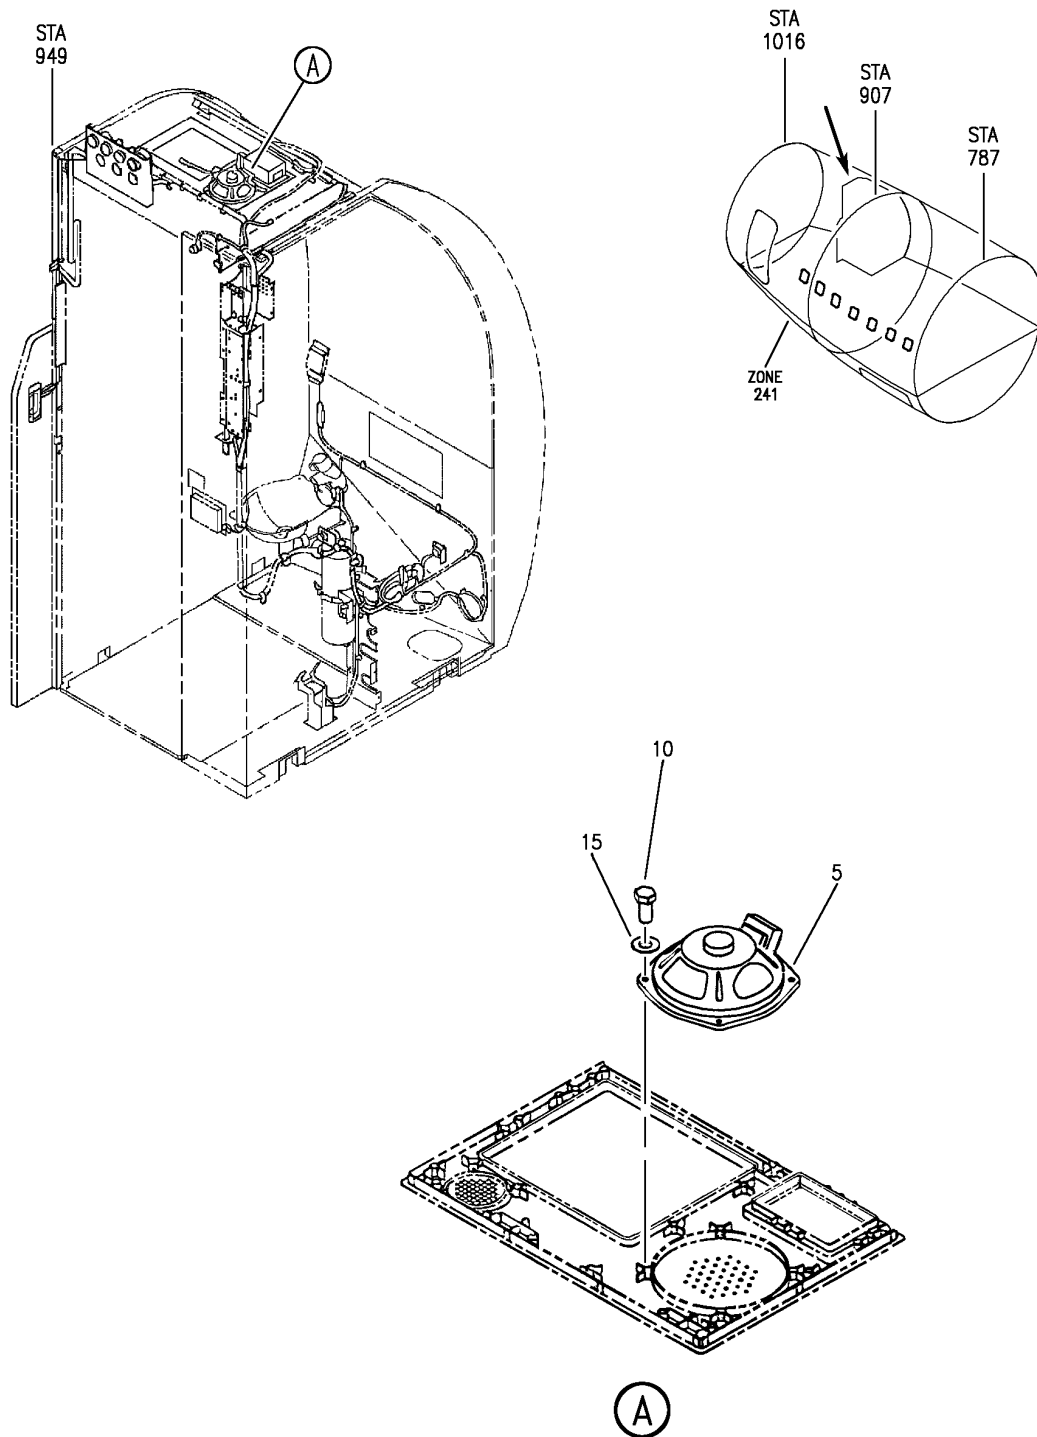

E 23310546N REV 116

ELECTRICAL ASSY-LAV D (COMMUNICATIONS ONLY)
FIGURE 46N

HAP
OCT 10/06

23-31-05-46N

23-31-05-46N
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
46N			ELECTRICAL ASSY-LAV D (COMMUNICATIONS ONLY)	031037 039041 047050 053200 968999	
- 1	D72W27051-111		ELECTRICAL ASSY-LAV D (COMMUNICATIONS ONLY) SUPPLIER CODE: VS5825 FOR NHA/OTHER SYS DET SEE: 25-40-01-46N	031037 039041 047050 053200 968999	RF
5	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01	031037 039041 047050 053200 968999	1
10	NAS1801-3-7		ATTACHING PARTS .SCREW	031037 039041 047050 053200 968999	4
15	NAS1149D0332K		.WASHER	031037 039041 047050 053200 968999	4
			-----*-----		
MISSING ITEM NUMBERS NOT APPLICABLE					


- ITEM NOT ILLUSTRATED

HAP

23-31-05-46N

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 46N
 PAGE 1
 FEB 15/09

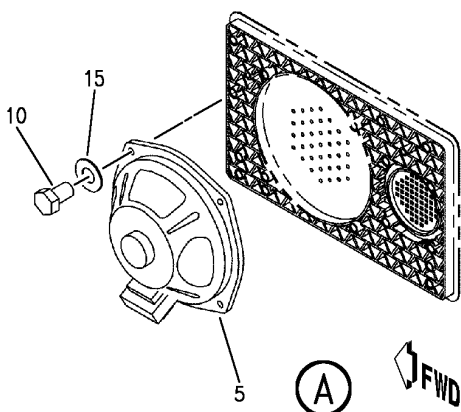

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
46P			ELECTRICAL ASSY-LAV A (COMMUNICATIONS ONLY)	031041 047050 053200 968999	
- 1	D72W27050-111		ELECTRICAL ASSY-LAV A (COMMUNICATIONS ONLY) SUPPLIER CODE: VS5825 FOR NHA/OTHER SYS DET SEE: 25-40-01-46P	031041 047050 053200 968999	RF
5	RDAM8018		.SPEAKER- SUPPLIER CODE: V0FF57 SPECIFICATION NUMBER: 10-62232-01	031041 047050 053200 968999	1
10	NAS1801-3-7		ATTACHING PARTS .SCREW	031041 047050 053200 968999	4
15	NAS1149D0332K		.WASHER	031041 047050 053200 968999	4
			-----*-----		
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-05-46P

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 46P
 PAGE 1
 FEB 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

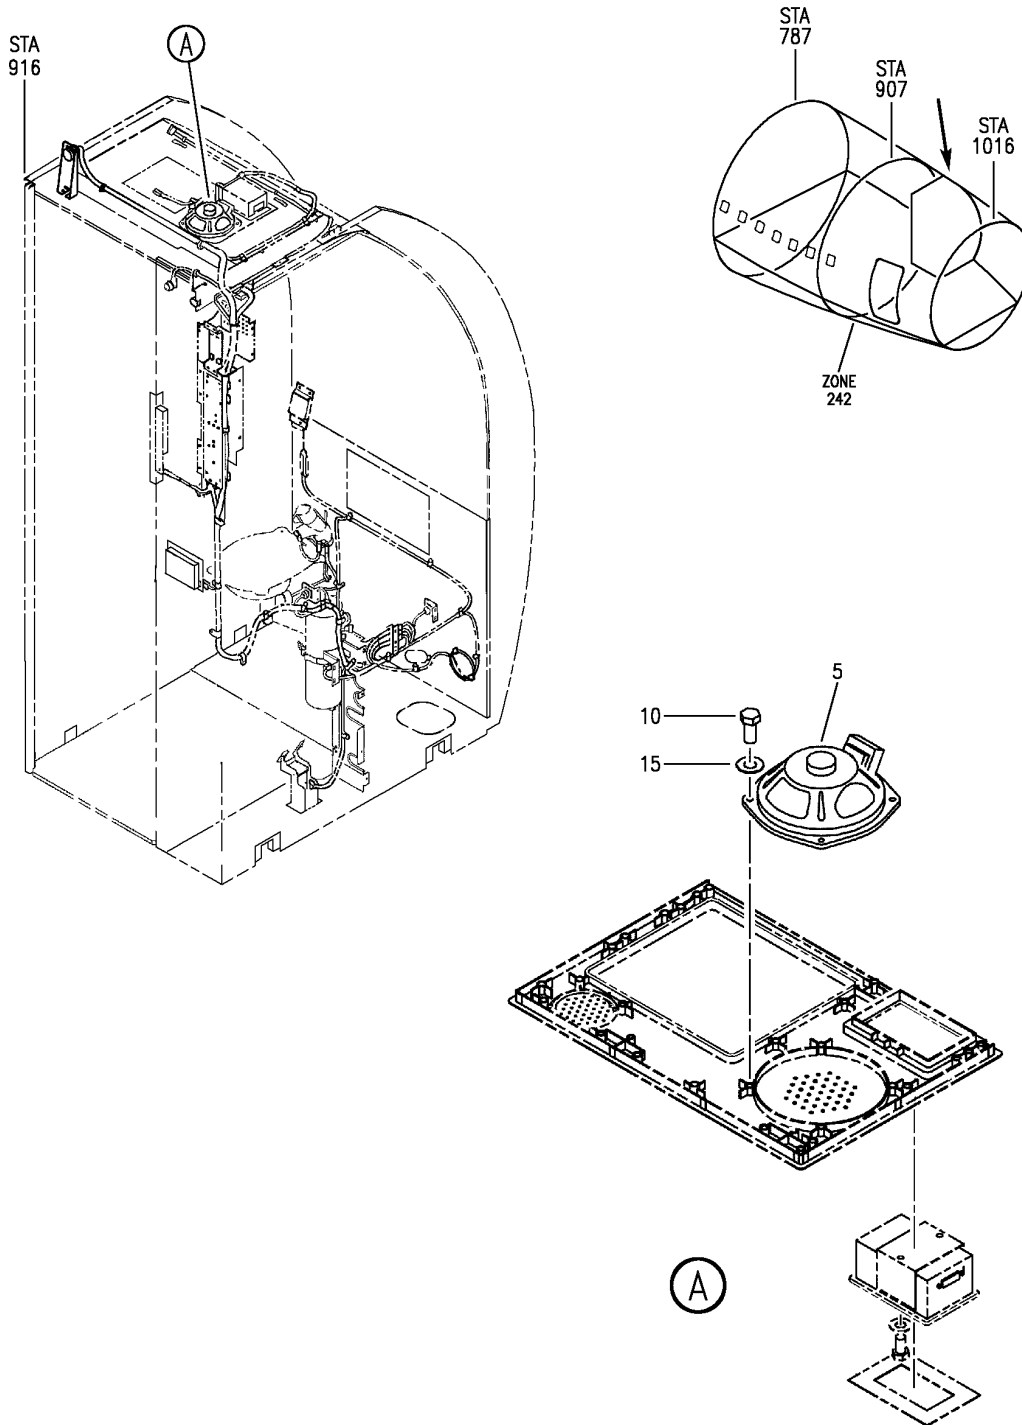

E 23310546Q REV 116

ELECTRICAL ASSY-LAV E (COMMUNICATIONS ONLY)

FIGURE 46Q

23-31-05-46Q

HAP
OCT 10/06

23-31-05-46Q
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
46Q			ELECTRICAL ASSY-LAV E (COMMUNICATIONS ONLY)	031037 039041 047050 053100	
- 1	D72W27052-111		ELECTRICAL ASSY-LAV E (COMMUNICATIONS ONLY) SUPPLIER CODE: VS5825 FOR NHA/OTHER SYS DET SEE: 25-40-01-46Q	031037 039041 047050 053100	RF
5	RDAM8018		.SPEAKER- SUPPLIER CODE: V0FF57 SPECIFICATION NUMBER: 10-62232-01	031037 039041 047050 053100	1
10	NAS1801-3-7		ATTACHING PARTS .SCREW	031037 039041 047050 053100	4
15	NAS1149D0332K		.WASHER	031037 039041 047050 053100	4
			-----*-----		
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-05-46Q

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 46Q
 PAGE 1
 FEB 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

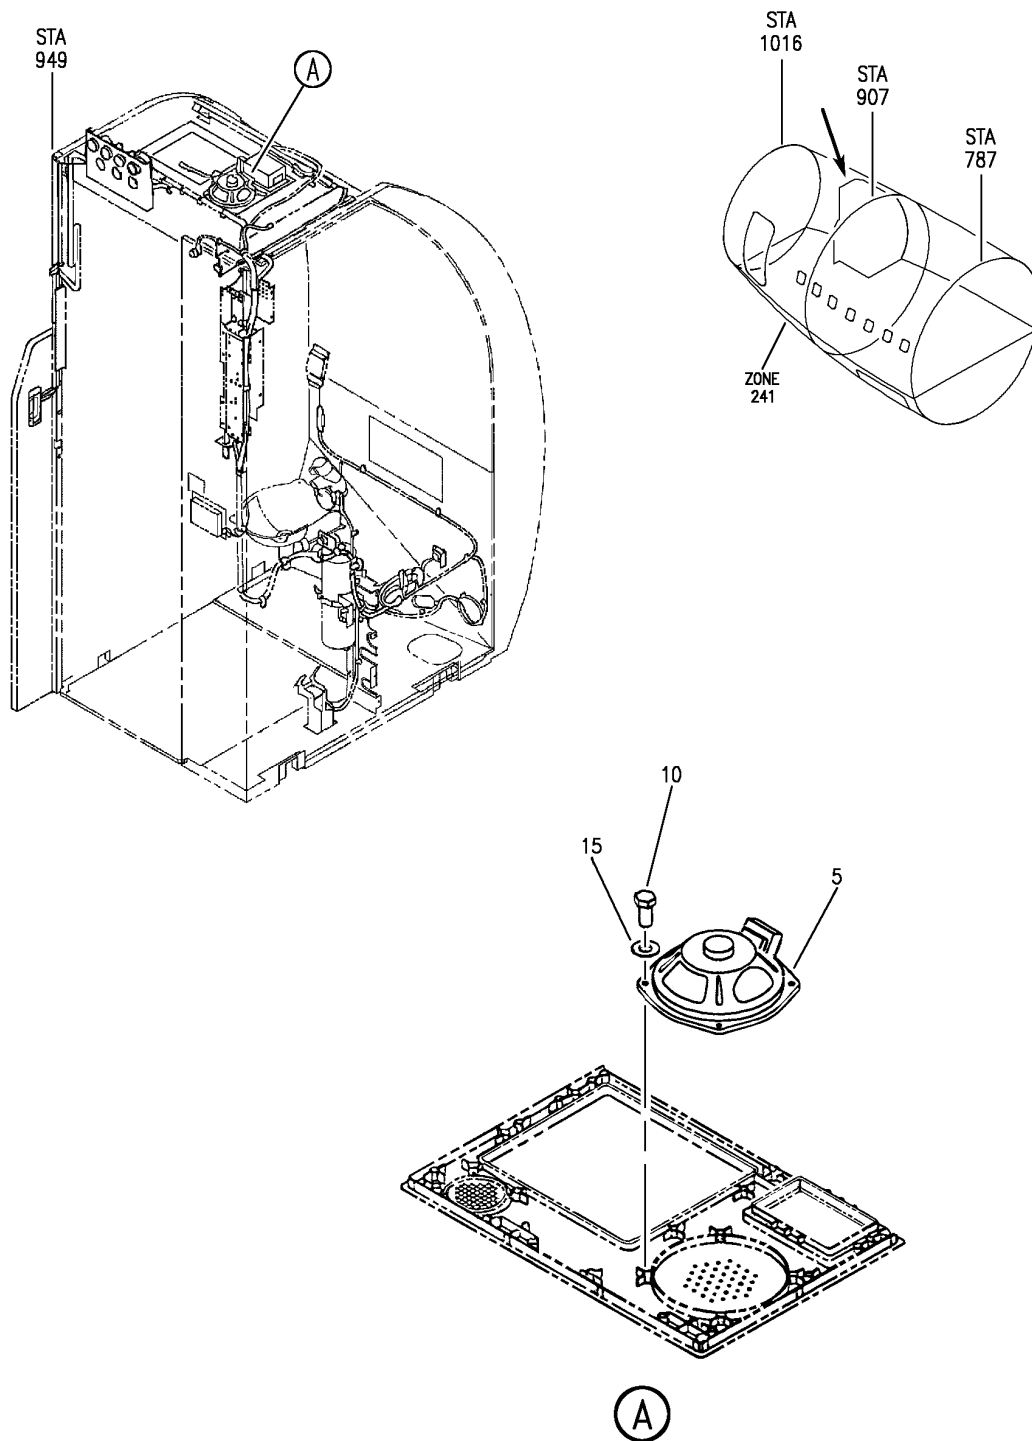

E 23310555A REV 125

ELECTRICAL ASSY-LAV D (COMMUNICATIONS ONLY)
FIGURE 55A

23-31-05-55A

HAP
FEB 10/07

23-31-05-55A
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55A			ELECTRICAL ASSY-LAV D (COMMUNICATIONS ONLY)	038038 042046 051052	
- 1	D72W27051-111		ELECTRICAL ASSY-LAV-D (COMMUNICATIONS ONLY) SUPPLIER CODE: VS5825 FOR NHA/OTHER SYS DET SEE: 25-40-01-55A	038038 042046 051052	RF
5	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01	038038 042046 051052	1
10	NAS1801-3-7		ATTACHING PARTS .SCREW	038038 042046 051052	4
15	NAS1149D0332K		.WASHER	038038 042046 051052	4
			-----*-----		
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-05-55A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 55A
 PAGE 1
 FEB 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

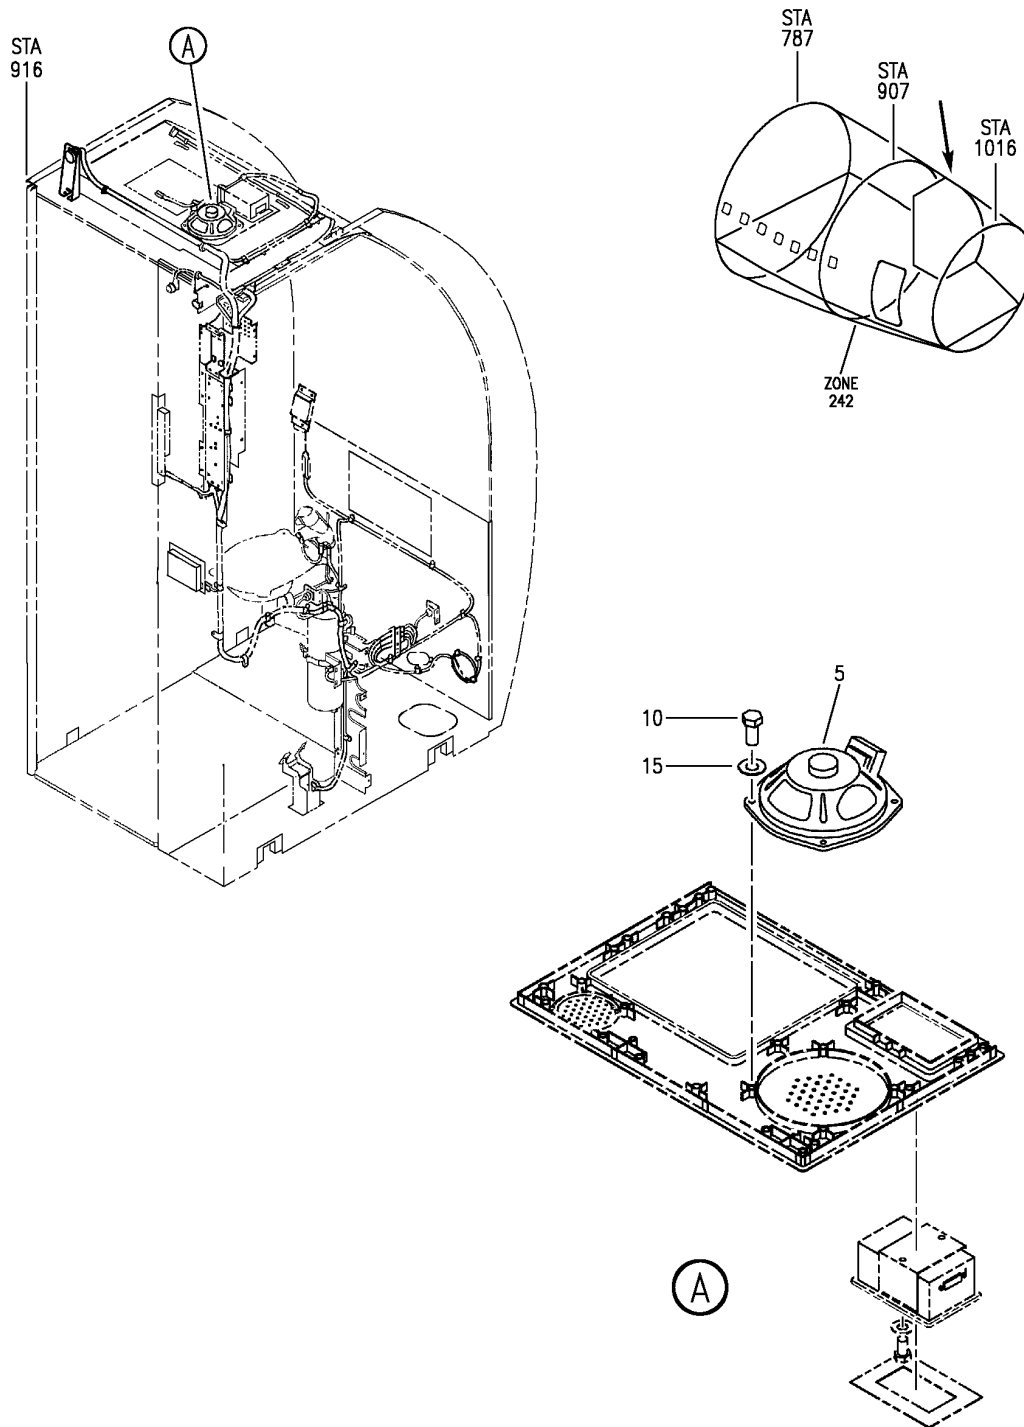

ELECTRICAL ASSY-LAV E (COMMUNICATIONS ONLY)

FIGURE 55C

23-31-05-55C

HAP
FEB 10/07

23-31-05-55C
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

E 23310555C REV 125

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
55C			ELECTRICAL ASSY-LAV E (COMMUNICATIONS ONLY)	038038 042046 051052	
- 1	D72W27052-111		ELECTRICAL ASSY-LAV E (COMMUNICATIONS ONLY) SUPPLIER CODE: VS5825 FOR NHA/OTHER SYS DET SEE: 25-40-01-55C	038038 042046 051052	RF
5	RDAM8018		.SPEAKER- SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: 10-62232-01	038038 042046 051052	1
10	NAS1801-3-7		ATTACHING PARTS .SCREW	038038 042046 051052	4
15	NAS1149D0332K		.WASHER	038038 042046 051052	4
			-----*-----		
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-05-55C

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 55C
 PAGE 1
 FEB 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

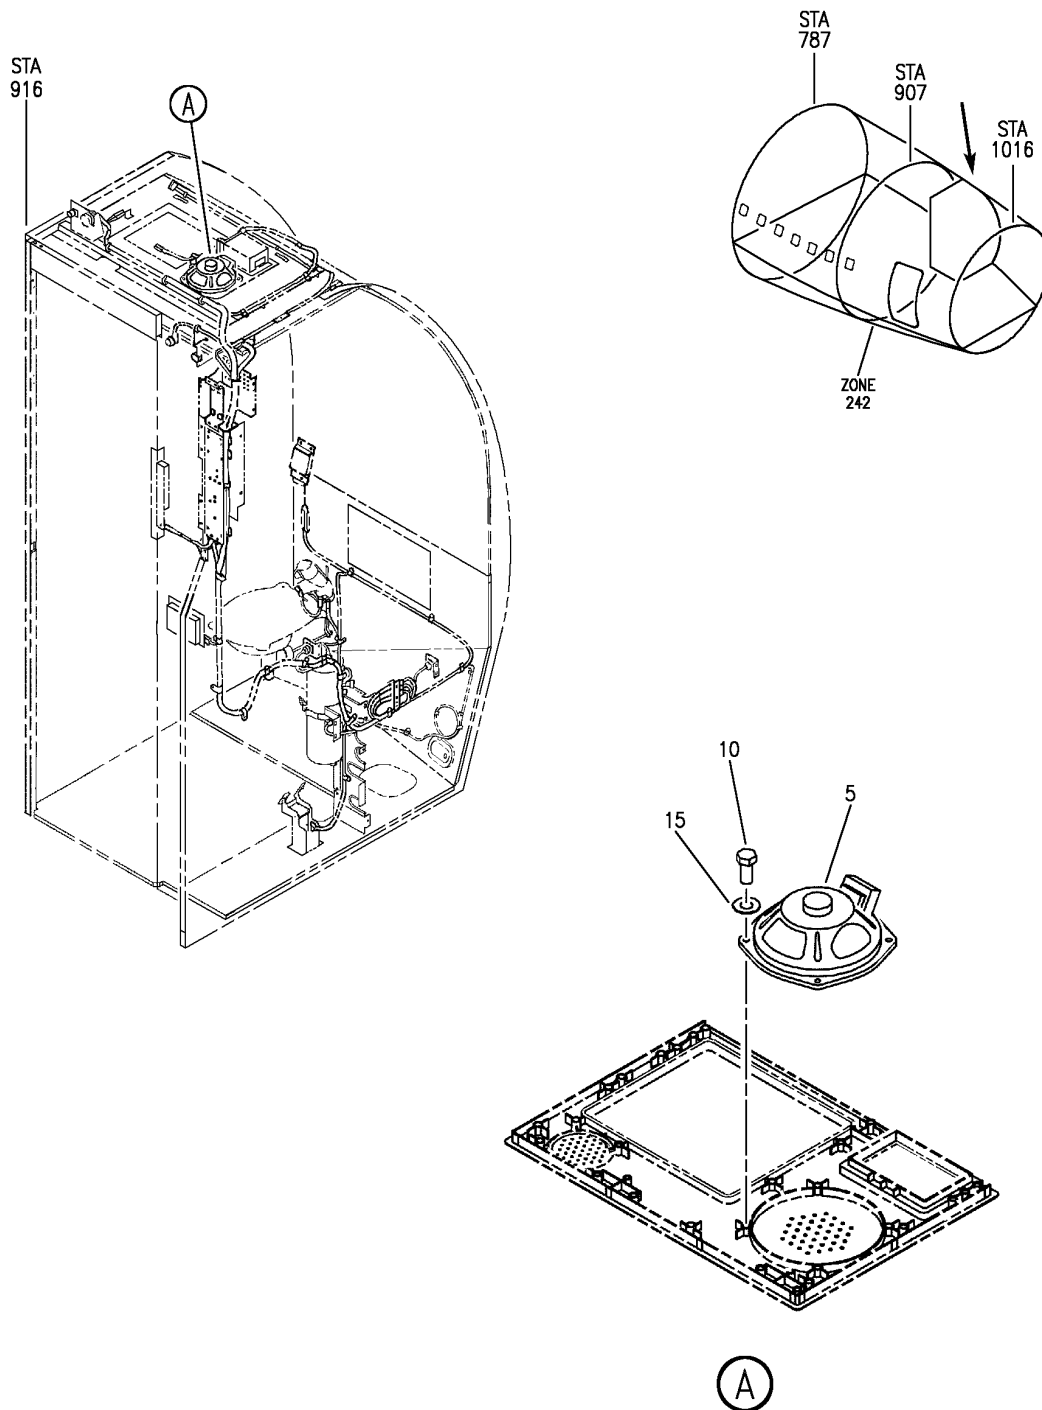

E 23310589 REV 127

ELECTRICAL ASSY-LAV E (COMMUNICATIONS ONLY)
FIGURE 89

23-31-05-89

HAP
FEB 10/07

23-31-05-89
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
89			ELECTRICAL ASSY-LAV E (COMMUNICATIONS ONLY)	101200 968999	
- 1	D72W27074-111		ELECTRICAL ASSY-LAV E (COMMUNICATIONS ONLY)	101200 968999	RF
			SUPPLIER CODE: VS5825		
			FOR NHA/OTHER SYS DET SEE: 25-40-01-89		
5	RDAM8018		.SPEAKER-	101200 968999	1
			SUPPLIER CODE: VOFF57		
			SPECIFICATION NUMBER: 10-62232-01		
			ELECTRICAL EQUIP NUMBER: LS00001		
10	NAS1801-3-7		ATTACHING PARTS		
			.SCREW	101200 968999	4
15	NAS1149D0332K		.WASHER	101200 968999	4
			-----*-----		
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-05-89

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-05
 FIG. 89
 PAGE 1
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

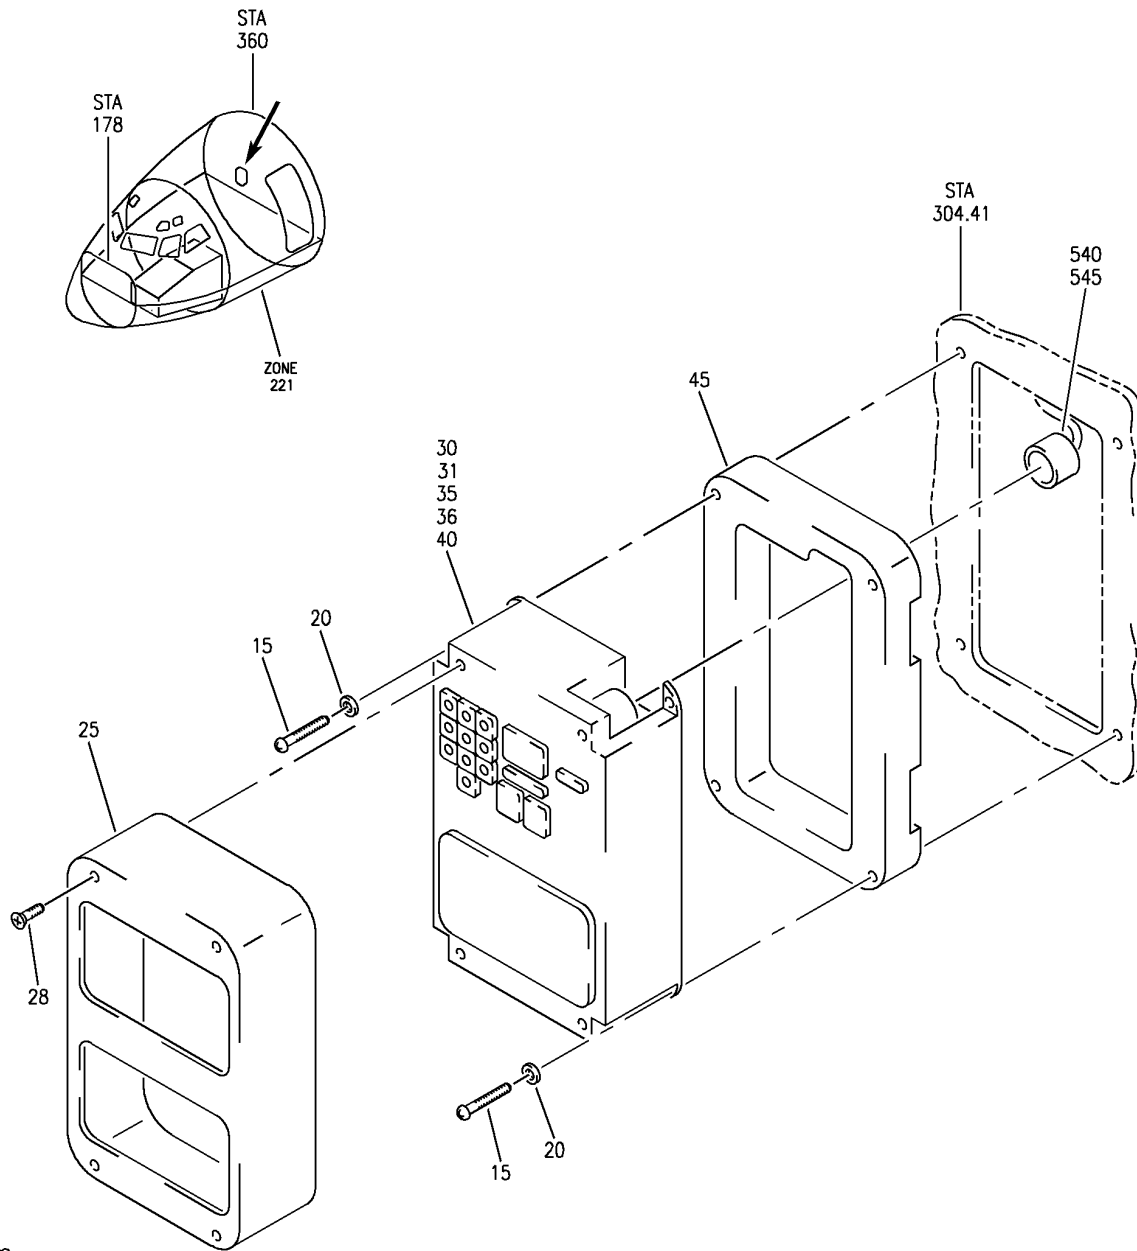

E 23310604 REV 113

PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC
FIGURE 4

23-31-06-04

HAP
OCT 15/08

23-31-06-04
PAGE 0

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4			PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC	201967	
- 1	417A6300-5SP		PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC POSITION DATA: STA 304.41, LBL 24.18, WL 280.15. FOR NHA SEE: 23-31-00-02A	201967	RF
15	NAS8203A24		.SCREW-	201967	4
20	NAS1149D0332J		.WASHER-	201967	4
25	R8G1X7308		.COVER-TAPE REPRODUCER SUPPLIER CODE: V54473	201967	1
28	R6XSS28P8FB		.SCREW	201967	4
35	RDAX7308-01		.REPRODUCER-TAPE SUPPLIER CODE: VOFF57 FUNCTIONAL DESCRIPTION: REPRODUCES PRE-RECORDED ANNOUNCEMENTS ELECTRICAL EQUIP NUMBER: M01276 COMPONENT MAINT MANUAL REF: 23-31-06 QUALIFIED I/W DATA: RDAX7308-01(BEIGE) I/W RDAX7308-03(GRAY) PER CUSTOMER PREFERENCE	201967	1
36	RDAX7308-01JN01		.REPRODUCER-TAPE SUPPLIER CODE: VOFF57 FUNCTIONAL DESCRIPTION: REPRODUCES PRE-RECORDED ANNOUNCEMENTS AND BOARDING MUSIC. ELECTRICAL EQUIP NUMBER: M01276 COMPONENT MAINT MANUAL REF: 23-31-06	201967	1
45	417A6310-1SP		.SPACER ASSY-	201967	1
- 505	286A3307-053		WIRE BUNDLE ASSY-	201967	RF
540	BACC45FT16-24S		.PLUG- POSITION DATA: FWD ELECTRICAL EQUIP NUMBER: D01507 WIRING DIAGRAM REF: 233106	201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-06-04

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-06
FIG. 04
PAGE 1
OCT 15/08

BOEING
 737-600/700/800/900
 PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4 545	BACC10GH16		.BACKSHELL- ELECTRICAL EQUIP NUMBER: D01507T WIRING DIAGRAM REF: 233106	201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-31-06-04

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-06
 FIG. 04
 PAGE 2
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

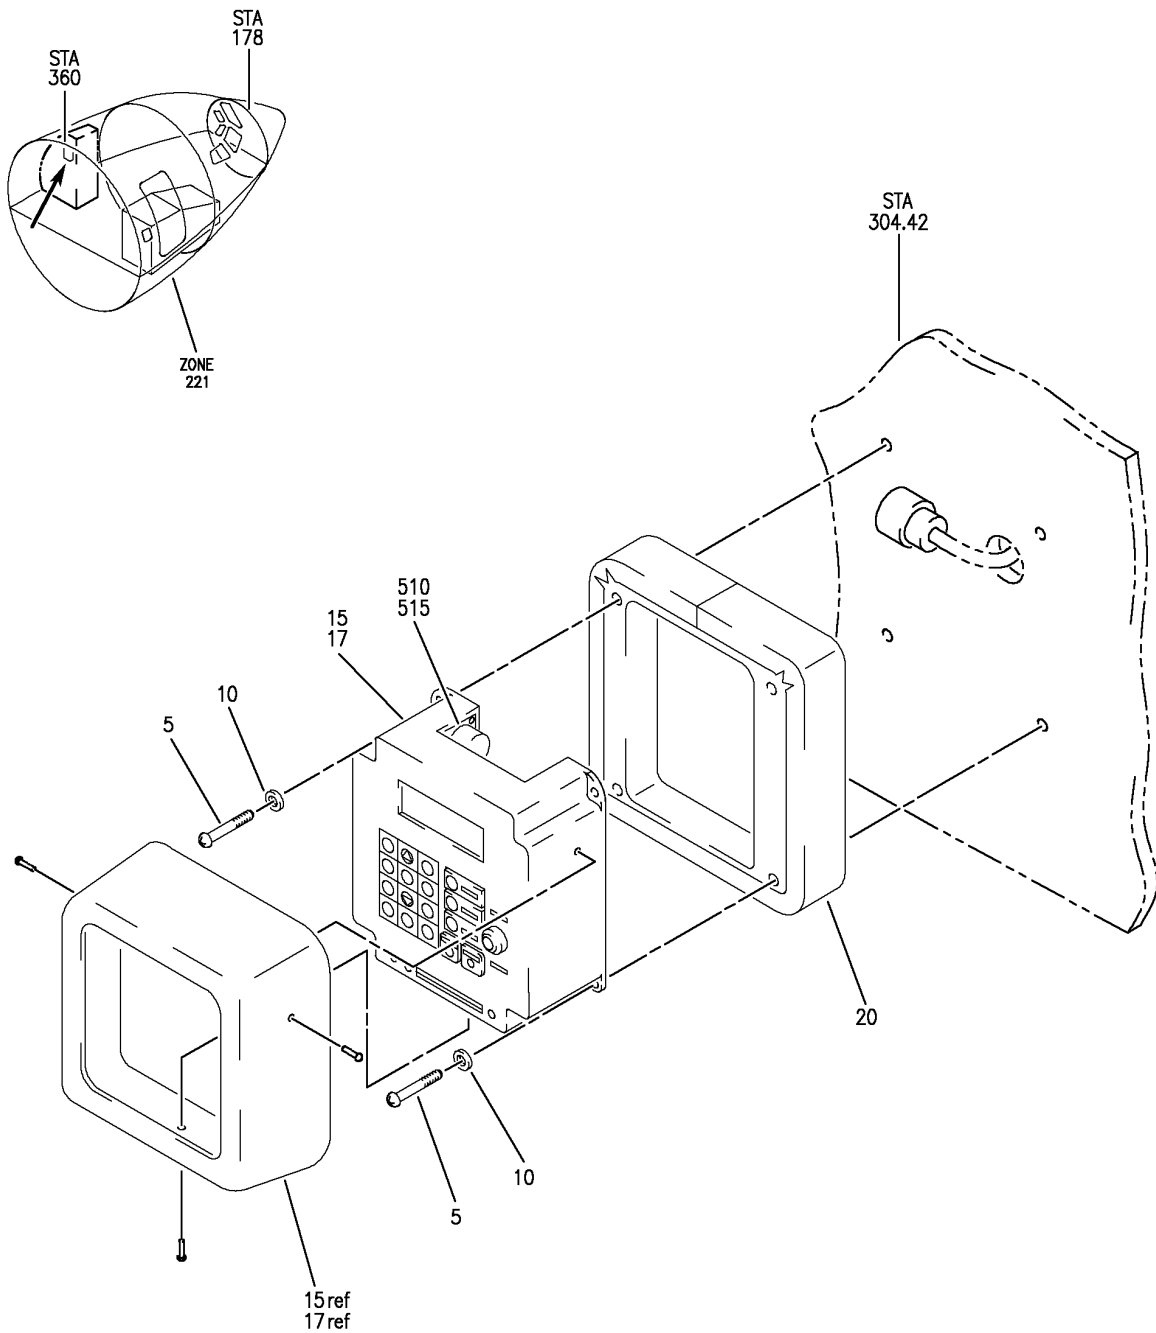

E 23310605 REV 070

PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC
FIGURE 5

23-31-06-05

HAP
OCT 10/06

23-31-06-05
PAGE 0

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5			PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC	031200 968999	
- 3	MODREF253330		PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC MODULE NUMBER: 417A6300-124 REV Y POSITION DATA: STA 304.42 LBL 24.18 WL 280.15	031031	1
- 3	MODREF274141		PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC MODULE NUMBER: 417A6300-124 REV AB POSITION DATA: STA 304.42 LBL 24.18 WL 280.15	032036 038038	1
- 4	MODREF311122		PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC MODULE NUMBER: 417A6300-124 REV AC POSITION DATA: STA 304.42, LBL 24.18, WL 280.15	037037	1
- 4	MODREF316070		PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC MODULE NUMBER: 417A6300-124 REV AD POSITION DATA: STA 304.42, LBL 24.18, WL 280.15	039043 101101 968971	1
- 4	MODREF338465		PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC MODULE NUMBER: 417A6300-124 REV AE POSITION DATA: STA 304.42, LBL 24.18, WL 280.15	044044 054100 102103	1
- 4	MODREF356908		PANEL INSTL-PRE-RECORDED ANNOUNCEMENT/MUSIC MODULE NUMBER: 417A6300-124 REV AF POSITION DATA: STA 304.42, LBL 24.18, WL 280.15	045053 104200 972999	1
5	BACB30NT3K17		.BOLT-	031200 968999	4
10	NAS1149D0332J		.WASHER-	031031	4
10	NAS620A10L		.WASHER-	032200 968999	4
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-06-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-06
FIG. 05
PAGE 1
FEB 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
15	RDAX7360-01		.MACHINE-TAPE REPRODUCER SUPPLIER CODE: VOFF57 FUNCTIONAL DESCRIPTION: REPRODUCES PRE-RECORDED ANNOUNCEMENTS AND BOARDING MUSIC. ELECTRICAL EQUIP NUMBER: M01276 COMPONENT MAINT MANUAL REF: 23-31-18	032200 968999	1
15	RDAX7360-01		.MACHINE-TAPE REPRODUCER SUPPLIER CODE: VOFF57 FUNCTIONAL DESCRIPTION: REPRODUCES PRE-RECORDED ANNOUNCEMENTS AND BOARDING MUSIC. ELECTRICAL EQUIP NUMBER: M01276 COMPONENT MAINT MANUAL REF: 23-31-18	031031	1
20	417A6310-11		.SPACER ASSY-	031200 968999	1
- 295	MODREF377413		SOFTWARE INSTL- MODULE NUMBER: 222A0001-10 REV AK	047053 107200	1
- 296	MODREF313675		SOFTWARE INSTL- MODULE NUMBER: 222A0001-10 REV AG	037037 039043 101101 968971	1
- 296	MODREF348466		SOFTWARE INSTL- MODULE NUMBER: 222A0001-10 REV AH	044044 054100 102103	1
- 296	MODREF359714		SOFTWARE INSTL- MODULE NUMBER: 222A0001-10 REV AJ	045046 104106 972999	1
- 300	MODREF271536		SOFTWARE INSTL- MODULE NUMBER: 222A0001-10 REV AD	031031	1
- 300	MODREF278572		SOFTWARE INSTL- MODULE NUMBER: 222A0001-10 REV AE	032036 038038	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-06-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-06
 FIG. 05
 PAGE 2
 FEB 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
- 305	2377MEI241-00		.SOFTWARE-PRAM SUPPLIER CODE: VOFF57 USED WITH: RDAX7360-02 HARDWARE REFERENCE SEE: 23-31-06-05	031200 968999	1
- 500	286A3307-235		WIRE BUNDLE ASSY-	031200 968999	RF
510	BACC45FT16-24S		.PLUG- ELECTRICAL EQUIP NUMBER: D01507 WIRING DIAGRAM REF: 233106	031200 968999	1
515	BACC10GH16		.BACKSHELL- ELECTRICAL EQUIP NUMBER: D01507T WIRING DIAGRAM REF: 233106	031200 968999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-31-06-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-06
 FIG. 05
 PAGE 3
 FEB 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

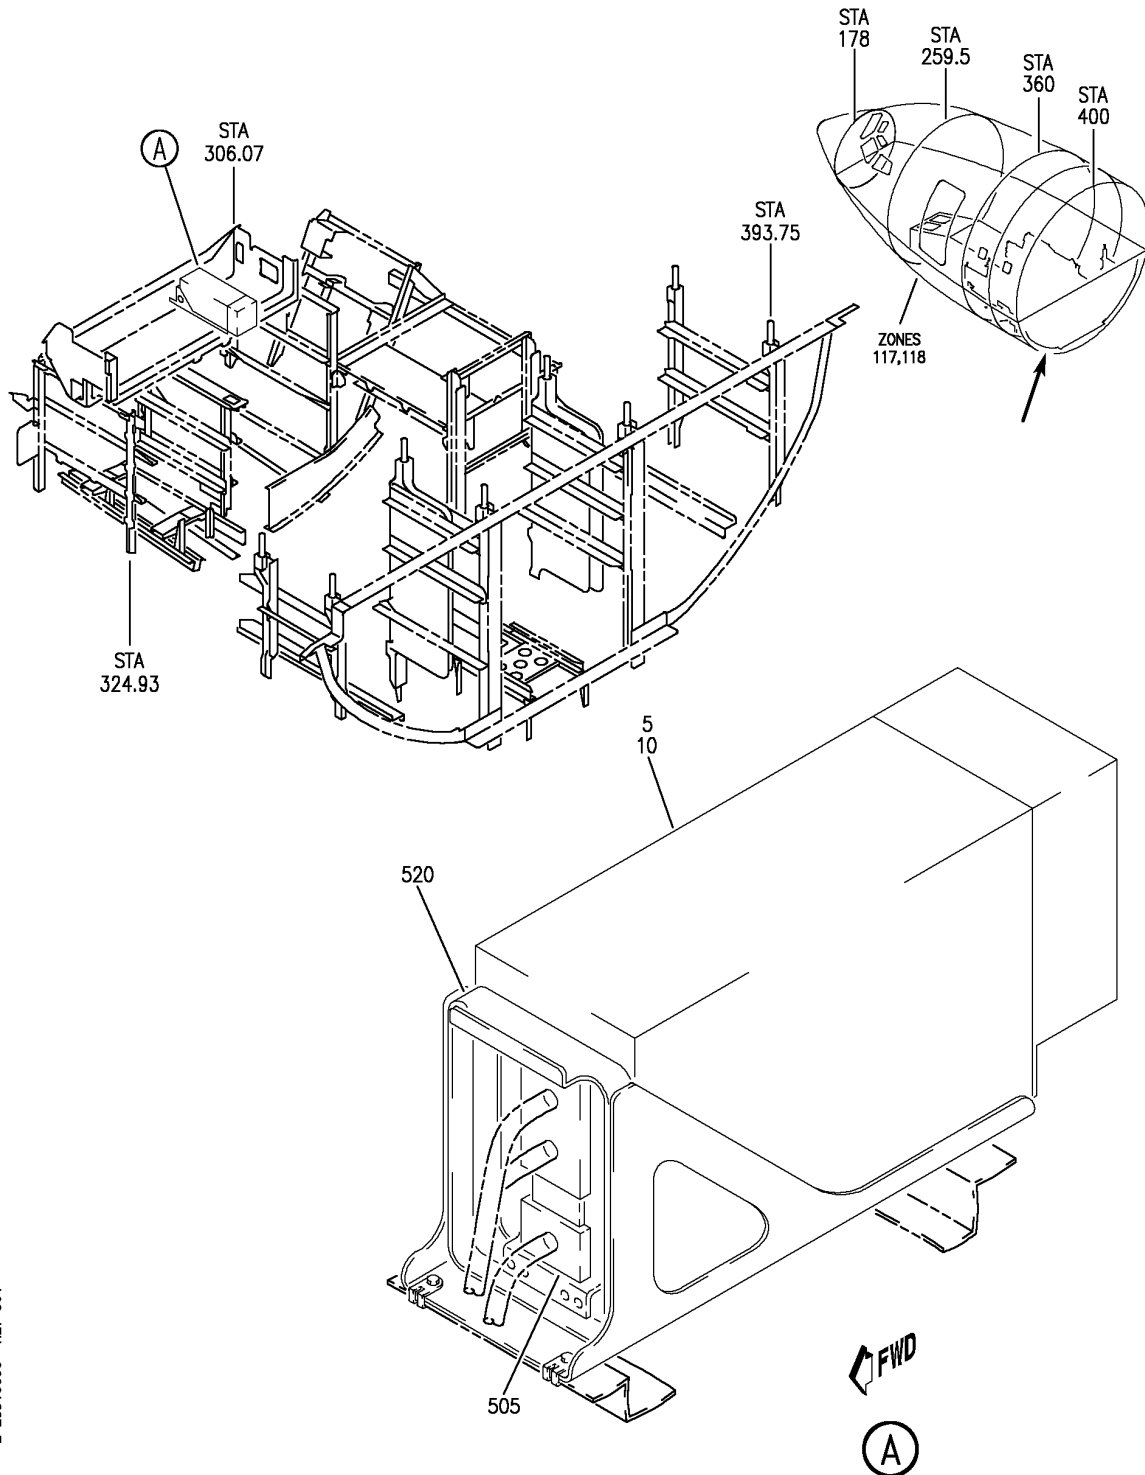

E 23310606 REV 064

EQUIPMENT INSTL-E/E BAY E8 RACK(PASSENGER ADDRESS SYSTEM ONLY)

FIGURE 6

23-31-06-06

HAP
OCT 10/06

23-31-06-06
PAGE 0

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
6			EQUIPMENT INSTL-E/E BAY	001030	
- 1	284A0480-1		E8 RACK(PASSENGER ADDRESS SYSTEM ONLY)		
			EQUIPMENT INSTL-E/E BAY	001007	RF
			E8 RACK(PASSENGER ADDRESS SYSTEM ONLY)		
			FOR NHA/OTHER SYS DET SEE: 23-30-00-12		
- 1	284A0480-12		EQUIPMENT INSTL-E/E BAY	008011	RF
			E8 RACK(PASSENGER ADDRESS SYSTEM ONLY)		
			FOR NHA/OTHER SYS DET SEE: 23-30-00-12		
- 2	284A0481-108		EQUIPMENT INSTL-E/E BAY	012030	RF
			E8 RACK(PASSENGER ADDRESS SYSTEM ONLY)		
			FOR NHA/OTHER SYS DET SEE: 23-30-00-12		
5	980-9903-007		.REPRODUCER-TAPE (PRAM)	001013	1
			SUPPLIER CODE: V62204	015030	
			FUNCTIONAL DESCRIPTION: REPRODUCES PRE-RECORDED ANNOUNCEMENTS AND BOARDING MUSIC		
			ELECTRICAL EQUIP NUMBER: M01966		
5	980-9903-007		.REPRODUCER-TAPE (PRAM)	014014	1
			(CUSTOMER FURNISHED)		
			SUPPLIER CODE: V62204		
			FUNCTIONAL DESCRIPTION: REPRODUCES PRE-RECORDED ANNOUNCEMENTS AND BOARDING MUSIC		
			ELECTRICAL EQUIP NUMBER: M01966		
- 500	286A0813-001		WIRE BUNDLE ASSY	001004	RF
				006007	
- 500	286A0813-005		WIRE BUNDLE ASSY	005005	RF
- 500	286A0813-009		WIRE BUNDLE ASSY	008027	RF
- 500	286A0813-011		WIRE BUNDLE ASSY	028030	RF
505	BCREF11770		.PLUG-	001030	1
			OVERLENGTH PART NUMBER: BACC66F11F69AA01		
			ELECTRICAL EQUIP NUMBER: D10665		
			WIRING DIAGRAM REF: 233106		
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-06-06

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-06
 FIG. 06
 PAGE 1
 OCT 10/06

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
6			ATTACHING PARTS		
- 510	NAS1801-06		.SCREW-	001030	4
			POSITION DATA:		
			FARSIDE		
			SIZE DETERMINED ON INSTL.		
- 515	PLH506CD		.NUT-	001030	4
			SUPPLIER CODE:		
			VF0224		
			SPECIFICATION NUMBER:		
			BACN10YR06CD		
			OPTIONAL PART:		
			H52732-06CD		
			V15653		
			POSITION DATA:		
			NEAR SIDE		
			-----*-----		
520	RBGP48-116N		.BACKSHELL-GROUND, ARINC	001030	1
			600		
			SUPPLIER CODE:		
			V09922		
			SPECIFICATION NUMBER:		
			S280W601-116		
			ELECTRICAL EQUIP NUMBER:		
			D10665T		
			WIRING DIAGRAM REF:		
			233406		

MISSING ITEM NUMBERS NOT APPLICABLE

- ITEM NOT ILLUSTRATED


HAP

23-31-06-06

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-06
 FIG. 06
 PAGE 2
 FEB 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

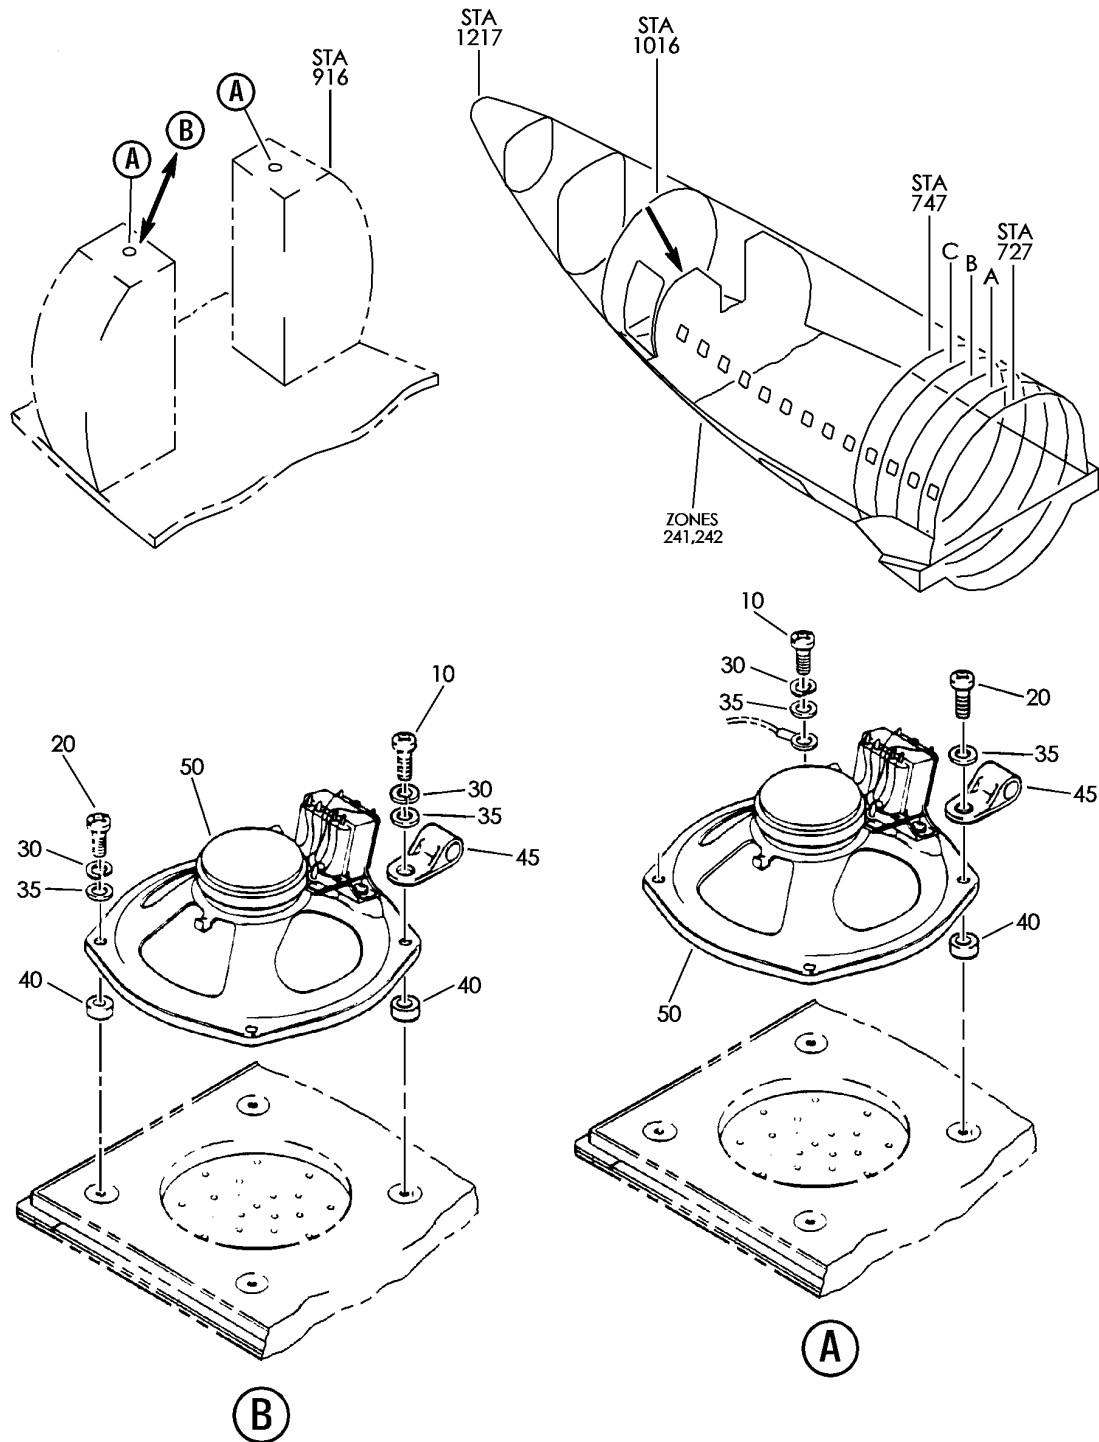

E 23311404 REV 058

SERVICE UNIT ASSY PASS. LAV D AND E (COMMUNICATIONS ONLY)
FIGURE 4

23-31-14-04

HAP
OCT 10/06

23-31-14-04
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
4			SERVICE UNIT ASSY	001007	
			PASS. LAV D AND E		
			(COMMUNICATIONS ONLY)		
- 1	C22502-571-313		SERVICE UNIT ASSY-PASS.	001007	RF
			LAV D AND E		
			(COMMUNICATIONS ONLY)		
			SUPPLIER CODE:		
			VU3384		
			FOR NHA/OTHER SYS DET SEE:		
			25-41-40-02		
10	MS27039-0810		.SCREW	001007	1
20	MS27039-0809		.SCREW	001007	3
30	SP47X		.WASHER-SPRING	001007	1
35	SP122C		.WASHER-	001007	4
40	C22102-949-101		.SPACER-	001007	4
			SUPPLIER CODE:		
			VU3384		
45	BACC10DL6		.CLAMP-P	001007	1
50	RDAM8005A		.SPEAKER-MZ107	001007	1
			SUPPLIER CODE:		
			VOFF57		
			SPECIFICATION NUMBER:		
			S222T101-101		

MISSING ITEM NUMBERS NOT APPLICABLE

- ITEM NOT ILLUSTRATED



HAP

23-31-14-04

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-14
 FIG. 04
 PAGE 1
 OCT 10/06

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

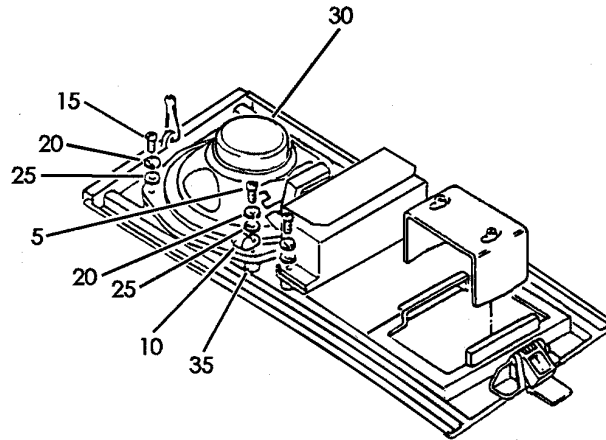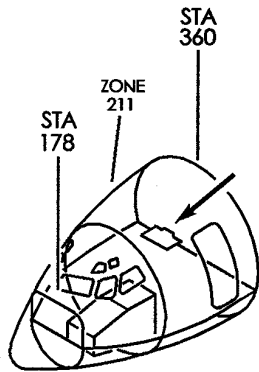

E 23311405 REV 030

SERVICE UNIT ASSY-PASS. LAV A (COMMUNICATIONS ONLY)

FIGURE 5

23-31-14-05

HAP
OCT 10/06

23-31-14-05
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5			SERVICE UNIT ASSY-PASS. LAV A (COMMUNICATIONS ONLY)	001001 006007	
- 1	C22102-101-315		SERVICE UNIT ASSY-PASS. LAV A (COMMUNICATIONS ONLY) SUPPLIER CODE: VU3384 FOR NHA/OTHER SYS DET SEE: 25-41-40-01	001001 006007	RF
5	MS27039-0812		.SCREW	001001 006007	1
10	BACC10DK4		.CLAMP-P	001001 006007	1
15	MS27039-0810		.SCREW	001001 006007	3
20	SP47X		.WASHER-SPR	001001 006007	4
25	SP122C		.WASHER-	001001 006007	4
30	RDAM8005A		.SPEAKER-MZ107 SUPPLIER CODE: VOFF57 SPECIFICATION NUMBER: S222T101-101	001001 006007	1
35	C22102-949-103		.SPACER- SUPPLIER CODE: VU3384	001001 006007	4
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-31-14-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-31-14
 FIG. 05
 PAGE 1
 OCT 10/06