


VOICE RECORDER

HAP
OCT 10/06

23-71-00
SECTION TITLE
PAGE 1

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

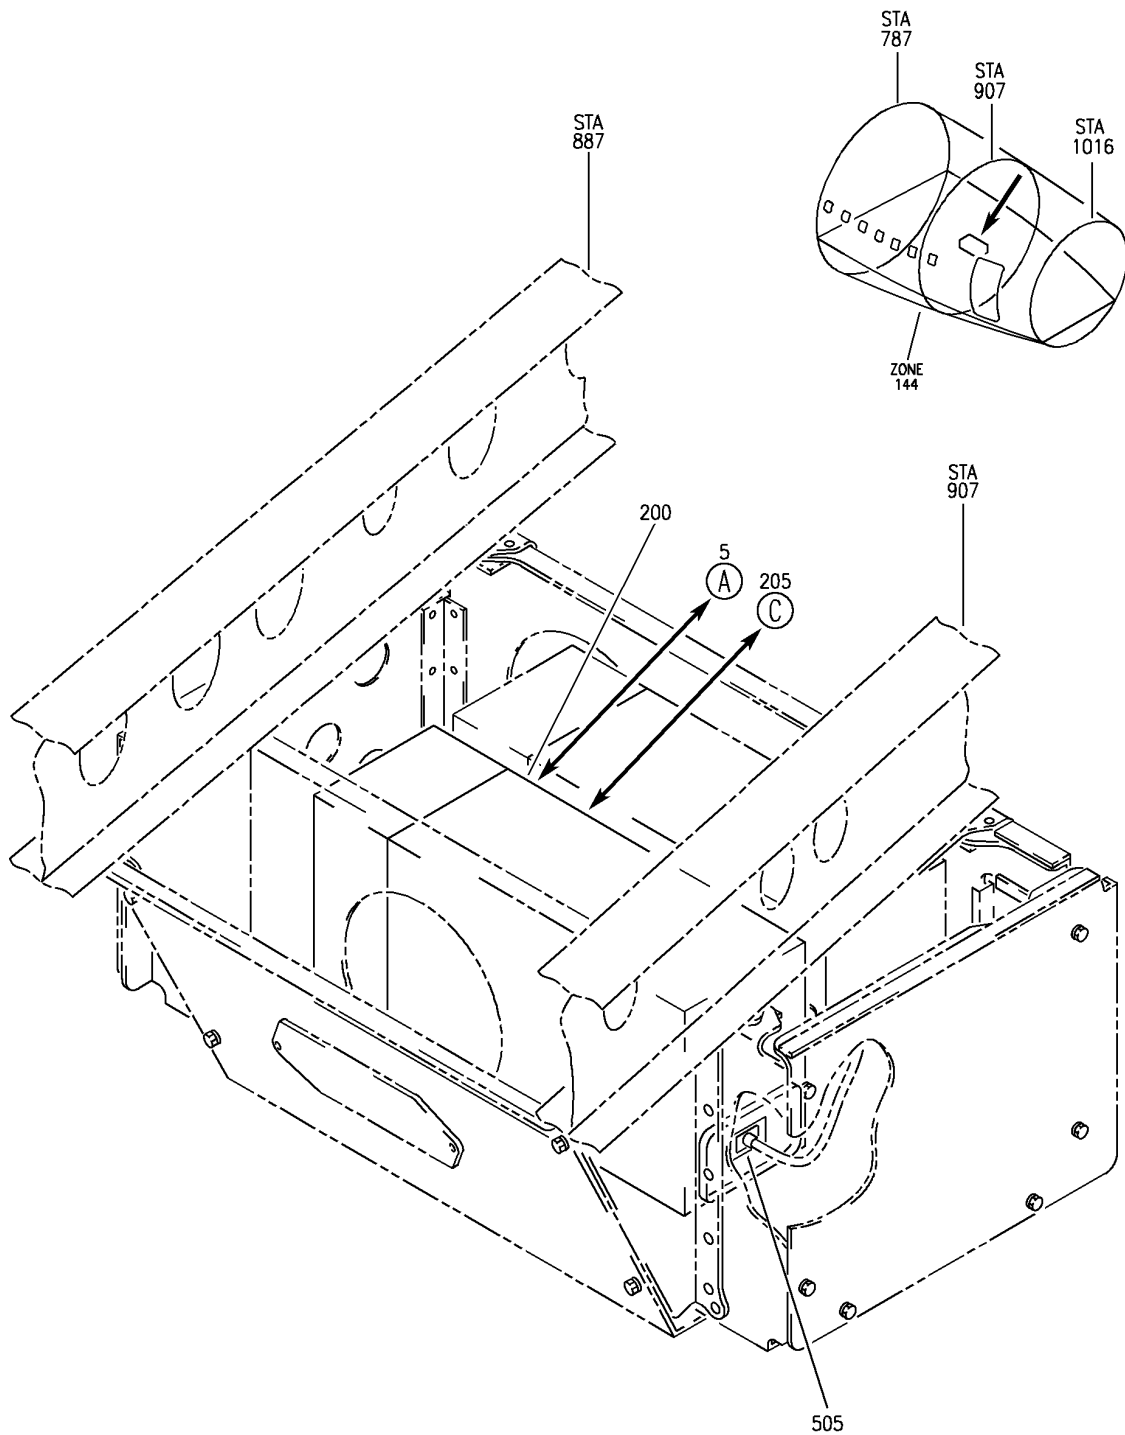

E 23711101 SHT 1 REV 139

EQUIPMENT INSTL-(COMMUNICATION ONLY)
FIGURE 1 (SHEET 1)



23-71-11-01

HAP
FEB 15/08

23-71-11-01
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

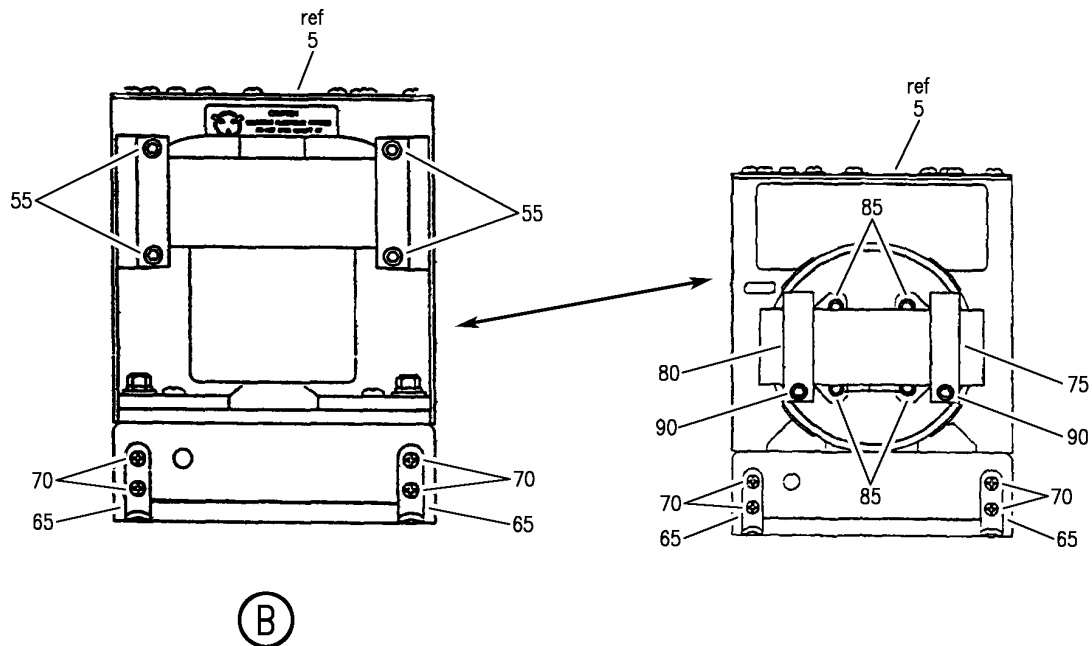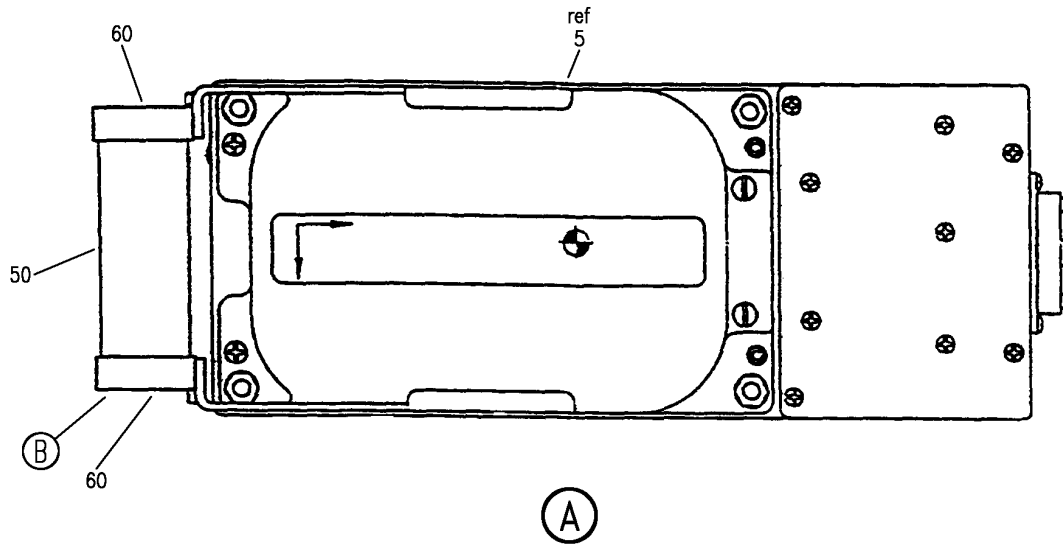

E 23711101 SHT 2 REV 081

EQUIPMENT INSTL-(COMMUNICATION ONLY)
FIGURE 1 (SHEET 2)


23-71-11-01

HAP
OCT 10/06

23-71-11-01
PAGE 0A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

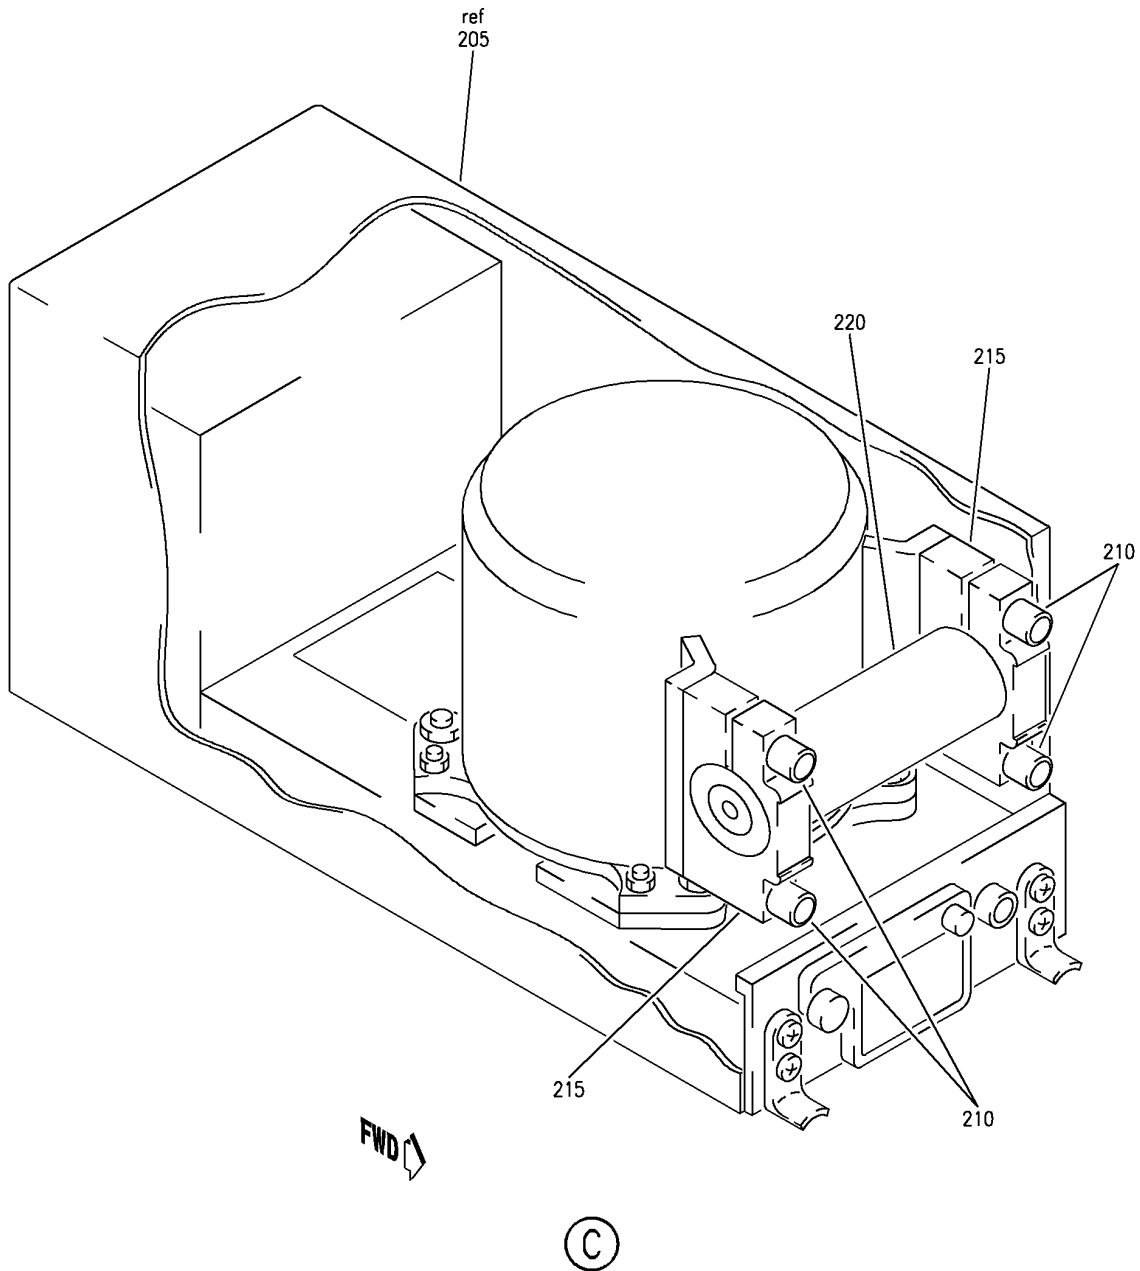

E 23711101 SHT 3 REV 139

EQUIPMENT INSTL-(COMMUNICATION ONLY)
FIGURE 1 (SHEET 3)

23-71-11-01

HAP
FEB 15/08

23-71-11-01
PAGE 0B

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			EQUIPMENT INSTL- (COMMUNICATION ONLY)	001030 201967	
- 1	284A0460-1		EQUIPMENT INSTL- (COCKPIT VOICE RECORDER ONLY)	001011 201967	RF
			POSITION DATA: AFT CARGO BAY AND E6 RACK FOR NHA/OTHER SYS DET SEE: 25-50-00-08		
- 2	284A0462-237106		EQUIPMENT INSTL-COCKPIT VOICE RECORDER POSITION DATA: AFT CARGO BAY AND E6 RACK FOR NHA SEE: 23-70-00-03	012030	RF
5	980-6022-001		RECORDER ASSY-VOICE (CUSTOMER FURNISHED) SUPPLIER CODE: V97896 FUNCTIONAL DESCRIPTION: RECORDS FOUR SEPARATE CHANNELS OF COCKPIT AUDIO SIMULTANEOUSLY USING SOLID-STATE MEMORY. ELECTRICAL EQUIP NUMBER: M00383 COMPONENT MAINT MANUAL REF: 23-70-44 MAINTENANCE MANUAL REF: 23-71-11 QUALIFIED I/W DATA: 980-6020-001 (30 MIN) AND 980-6022-001 (2 HOUR) RECORDERS ARE INTERCHANGEABLE PER CUSTOMER REQUIREMENTS.	012030	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-71-11-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-11
 FIG. 01
 PAGE 1
 OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1	5 980-6022-001		.RECORDER ASSY-VOICE SUPPLIER CODE: V97896 FUNCTIONAL DESCRIPTION: RECORDS FOUR SEPARATE CHANNELS OF COCKPIT AUDIO SIMULTANEOUSLY USING SOLID-STATE MEMORY. ELECTRICAL EQUIP NUMBER: M00383 COMPONENT MAINT MANUAL REF: 23-70-44 MAINTENANCE MANUAL REF: 23-71-11 QUALIFIED I/W DATA: 980-6020-001 (30 MIN) AND 980-6022-001 (2 HOUR) RECORDERS ARE INTERCHANGEABLE PER CUSTOMER REQUIREMENTS.	001011 201967	1
50	DK100		..BEACON-UNDERWATER LOCATOR SUPPLIER CODE: V94970 OPTIONAL PART: DK120 V94970 ELP362D V4U270 ELP362DS V4U270	001030 201967	1
50	ELP362D		..BEACON-UNDERWATER LOCATOR SUPPLIER CODE: V4U270 COMPONENT MAINT MANUAL REF: 31-35-40 OPTIONAL PART: DK100 V94970 DK120 V94970 ELP362DS V4U270	001030 201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-71-11-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-11
 FIG. 01
 PAGE 2
 OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
50	DK120	..BEACON-UNDERWATER LOCATOR SUPPLIER CODE: V94970 OPTIONAL PART: DK100 V94970 ELP362D V4U270 ELP362DS V4U270	001030 201967	1
50	ELP362DS	..BEACON-UNDERWATER LOCATOR SUPPLIER CODE: V4U270 OPTIONAL PART: DK100 V94970 DK120 V94970 ELP362D V4U270 ATTACHING PARTS	001030 201967	1
55	NAS1352C08-20	..SCREW- CONFIG CHG DATA FROM A CMM: SUPSD BY PL54U82J20 -----*-----	001030 201967	4
55	PL54U82J20	..SCREW- SUPPLIER CODE: V03038 CONFIG CHG DATA FROM A CMM: SUPERSEDES NAS1352C08-20 OPTIONAL PART: PAT63234SS1 V51506	001030 201967	4
55	PAT63234SS1	..SCREW- SUPPLIER CODE: V51506 OPTIONAL PART: PL54U82J20 V03038	001030 201967	4
60	654-0146-001	..MOUNT-BEACON SUPPLIER CODE: V97896	001030 201967	1
65	405-0255-001	..HOOK- SUPPLIER CODE: V97896	001030 201967	2
70	MS24693C29	..SCREW	001030 201967	4
MISSING ITEM NUMBERS NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

HAP

23-71-11-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-11
 FIG. 01
 PAGE 3
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
75	625-1132-006	..SUPPORT-ULB SUPPLIER CODE: V97896	001030 201967	1
80	625-1132-005	..SUPPORT-ULB SUPPLIER CODE: V97896	001030 201967	1
85	PAT63216SS1	..SCREW-SOCKET CAP SUPPLIER CODE: V51506 OPTIONAL PART: PL54U82J6 V03038	001030 201967	4
85	PL54U82J6	..SCREW-SOCKET CAP SUPPLIER CODE: V03038 OPTIONAL PART: PAT63216SS1 V51506	001030 201967	4
90	PAT63220SS1	..SCREW-SOCKET CAP SUPPLIER CODE: V51506	001030 201967	2
- 500	286A5431-003	WIRE BUNDLE ASSY	001007	RF
- 500	286A5431-009	WIRE BUNDLE ASSY	201967	RF
- 500	286A5431-012	WIRE BUNDLE ASSY-	008030	RF
505	BCREF2215	.PLUG- OVERLENGTH PART NUMBER: DPXBMB57-33S0001 ELECTRICAL EQUIP NUMBER: D00177 WIRING DIAGRAM REF: 237101	001030 201967	1
MISSING ITEM NUMBERS NOT APPLICABLE				

- ITEM NOT ILLUSTRATED


HAP

23-71-11-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-11
 FIG. 01
 PAGE 4
 OCT 15/08

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

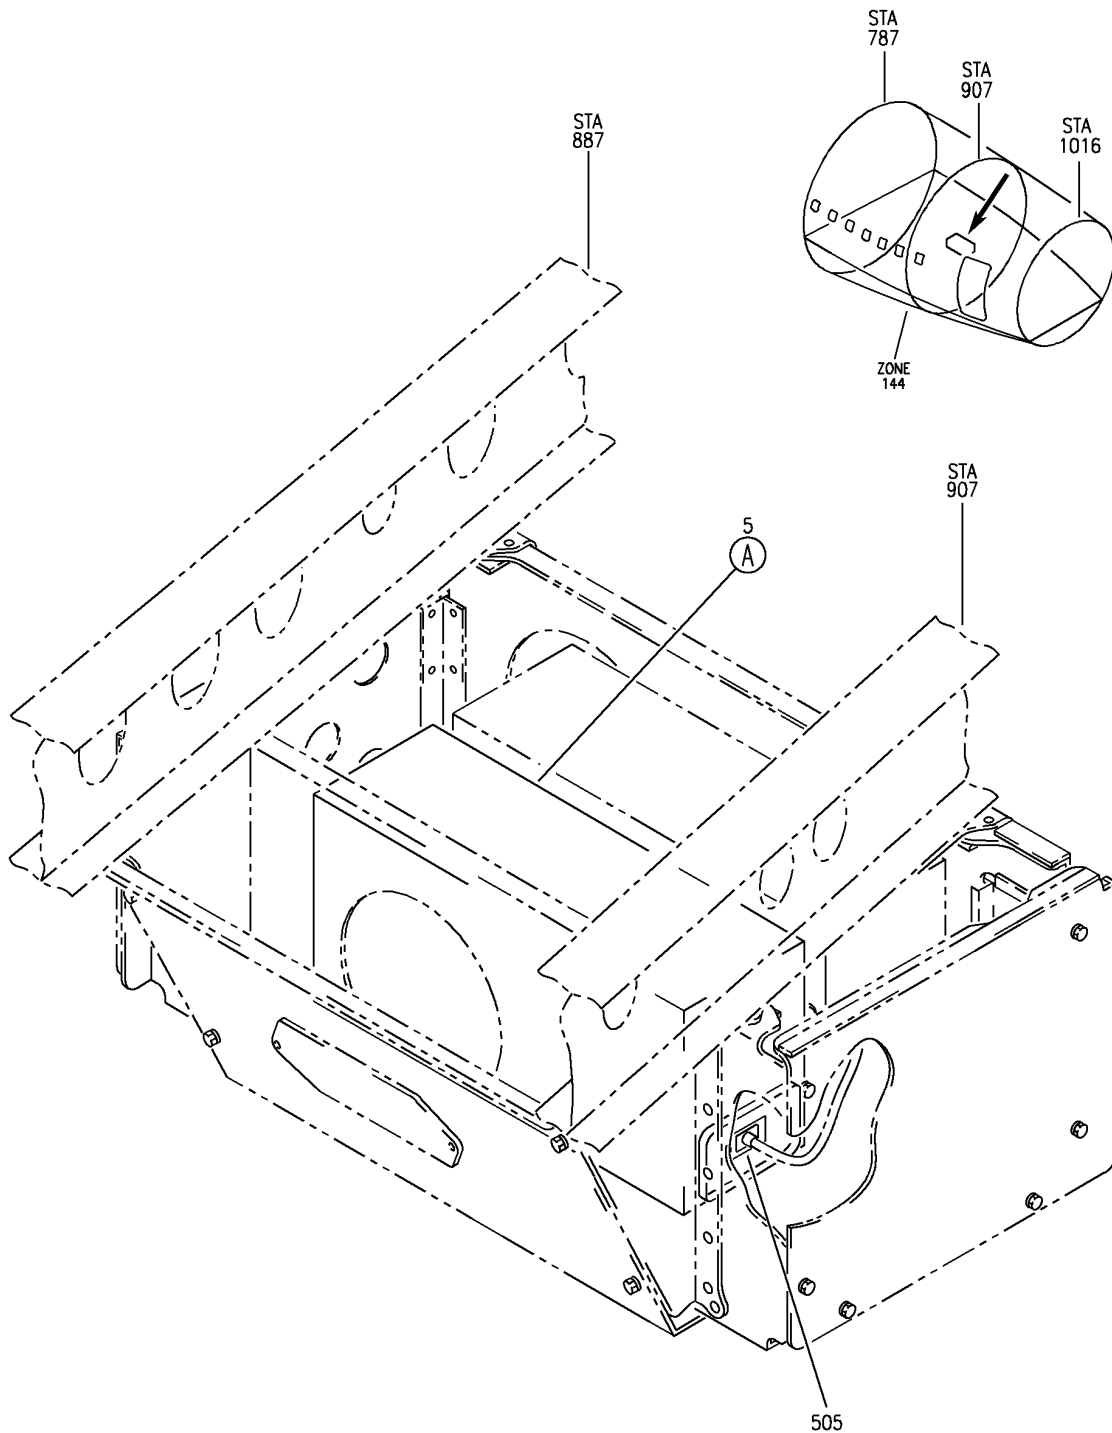

E 23711103 SHT 1 REV 125


EQUIPMENT INST-CVR
FIGURE 3 (SHEET 1)

23-71-11-03

HAP
FEB 10/07

23-71-11-03
PAGE 0

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

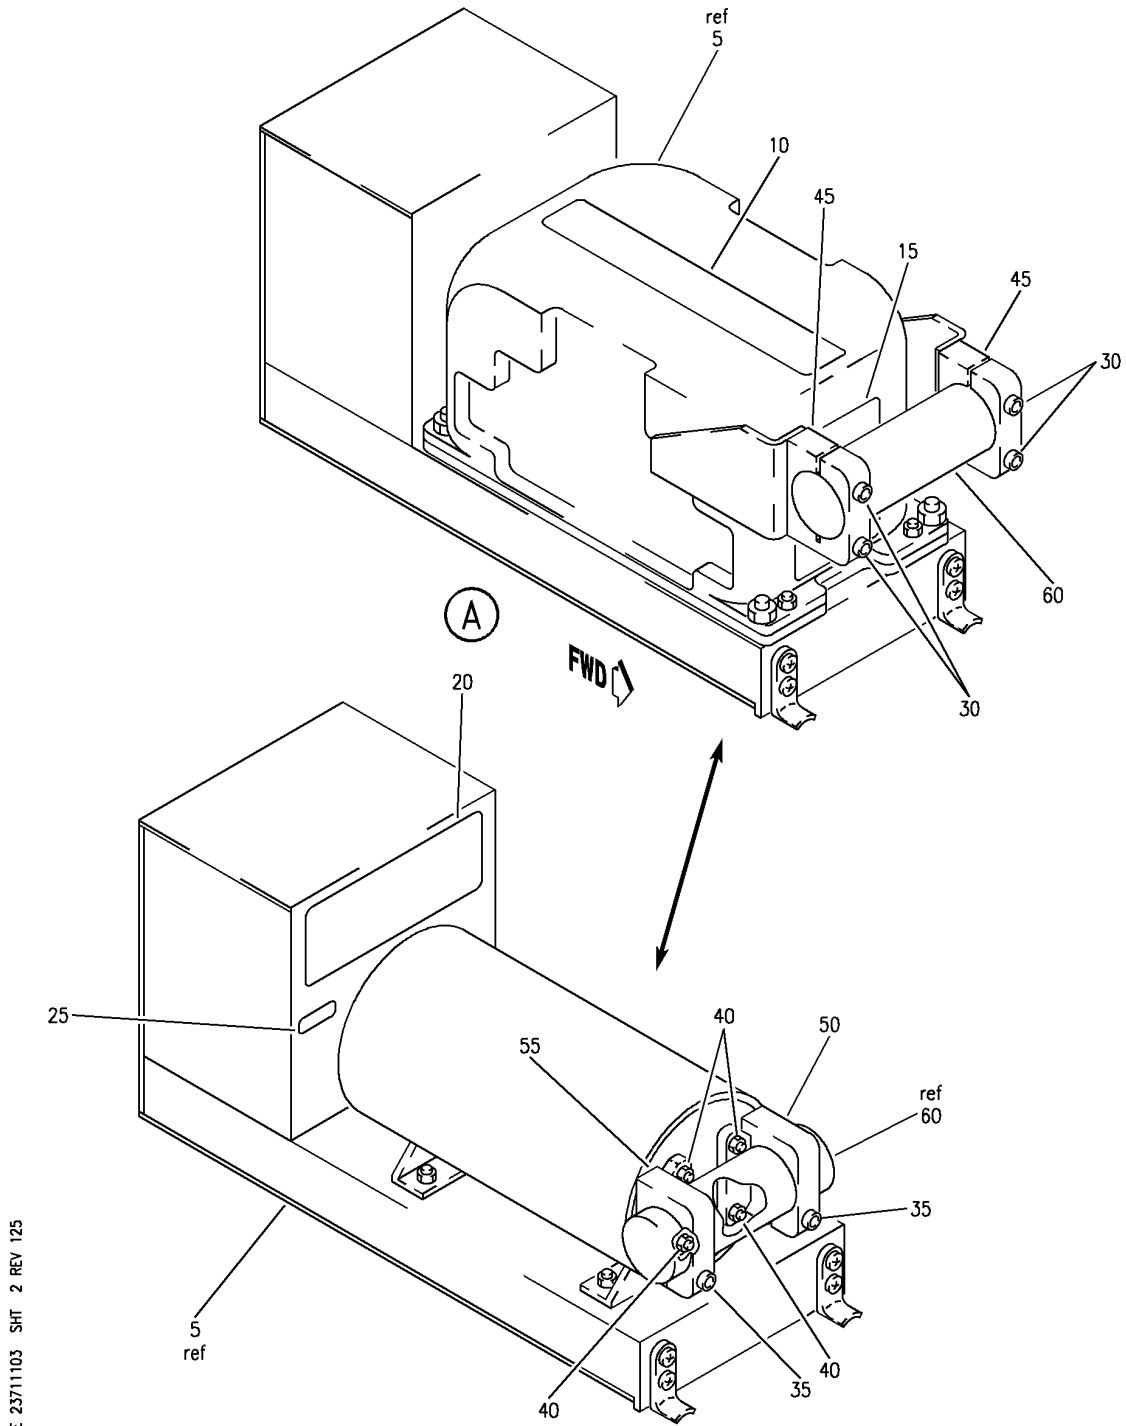

E 23711103 SHT 2 REV 125

EQUIPMENT INST-CVR
FIGURE 3 (SHEET 2)

23-71-11-03

HAP
FEB 10/07

23-71-11-03
PAGE 0A

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3			EQUIPMENT INST-CVR	031200	
- 1	MODREF85780		EQUIPMENT INSTL-COCKPIT VOICE RECORDER MODULE NUMBER: 284A0462-237101 REV A POSITION DATA: AFT CARGO BAY AND E6 RACK	968999 101200 968999	1
- 1	MODREF85785		EQUIPMENT INSTL-COCKPIT VOICE RECORDER MODULE NUMBER: 284A0462-237106 REV A POSITION DATA: AFT CARGO BAY AND E6 RACK	031100	1
5	980-6022-001		.RECORDER ASSY-VOICE (COMMUNICATIONS ONLY) SUPPLIER CODE: V97896 FUNCTIONAL DESCRIPTION: RECORDS FOUR SEPARATE CHANNELS OF COCKPIT AUDIO SIMULTANEOUSLY USING SOLID-STATE MEMORY. ELECTRICAL EQUIP NUMBER: M00383 COMPONENT MAINT MANUAL REF: 23-70-44 MAINTENANCE MANUAL REF: 23-71-11 QUALIFIED I/W DATA: 980-6020-001 (30 MIN) AND 980-6022-001 (2 HOUR) RECORDERS ARE INTERCHANGEABLE PER CUSTOMER REQUIREMENTS. FUNCTIONAL REFERENCE: PLACARDS AND MARKINGS FOR DETAILS SEE 11-36-01-79A	031200 968999	1
10	402-6061-003		..LABEL-PATENT SUPPLIER CODE: V97896	031200 968999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-71-11-03

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-11
 FIG. 03
 PAGE 1
 OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3					
15	643-0726-001	..	LABEL-IDENT SUPPLIER CODE: V97896 CONFIG CHG DATA FROM A CMM: SUPSD BY 643-0726-002	031200 968999	1
15	643-0726-002	..	LABEL-IDENT SUPPLIER CODE: V97896 CONFIG CHG DATA FROM A CMM: SUPERSEDES 643-0726-001	031200 968999	1
20	643-0726-003	..	LABEL-IDENT SUPPLIER CODE: V97896 CONFIG CHG DATA FROM A CMM: SUPSD BY 620-1856-002	031200 968999	1
20	620-1856-002	..	LABEL-IDENT SUPPLIER CODE: V97896 CONFIG CHG DATA FROM A CMM: SUPERSEDES 643-0726-003	031200 968999	1
25	620-1845-023	..	LABEL-IDENT SUPPLIER CODE: V97896 ATTACHING PARTS	031200 968999	1
30	NAS1352C08-20	..	SCREW- CONFIG CHG DATA FROM A CMM: SUPSD BY PL54U82J20 -----*-----	031200 968999	4
30	PL54U82J20	..	SCREW- SUPPLIER CODE: V03038 CONFIG CHG DATA FROM A CMM: SUPERSEDES NAS1352C08-20 OPTIONAL PART: PAT63234SS1 V51506	031200 968999	4
30	PAT63234SS1	..	SCREW- SUPPLIER CODE: V51506 OPTIONAL PART: PL54U82J20 V03038	031200 968999	4
35	PAT63220SS1	..	SCREW-SOCKET CAP SUPPLIER CODE: V51506	031200 968999	2
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-71-11-03

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-11
 FIG. 03
 PAGE 2
 OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3					
40	PAT63216SS1	..	SCREW-SOCKET CAP SUPPLIER CODE: V51506 OPTIONAL PART: PL54U82J6 V03038	031200 968999	4
40	PL54U82J6	..	SCREW-SOCKET CAP SUPPLIER CODE: V03038 OPTIONAL PART: PAT63216SS1 V51506	031200 968999	4
45	654-0146-001	..	MOUNT-BEACON SUPPLIER CODE: V97896	031200 968999	2
50	625-1132-006	..	SUPPORT-ULB SUPPLIER CODE: V97896	031200 968999	1
55	625-1132-005	..	SUPPORT-ULB SUPPLIER CODE: V97896	031200 968999	1
60	DK100	..	BEACON-UNDERWATER LOCATOR SUPPLIER CODE: V94970 MAINTENANCE MANUAL REF: 23-71-21 OPTIONAL PART: DK120 V94970 ELP362D V4U270 ELP362DS V4U270	031200 968999	1
60	ELP362D	..	BEACON-UNDERWATER LOCATOR SUPPLIER CODE: V4U270 COMPONENT MAINT MANUAL REF: 31-35-40 MAINTENANCE MANUAL REF: 23-71-21 OPTIONAL PART: DK100 V94970 DK120 V94970 ELP362DS V4U270	031200 968999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-71-11-03

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-11
 FIG. 03
 PAGE 3
 OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3					
60	DK120		..BEACON-UNDERWATER LOCATOR SUPPLIER CODE: V94970 MAINTENANCE MANUAL REF: 23-71-21 OPTIONAL PART: DK100 V94970 ELP362DS V4U270 ELP362D V4U270	031200 968999	1
60	ELP362DS		..BEACON-UNDERWATER LOCATOR SUPPLIER CODE: V4U270 MAINTENANCE MANUAL REF: 23-71-21 OPTIONAL PART: DK100 V94970 DK120 V94970 ELP362D V4U270	031200 968999	1
- 500	286A5431-012		WIRE BUNDLE ASSY	031045 054100	RF
- 500	286A5431-025		WIRE BUNDLE ASSY	101103 968971	RF
505	BCREF2215		.PLUG- OVERLENGTH PART NUMBER: DPXBMB57-33S0001 ELECTRICAL EQUIP NUMBER: D00177 WIRING DIAGRAM REF: 237101	031045 054103 968971	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-71-11-03

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-11
 FIG. 03
 PAGE 4
 FEB 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

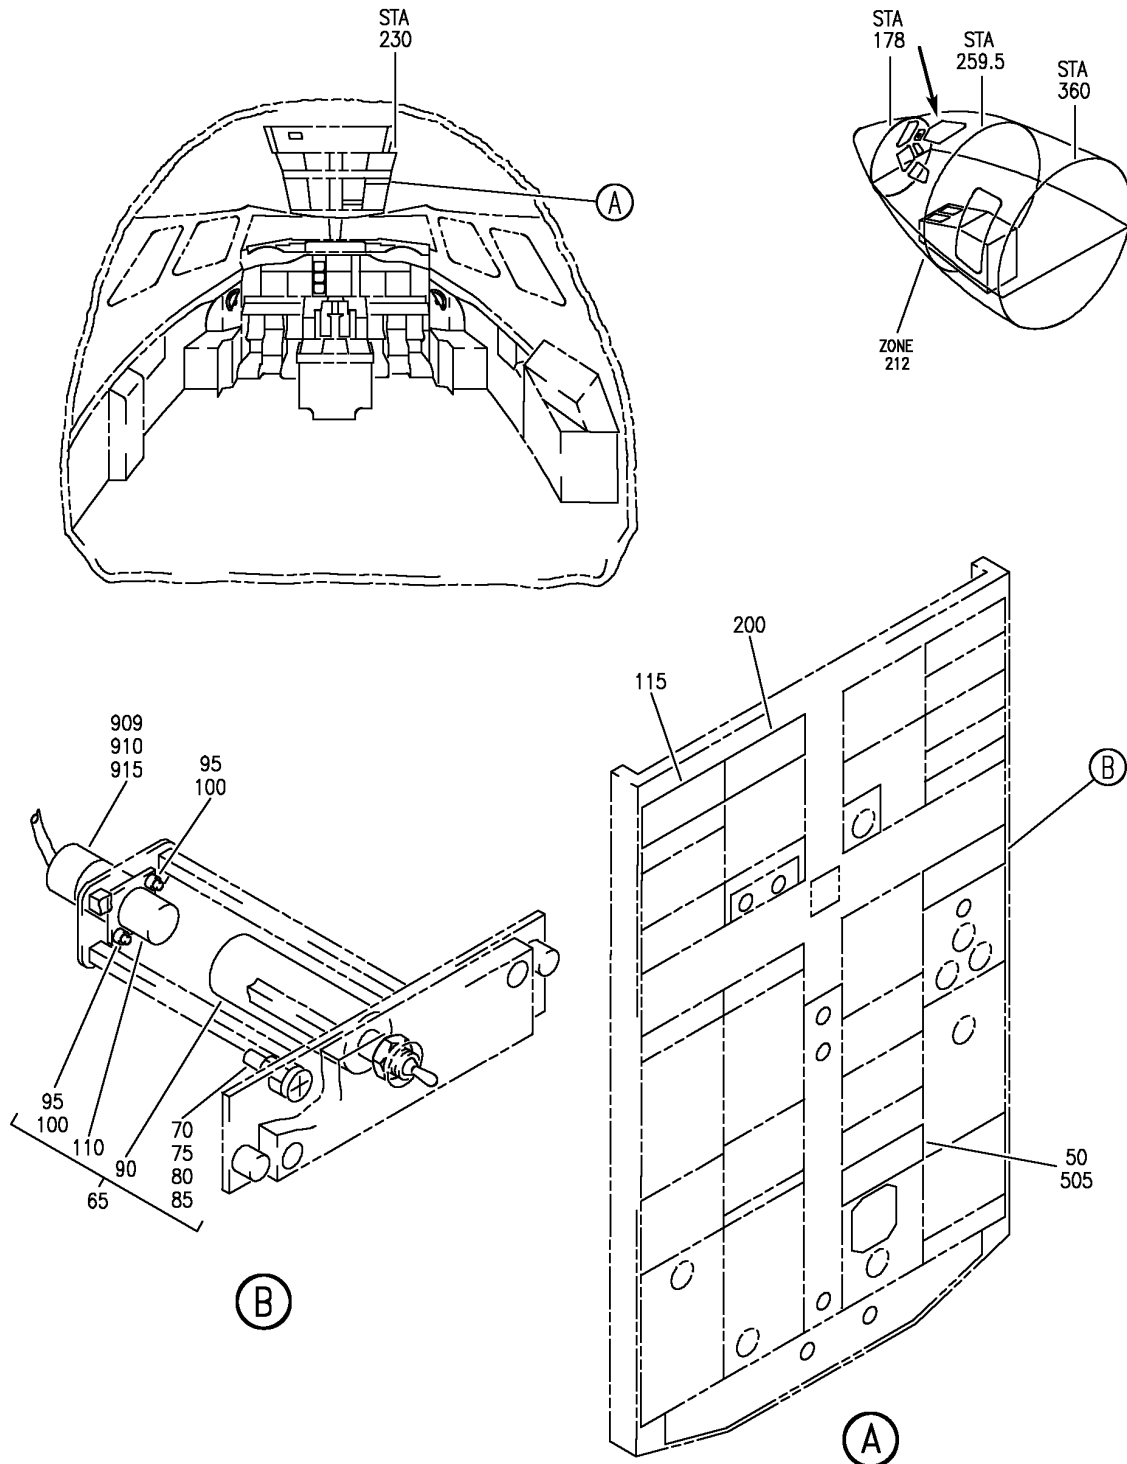

E 23711201 REV 154

MODULE INSTL-P5 OVHD (VOICE RECORDER CONTROL PANEL ONLY)

FIGURE 1

23-71-12-01

HAP
JUN 15/09

23-71-12-01
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			MODULE INSTL-P5 OVHD (VOICE RECORDER CONTROL PANEL ONLY)	001028 201967	
- 1	233A3101-4		MODULE INSTL-P5 OVHD (VOICE RECORDER CONTROL PANEL ONLY) FOR NHA/OTHER SYS DET SEE: 31-11-00-01C	001005	RF
- 4	233A3101-52		MODULE INSTL-P5 OVHD (VOICE RECORDER CONTROL PANEL ONLY) FOR NHA/OTHER SYS DET SEE: 31-11-00-01C	006007	RF
- 4	233A3101-63		MODULE INSTL-P5 OVHD (VOICE RECORDER CONTROL PANEL ONLY) FOR NHA/OTHER SYS DET SEE: 31-11-00-01C	008011	RF
- 5	233A3101-74		MODULE INSTL-P5 OVHD (VOICE RECORDER CONTROL PANEL ONLY) FOR NHA/OTHER SYS DET SEE: 31-11-00-01J	201967	RF
- 7	233A3101-110		MODULE INSTL-P5 OVHD (VOICE RECORDER CONTROL PANEL ONLY) FOR NHA/OTHER SYS DET SEE: 31-11-00-01C	012016	RF
- 14	233A3101-225		MODULE INSTL-P5 OVHD (VOICE RECORDER CONTROL PANEL ONLY) FOR NHA/OTHER SYS DET SEE: 31-11-00-01C	017019	RF
- 14	233A3101-234		MODULE INSTL-P5 OVHD (VOICE RECORDER CONTROL PANEL ONLY) FOR NHA/OTHER SYS DET SEE: 31-11-00-01C	020028	RF
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-71-12-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-12
 FIG. 01
 PAGE 1
 OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1	50 980-6116-001		.PANEL-MIC/MONITOR VOICE RECORDER P5-7 (CUSTOMER FURNISHED) SUPPLIER CODE: V97896 FUNCTIONAL DESCRIPTION: ALLOWS TESTING OF THE COCKPIT VOICE RECORDER ELECTRICAL EQUIP NUMBER: P00507 COMPONENT MAINT MANUAL REF: 23-70-43 MAINTENANCE MANUAL REF: 23-71-12 QUALIFIED I/W DATA: PANEL S152-0020-00 T/W RECORDER 2100-1010-00(30MIN) OR 2100-1020-00(2HOUR) IS INTERCHANGEABLE WITH PANEL 980-6116-001 T/W RECORDER 980-6020-001(30 MIN) OR 980-6022-001(2 HOUR).	014014	1
	50 980-6116-001		.PANEL-MIC/MONITOR VOICE RECORDER P5-7 SUPPLIER CODE: V97896 FUNCTIONAL DESCRIPTION: ALLOWS TESTING OF THE COCKPIT VOICE RECORDER ELECTRICAL EQUIP NUMBER: P00507 COMPONENT MAINT MANUAL REF: 23-70-43 MAINTENANCE MANUAL REF: 23-71-12 QUALIFIED I/W DATA: PANEL S152-0020-00 T/W RECORDER 2100-1010-00(30MIN) OR 2100-1020-00(2HOUR) IS INTERCHANGEABLE WITH PANEL 980-6116-001 T/W RECORDER 980-6020-001(30 MIN) OR 980-6022-001(2 HOUR).	001013 015028 201967	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-71-12-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-12
 FIG. 01
 PAGE 2
 OCT 15/08

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 60	233A3211-1		.MODULE ASSY-VOICE RECORDER CONT P5-88 SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: P00588 COMPONENT MAINT MANUAL REF: 23-71-02 POST SERVICE BULLETIN: 23-1107	001028 201967	RF
65	233A3211-101		..MODULE ASSY- SUPPLIER CODE: V89954	001028 201967	1
70	NAS514P1032-10		...SCREW	001028 201967	1
75	AN960D416		...WASHER	001028 201967	1
80	MS35650-305T		...NUT	001028 201967	1
85	MS21042L3		...NUT	001028 201967	1
90	25ET61S		...SWITCH-TG SUPPLIER CODE: V91929	001028 201967	1
95	MS51957-14		...SCREW	001028 201967	2
100	K19798-04		...NUT SUPPLIER CODE: V15653 SPECIFICATION NUMBER: BACN10NW1 OPTIONAL PART: RMA4812-160-40 V72962 293162 V60119	001028 201967	2
- 105	233A3211-201		...WIRE BUNDLE ASSY- SUPPLIER CODE: V89954	001028 201967	1
110	BACC45FN12-12P		CONNECTOR	001028 201967	1
R R R R R R R R	- 500	286A3329-005	WIRE BUNDLE ASSY-VOICE RECORDER CONT PNL REWORKED BY ALERT SB: 24A1141R1	001007	RF
- 500	286A3329-015		WIRE BUNDLE ASSY-VOICE RECORDER CONT PNL REWORKED BY ALERT SB: 24A1141R1	008011 201967	RF
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-71-12-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-12
FIG. 01
PAGE 3
JUN 15/09

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
R - 501	286A3329-028	WIRE BUNDLE ASSY-VOICE RECORDER CONT PNL REWORKED BY ALERT SB: 24A1141R1	012022	RF
R - 504	280A3109-11201	.TAPE-ID PLACARD CONTENT: D00179 M/W P005-07 VOICE REC PNL POST ALERT SB: 24A1141R1	001022 201967	1
R - 900	286A2112-049	WIRE BUNDLE ASSY- REWORKED BY ALERT SB: 24A1141R1	201967	RF
R - 900	286A2112-039	WIRE BUNDLE ASSY- REWORKED BY ALERT SB: 24A1141R1	008011	RF
R - 901	286A2112-056	WIRE BUNDLE ASSY- REWORKED BY SB: 23-1107 REWORKED BY ALERT SB: 24A1141R1	002005	RF
R - 901	286A2112-073	WIRE BUNDLE ASSY- REWORKED BY ALERT SB: 24A1141R1	012022	RF
R - 901	286A2112-017	WIRE BUNDLE ASSY- REWORKED BY SB: 23-1107 REWORKED BY ALERT SB: 24A1141R1	001001 006007	RF
R - 907	280A3109-15901	.TAPE-ID PLACARD CONTENT: D11125 M/W P005-88 VOICE RCDR AUTO/ON SW POST ALERT SB: 24A1141R1	001022 201967	1
R 909	BACC45FT12-12S	.CONNECTOR- ELECTRICAL EQUIP NUMBER: D11125 WIRING DIAGRAM REF: 237101 POST SERVICE BULLETIN: 23-1107	001007	1
R 910	BACC45FT16-24P6	.PLUG- ELECTRICAL EQUIP NUMBER: D40514P WIRING DIAGRAM REF: 212721 POST SERVICE BULLETIN: 23-1107	001007	1
MISSING ITEM NUMBERS NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

HAP

23-71-12-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-12
FIG. 01
PAGE 4
JUN 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

	FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
R R R R R R R R	1					
	915	MTCPQKT2P22SGBB		. PLUG-	001007	1
				SUPPLIER CODE:		
				V06090		
				ELECTRICAL EQUIP NUMBER:		
				D40518P		
				WIRING DIAGRAM REF:		
				241111		
				POST SERVICE BULLETIN:		
				23-1107		
MISSING ITEM NUMBERS NOT APPLICABLE						

— ITEM NOT ILLUSTRATED


HAP

23-71-12-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-12
 FIG. 01
 PAGE 5
 JUN 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

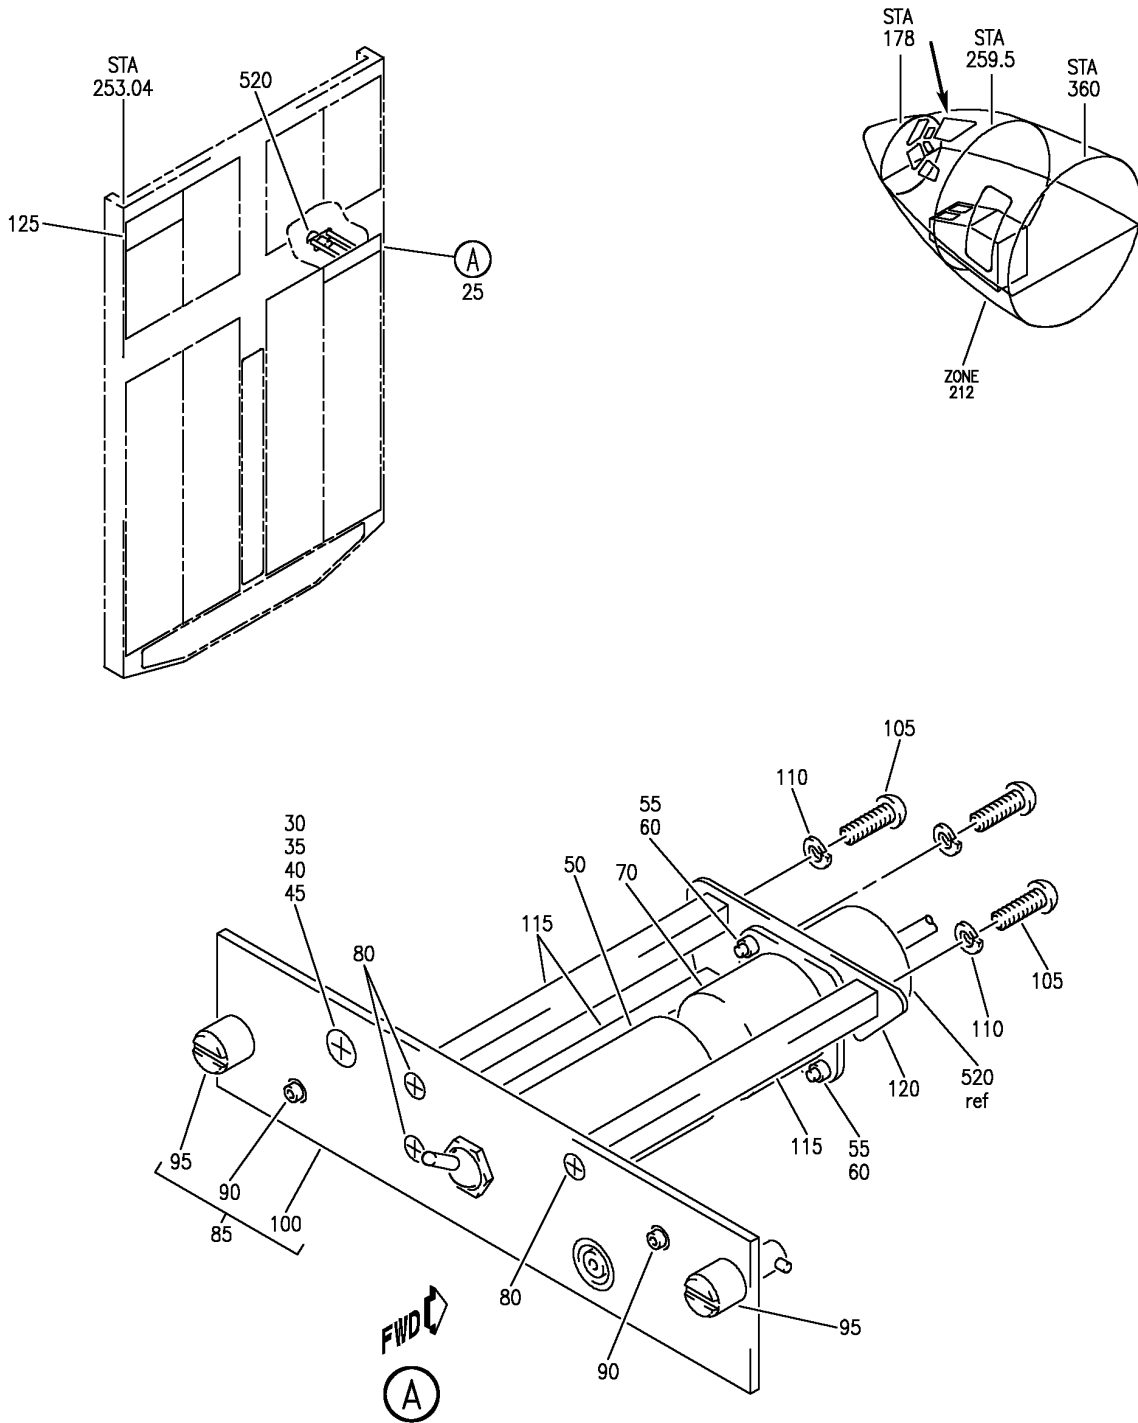

E 23711202 REV 140

MODULE INSTL-P5 OVHD (VOICE RECORDER SYSTEM ONLY)
FIGURE 2

23-71-12-02

HAP
JUN 15/08

23-71-12-02
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			MODULE INSTL-P5 OVHD (VOICE RECORDER SYSTEM ONLY)	029200 968999	
- 1	233A3104-115		MODULE INSTL-P5 OVHD (VOICE RECORDER SYSTEM ONLY)	029030	RF
- 3	MODREF101057		FOR NHA/OTHER SYS DET SEE: 31-11-00-01C MODULE INSTL-P5 OVHD (VOICE RECORDER SYSTEM ONLY)	031036 038038	1
- 4	MODREF321087		MODULE NUMBER: 233A3104-115 REV B FOR OTHER SYS DETAILS SEE: 23-24-00-03 23-32-03-93 31-11-94-12 31-11-95-14 33-11-52-13 MODULE INSTL-P5 OVHD (VOICE RECORDER SYSTEM ONLY)	037037 039200 968999	1
- 20	233A3211-1		MODULE ASSY-LOICE RECORDER CONT SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: P00588 COMPONENT MAINT MANUAL REF: 23-71-02	029200 968999	RF
25	233A3211-101		..MODULE ASSY- SUPPLIER CODE: V89954	029200 968999	1
30	NAS514P1032-10		...SCREW	029200 968999	1
35	AN960D416		...WASHER	029200 968999	1
40	MS35650-305T		...NUT	029200 968999	1
45	MS21042L3		...NUT	029200 968999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-71-12-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-12
FIG. 02
PAGE 1
JUN 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2					
50	25ET61S	...	SWITCH-TG SUPPLIER CODE: V91929	029200 968999	1
55	MS51957-14	...	SCREW	029200 968999	2
60	K19798-04	...	NUT SUPPLIER CODE: V15653 SPECIFICATION NUMBER: BACN10NW1 OPTIONAL PART: RMA4812-160-40 V72962 293162 V60119	029200 968999	2
- 65	233A3211-201	...	WIRE BUNDLE ASSY- SUPPLIER CODE: V89954	029200 968999	1
70	BACC45FN12-12P		CONNECTOR	029200 968999	1
80	FH6C6CPL10GY	...	SCREW- SUPPLIER CODE: V12324	029200 968999	3
85	233A3211-401	...	BASEPLATE ASSY- SUPPLIER CODE: V89954	029200 968999	1
90	SF6G6CBB5D		NUT-PRESS SUPPLIER CODE: V12324	029200 968999	2
95	BACS21DX1D		STUD ASSY	029200 968999	2
100	233A3211-402		BASEPLATE- SUPPLIER CODE: V89954	029200 968999	1
105	MS51957-27	...	SCREW	029200 968999	3
110	MS35338-136	...	WASHER	029200 968999	3
115	69B46200-11	...	STANDOFF	029200 968999	3
120	233A3211-403	...	BRACKET-SPRT SUPPLIER CODE: V89954	029200 968999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-71-12-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-12
 FIG. 02
 PAGE 2
 JUN 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

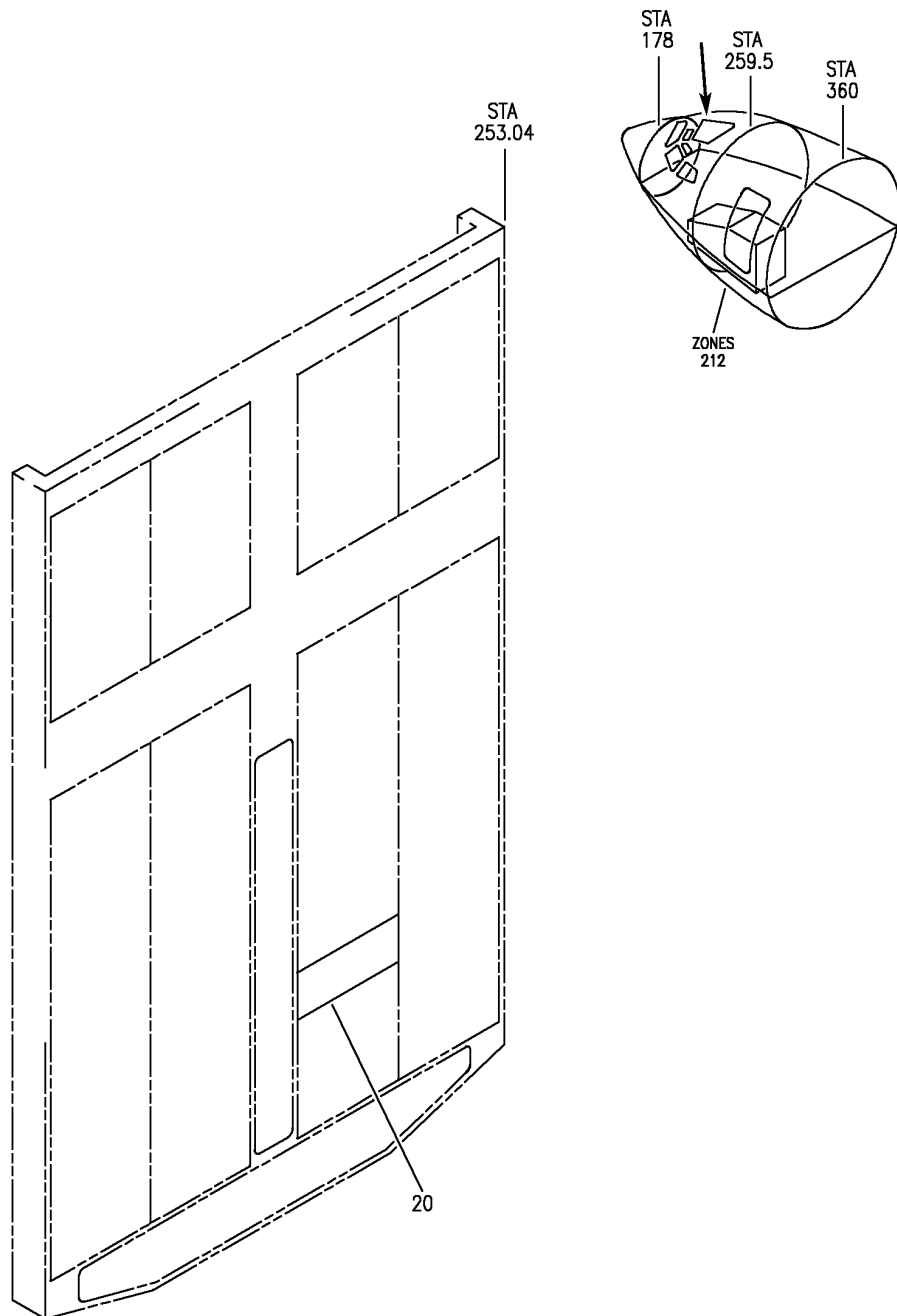

E 23711203 REV 150

MODULE INSTL-P5 OVHD (COMMUNICATIONS ONLY)

FIGURE 3

23-71-12-03

HAP
FEB 15/09

23-71-12-03
PAGE 0

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
3			MODULE INSTL-P5 OVHD (COMMUNICATIONS ONLY)	029200 968999	R F
- 1	233A3104-237103		MODULE INSTL-P5-7 OVHD (COMMUNICATIONS ONLY) FOR NHA/OTHER SYS DET SEE: 31-11-00-01C	029030	
- 1	MODREF101042		MODULE INSTL-P5-7 OVHD (COMMUNICATIONS ONLY) MODULE NUMBER: 233A3104-237103 REV B FOR OTHER SYS DETAILS SEE: 31-11-94-12	031036 038038	1
- 1	MODREF319454		MODULE INSTL-P5-7 OVHD (COMMUNICATIONS ONLY) MODULE NUMBER: 233A3104-237103 REV C FOR OTHER SYS DETAILS SEE: 31-11-94-04X 31-11-94-07Q	037037 039043 101101 968971	1
- 1	MODREF356904		MODULE INSTL-P5-7 OVHD (COMMUNICATIONS ONLY) MODULE NUMBER: 233A3104-237103 REV D FOR OTHER SYS DETAILS SEE: 31-11-94-04X 31-11-94-07Q	044100 102200 972999	1
20	980-6116-001		.PANEL-MIC/MONITOR VOICE RECORDER SUPPLIER CODE: V97896 FUNCTIONAL DESCRIPTION: ALLOWS TESTING OF THE COCKPIT VOICE RECORDER ELECTRICAL EQUIP NUMBER: P00507 COMPONENT MAINT MANUAL REF: 23-70-43 MAINTENANCE MANUAL REF: 23-71-12 QUALIFIED I/W DATA: PANEL S152-0020-00 T/W RECORDER 2100-1010-00(30MIN) OR 2100-1020-00(2HOUR) IS INTERCHANGEABLE WITH PANEL 980-6116-001 T/W RECORDER 980-6020-001(30 MIN) OR 980-6022-001(2 HOUR).	029200 968999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HAP

23-71-12-03

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-12
FIG. 03
PAGE 1
JUN 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

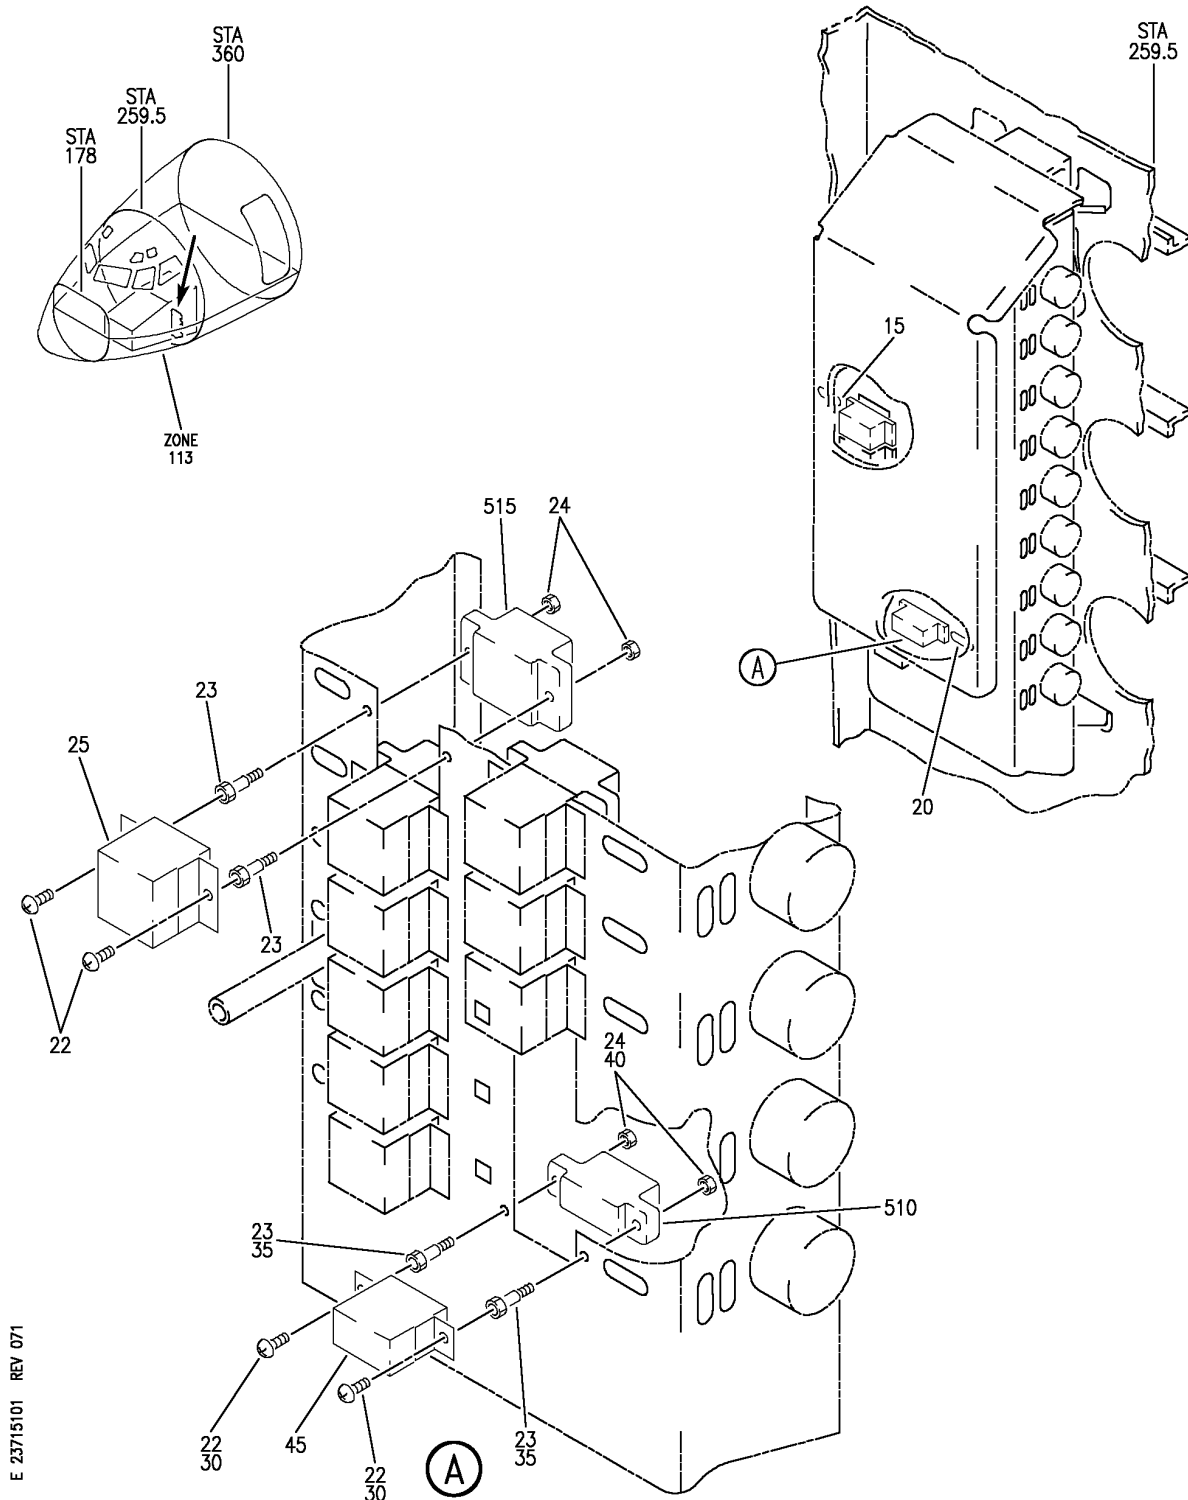

E 23715101 REV 071

JUNCTION BOX INSTL AND ASSY-J22 (VOICE RECORDER SYSTEM ONLY)
FIGURE 1

23-71-51-01

HAP
OCT 10/06

23-71-51-01
PAGE 0

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			JUNCTION BOX INSTL AND ASSY-J22 (VOICE RECORDER SYSTEM ONLY)		
- 1	284A1222-115		JUNCTION BOX INSTL-J22 (VOICE RECORDER SYSTEM ONLY) FOR NHA/OTHER SYS DET SEE: 25-50-00-12	201967	RF
- 1	284A1222-118		JUNCTION BOX INSTL-J22 (VOICE RECORDER SYSTEM ONLY) FOR NHA/OTHER SYS DET SEE: 25-50-00-13	008030	RF
- 1	284A1222-3		JUNCTION BOX ASSY-J22 (VOICE RECORDER SYSTEM ONLY) PRE SERVICE BULLETIN: 23-1107 FOR NHA/OTHER SYS DET SEE: 25-50-51-76	006007	RF
- 2	284A1222-118		JUNCTION BOX INSTL-J22 (VOICE RECORDER SYSTEM ONLY) POST SERVICE BULLETIN: 23-1107 FOR NHA/OTHER SYS DET SEE: 25-50-51-76	005007	RF
- 5	284A1222-17		JUNCTION BOX ASSY-J22 (VOICE RECORDER SYSTEM ONLY) REWORKED BY SB: 23-1107 FOR NHA/OTHER SYS DET SEE: 25-50-51-76	001004	RF
- 5	284A1222-18		JUNCTION BOX ASSY-J22 (VOICE RECORDER SYSTEM ONLY) PRE SERVICE BULLETIN: 23-1107 FOR NHA/OTHER SYS DET SEE: 25-50-51-76	005005	RF
- 5	MODREF184893		JUNCTION BOX INSTL-J22 MODULE NUMBER: 284A1222-203 REV B	031200 968999	1
25	TDH8127-3003		.SWITCH- SUPPLIER CODE: V58657 ELECTRICAL EQUIP NUMBER: R00779		1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HAP

23-71-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-51
FIG. 01
PAGE 1
OCT 15/08

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
45	ES210-1632		.RELAY- SUPPLIER CODE: V99699 SPECIFICATION NUMBER: BACR13CF2AB OPTIONAL PART: JD4L018 V35344 JD4L031 V35344 BR246S0111 V56623 BR64S105 V56623 FCA210-71 V78290 61GB2319-1A320 V98927 ELECTRICAL EQUIP NUMBER: R00780	008999	1
- 500	286A0076-031		WIRE BUNDLE ASSY-	201967	RF
- 500	286A0076-332		WIRE BUNDLE ASSY-	008011	RF
- 501	286A0076-355		WIRE BUNDLE ASSY-	012030	RF
- 502	286A0076-303		WIRE BUNDLE ASSY	002004	RF
- 502	286A0076-306		WIRE BUNDLE ASSY	001001	RF
- 502	286A0076-310		WIRE BUNDLE ASSY	005005	RF
- 502	286A0076-312		WIRE BUNDLE ASSY	006007	RF
- 506	286A0076-125		WIRE BUNDLE ASSY-	031047	RF
				054106	
				968999	
510	RSF116202		.SOCKET-RELAY SUPPLIER CODE: V58982 SPECIFICATION NUMBER: BACS16X4A OPTIONAL PART: 102-006-2 V09922 000300-1648 V05574 ELECTRICAL EQUIP NUMBER: D11131 WIRING DIAGRAM REF: 237101	001047 054106 201999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HAP

23-71-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-51
 FIG. 01
 PAGE 2
 FEB 15/09

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 515	RSF116416		. SOCKET-RELAY SUPPLIER CODE: V58982 SPECIFICATION NUMBER: BACS16W5A OPTIONAL PART: 102-010-1 V09922 000300-1545 V05574 ELECTRICAL EQUIP NUMBER: D11073 WIRING DIAGRAM REF: 237101	001047 054106 201999	1
MISSING ITEM NUMBERS NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HAP

23-71-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-51
 FIG. 01
 PAGE 3
 FEB 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

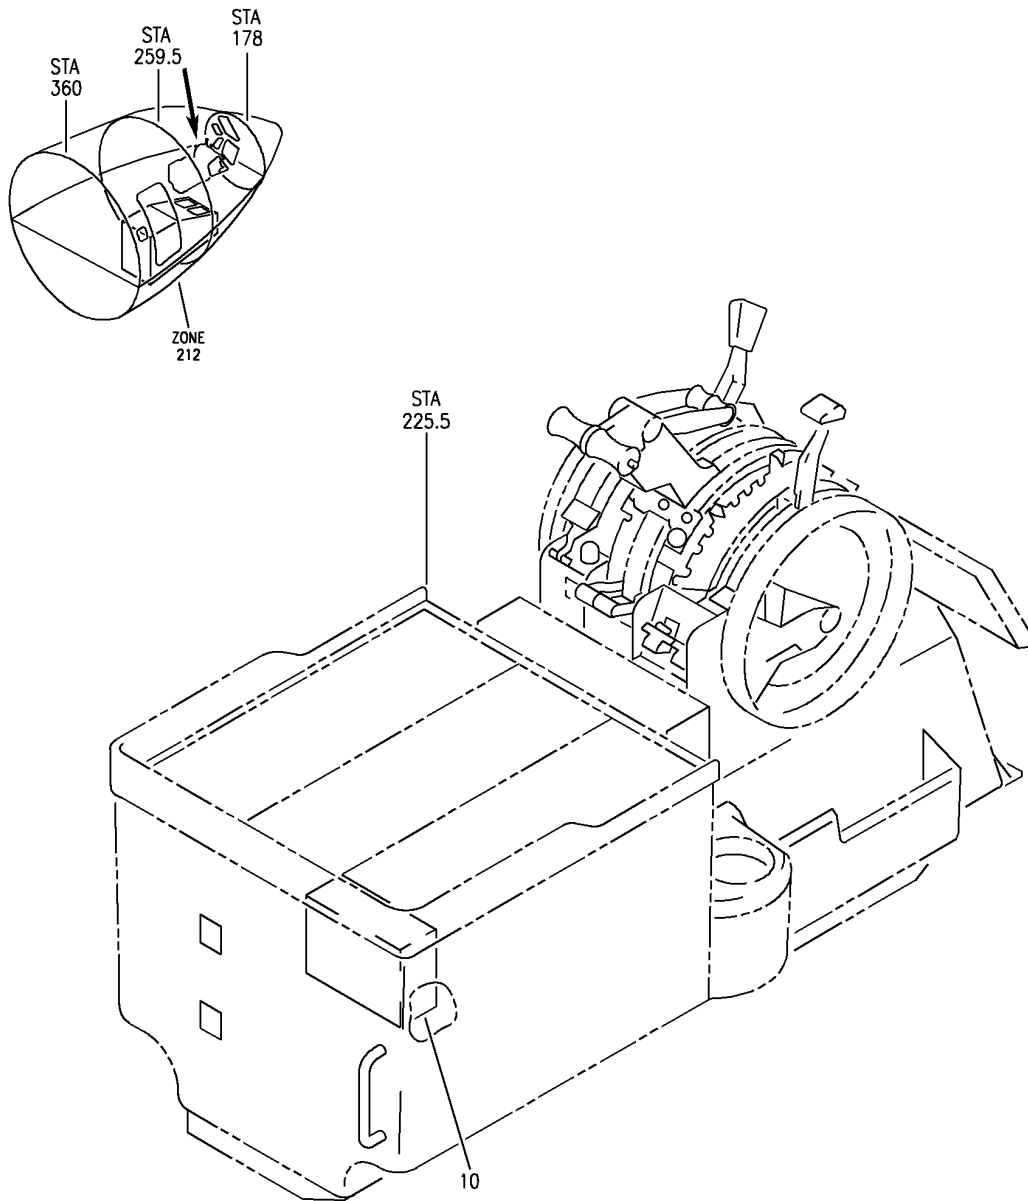

E 23715201 REV 137

MODULE INSTL-P8 AISLE STAND CAMERA SELECT PNL (COMMUNICATIONS ONLY)

FIGURE 1

23-71-52-01

HAP
FEB 15/08

23-71-52-01
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

 BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
R R	1		MODULE INSTL-P8 AISLE STAND CAMERA SELECT PNL (COMMUNICATIONS ONLY)	037040 042046 048048 051053 101106 968999	
	- 1	MODREF322830	MODULE INSTL-P8 AISLE STAND CAMERA SELECT PNL (COMMUNICATIONS ONLY) MODULE NUMBER: 233A6104-237002 REV B FOR OTHER SYS DETAILS SEE: 31-11-91-82S	037040 042046 048048 051053 101106 968999	1
	10	FV1070-11	.PANEL- SUPPLIER CODE: VKD369 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT WHICH CAMERA VIDEO SIGNAL WILL BE DISPLAYED AMONG MULTIPLE CAMERAS ELECTRICAL EQUIP NUMBER: M03000 MAINTENANCE MANUAL REF: 23-75-03	037040 042046 048048 051053 101106 968999	1

MISSING ITEM NUMBERS NOT APPLICABLE

- ITEM NOT ILLUSTRATED



HAP

23-71-52-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-52
FIG. 01
PAGE 1
JUN 15/09

BOEING
737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

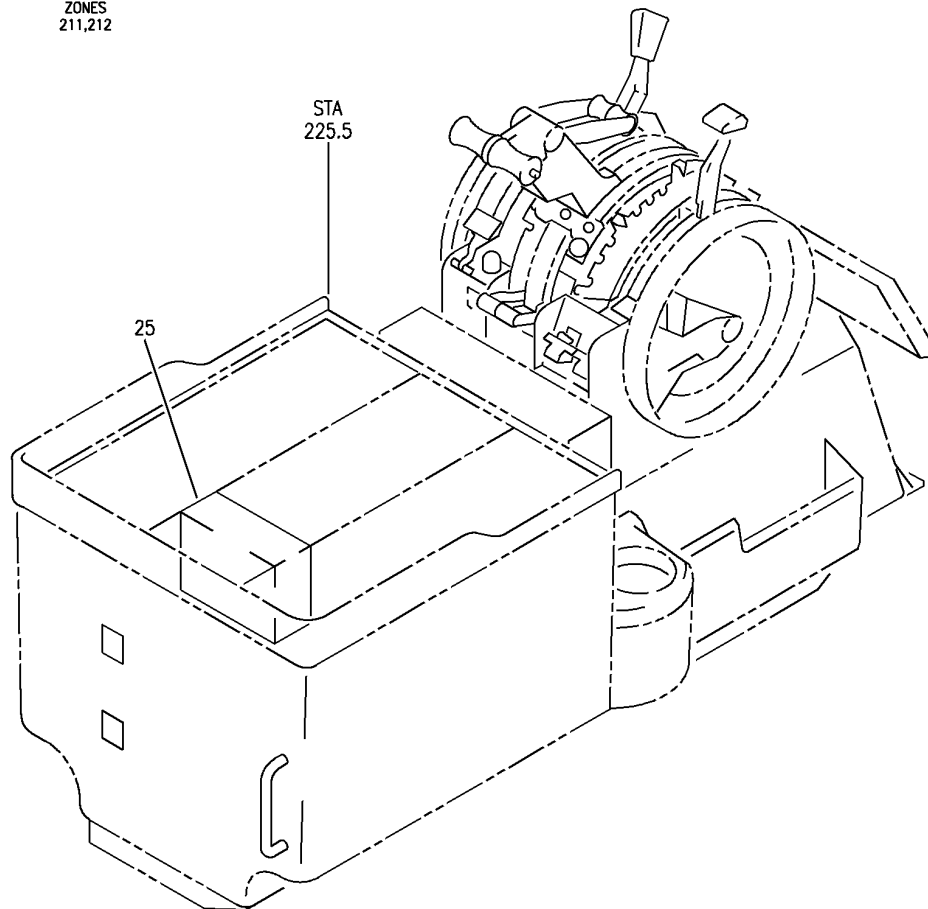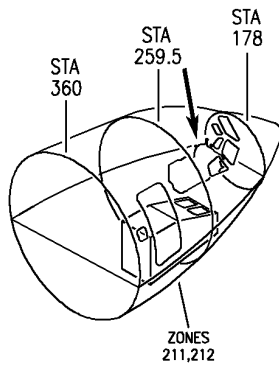

E 23715201A REV 126

MODULE INSTL-P8 AISLE STAND CAMERA SELECT PNL (COMMUNICATIONS ONLY)
FIGURE 1A

HAP
JUN 10/07

23-71-52-01A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-52-01A
PAGE 0

BOEING
 737-600/700/800/900
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
R R R R R R R R R R R R R R R R	1 A		MODULE INSTL-P8 AISLE STAND CAMERA SELECT PNL (COMMUNICATIONS ONLY)	041041 047047 049050 054100 107200	
	- 1	MODREF322830	MODULE INSTL-P8 AISLE STAND CAMERA SELECT PNL (COMMUNICATIONS ONLY) MODULE NUMBER: 233A6104-237002 REV B FOR OTHER SYS DETAILS SEE: 31-11-91-83M	041041 047047 049050 054100 107200	1
	25	FV1070-11	.PANEL- SUPPLIER CODE: VKD369 FUNCTIONAL DESCRIPTION: ALLOWS THE FLIGHT CREW TO SELECT WHICH CAMERA VIDEO SIGNAL WILL BE DISPLAYED AMONG MULTIPLE CAMERAS ELECTRICAL EQUIP NUMBER: M03000 POST RAPID REVISION: RR97237-28B	041041 047047 049050 054100 107200	1

MISSING ITEM NUMBERS NOT APPLICABLE

- ITEM NOT ILLUSTRATED

HAP

23-71-52-01A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

23-71-52
FIG. 01A
PAGE 1
JUN 15/09