
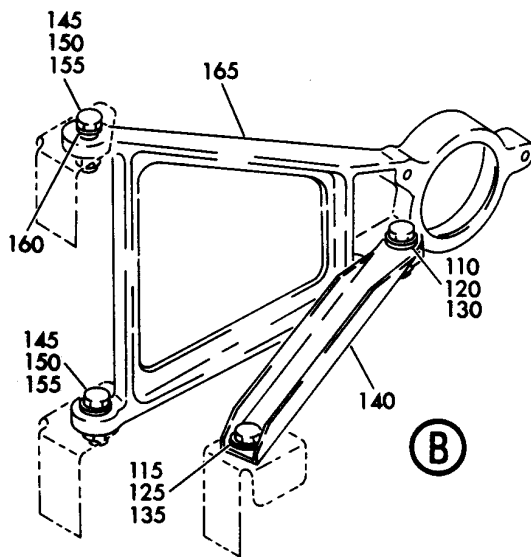
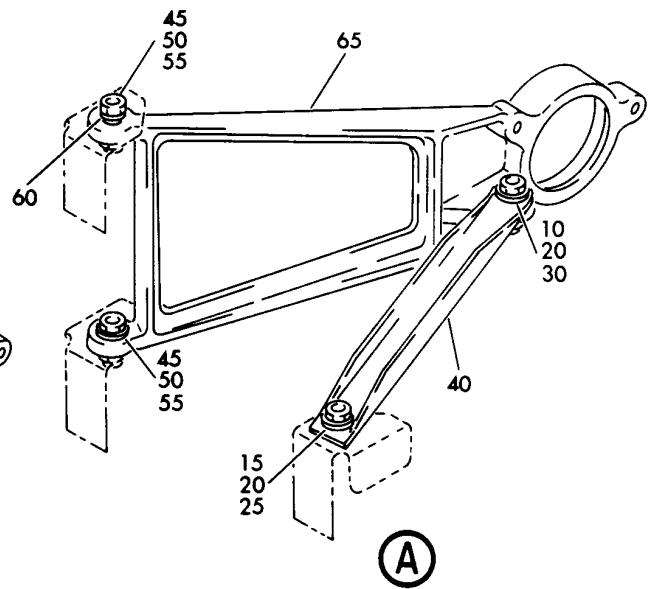
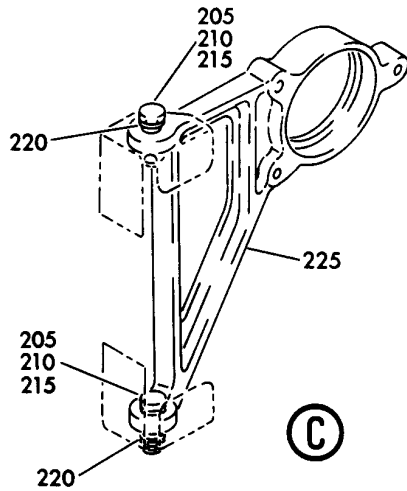
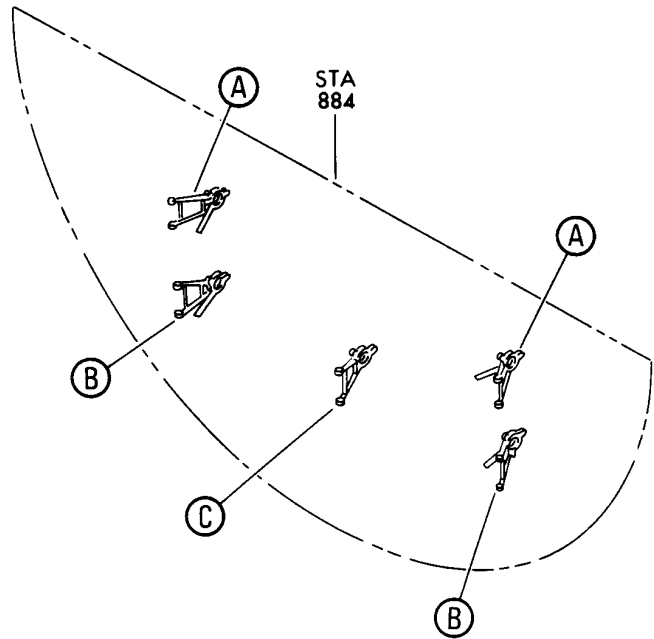


LEADING EDGE SLATS

BOEING
767
PARTS CATALOG (MAINTENANCE)

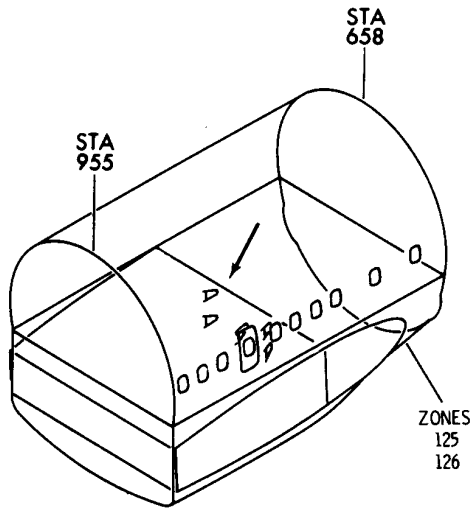

V 57430101 SHT 1 REV 005

SUPPORT INSTL-BODY LE SLAT DRIVE BRG
FIGURE 1

57-43-01-01

HXL
DEC 22/06

57-43-01-01
PAGE 0

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			SUPPORT INSTL-BODY LE SLAT DRIVE BRG		
- 1	256T2440-1		SUPPORT INSTL-BODY LE SLAT DRIVE BRG POSITION DATA: LH FOR NHA SEE: 27-81-42-05		RF
- 5	256T2440-2		SUPPORT INSTL-BODY LE SLAT DRIVE BRG POSITION DATA: RH FOR NHA SEE: 27-81-42-05		RF
10	BACB30NM3K4		.BOLT		1
15	BACB30NR4K2		.BOLT		1
20	AN960PD10		.WASHER		1
25	AN960PD416		.WASHER		1
30	BRH10A3		.NUT		1
			SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC3 OPTIONAL PART: H10-3BAC V15653 NS202101-02 V80539 RMLH9075-3W V72962 VN303A02 V92215 96-02 V80539 T6S1032J V11815		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-43-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-43-01
 FIG. 01
 PAGE 1
 DEC 22/06

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
35	BRH10A4		.NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653		1
40	256T2434-1		.CHANNEL		1
45	BACB30NR4K7		.BOLT		2
50	AN960PD416		.WASHER		4
55	BRH10A4		.NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653		2
60	BACB28AK04-014		.BUSHING		1
65	256T2431-1		.BRACKET- POSITION DATA: LH SIDE		1
- 70	256T2431-2		.BRACKET- POSITION DATA: RH SIDE		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-43-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-43-01
 FIG. 01
 PAGE 2
 DEC 22/06

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 100	256T2440-3		SUPPORT INSTL-BODY LE SLAT DRIVE BRG POSITION DATA: LH FOR NHA SEE: 27-81-42-05		RF
- 105	256T2440-4		SUPPORT INSTL-BODY LE SLAT DRIVE BRG POSITION DATA: RH FOR NHA SEE: 27-81-42-05		RF
110	BACB30NM3K4		.BOLT		1
115	BACB30NR4K2		.BOLT		1
120	AN960PD10		.WASHER		1
125	AN960PD416		.WASHER		1
130	BRH10A3		.NUT		1
			SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC3 OPTIONAL PART: H10-3BAC V15653 NS202101-02 V80539 RMLH9075-3W V72962 VN303A02 V92215 96-02 V80539 T6S1032J V11815		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-43-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-43-01
 FIG. 01
 PAGE 3
 DEC 22/06



767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 135	BRH10A4	.NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653		1
140	256T2434-3	.CHANNEL-		1
145	BACB30NR4K7	.BOLT		2
150	AN960PD416	.WASHER		4
155	BRH10A4	.NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653		2
160	BACB28AK04-014	.BUSHING		1
165	256T2432-1	.BRACKET		1
- 200	256T2440-5	SUPPORT INSTL-BODY LE SLAT DRIVE BRG FOR NHA SEE: 27-81-42-05		R F
205	BACB30NR4K7	.BOLT		2
210	AN960PD416	.WASHER		4
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

- ITEM NOT ILLUSTRATED

HXL

57-43-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-43-01
FIG. 01
PAGE 4
DEC 22/06



767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 215	BRH10A4		.NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653		2
220	BACB28AK04-014		.BUSHING		2
225	256T2432-1		.BRACKET		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HXL

57-43-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-43-01
FIG. 01
PAGE 5
DEC 22/06

BOEING
767
PARTS CATALOG (MAINTENANCE)

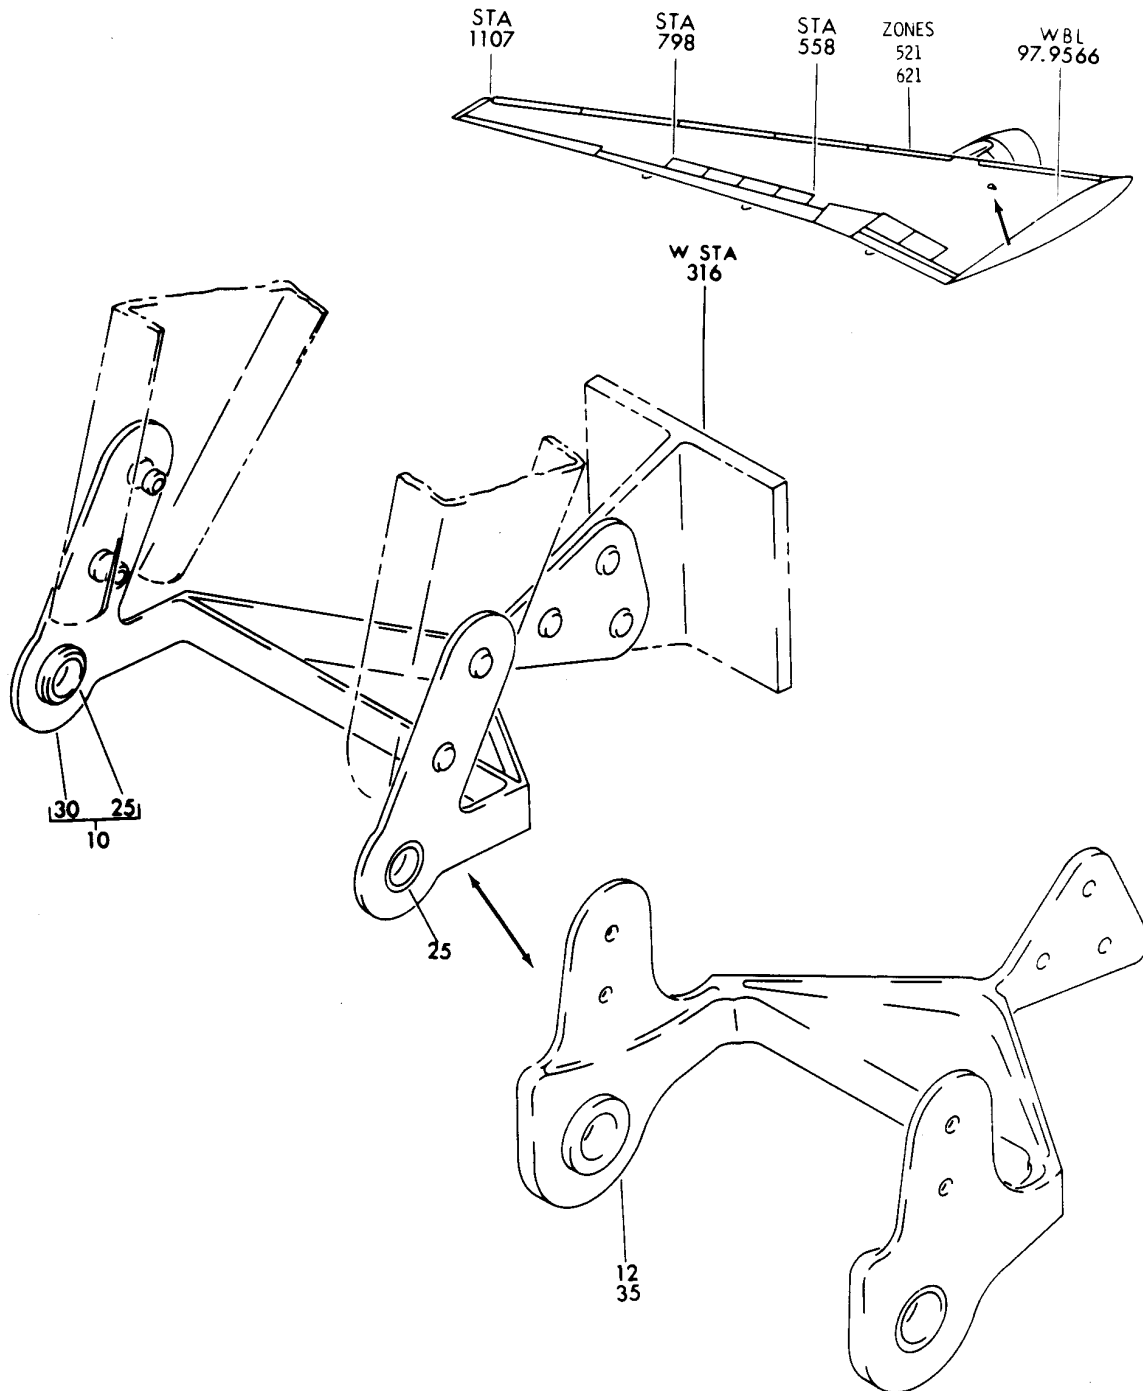

V 57435301 SHT 1 REV 014

SUPPORT INSTL-ISS 316.232 AUX TRACK AFT
FIGURE 1

57-43-53-01

HXL
DEC 22/06

57-43-53-01
PAGE 0

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			SUPPORT INSTL-ISS 316.232 AUX TRACK AFT		
- 3	114T0106-9		SUPPORT INSTL-AUX TRACK POSITION DATA: ISS 316.232 AFT LH FOR NHA SEE: 57-41-01-05		RF
- 7	114T0106-10		SUPPORT INSTL-AUX TRACK POSITION DATA: ISS 316.232 AFT RH FOR NHA SEE: 57-41-01-05		RF
12	114T0148-1		.SUPPORT ASSY- POSITION DATA: AFT OPTIONAL PART: 114T0149-1		1
12	114T0149-1		.SUPPORT ASSY- POSITION DATA: AFT OPTIONAL PART: 114T0148-1		1
- 15	L8006K3		ATTACHING PARTS .BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY6K3		7
- 20	HL79-6		.COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M6 OPTIONAL PART: HL79-6 V73197 HL79-6 V92215 66014-6 V56878 HL79-6 V56878 -----*-----		7
25	BACB28AM09B017A		..BUSHING		2
35	114T0148-2		..SUPPORT- USED ON: 114T0148-1		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-43-53-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-43-53
 FIG. 01
 PAGE 1
 APR 22/08

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 35	114T0149-2		.. SUPPORT- USED ON: 114T0149-1		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-43-53-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-43-53
 FIG. 01
 PAGE 2
 APR 22/08