


 BOEING
767
PARTS CATALOG (MAINTENANCE)

AILERONS

HXL
DEC 22/06

57-60-00
SECTION TITLE
PAGE 1

BOEING
767
PARTS CATALOG (MAINTENANCE)

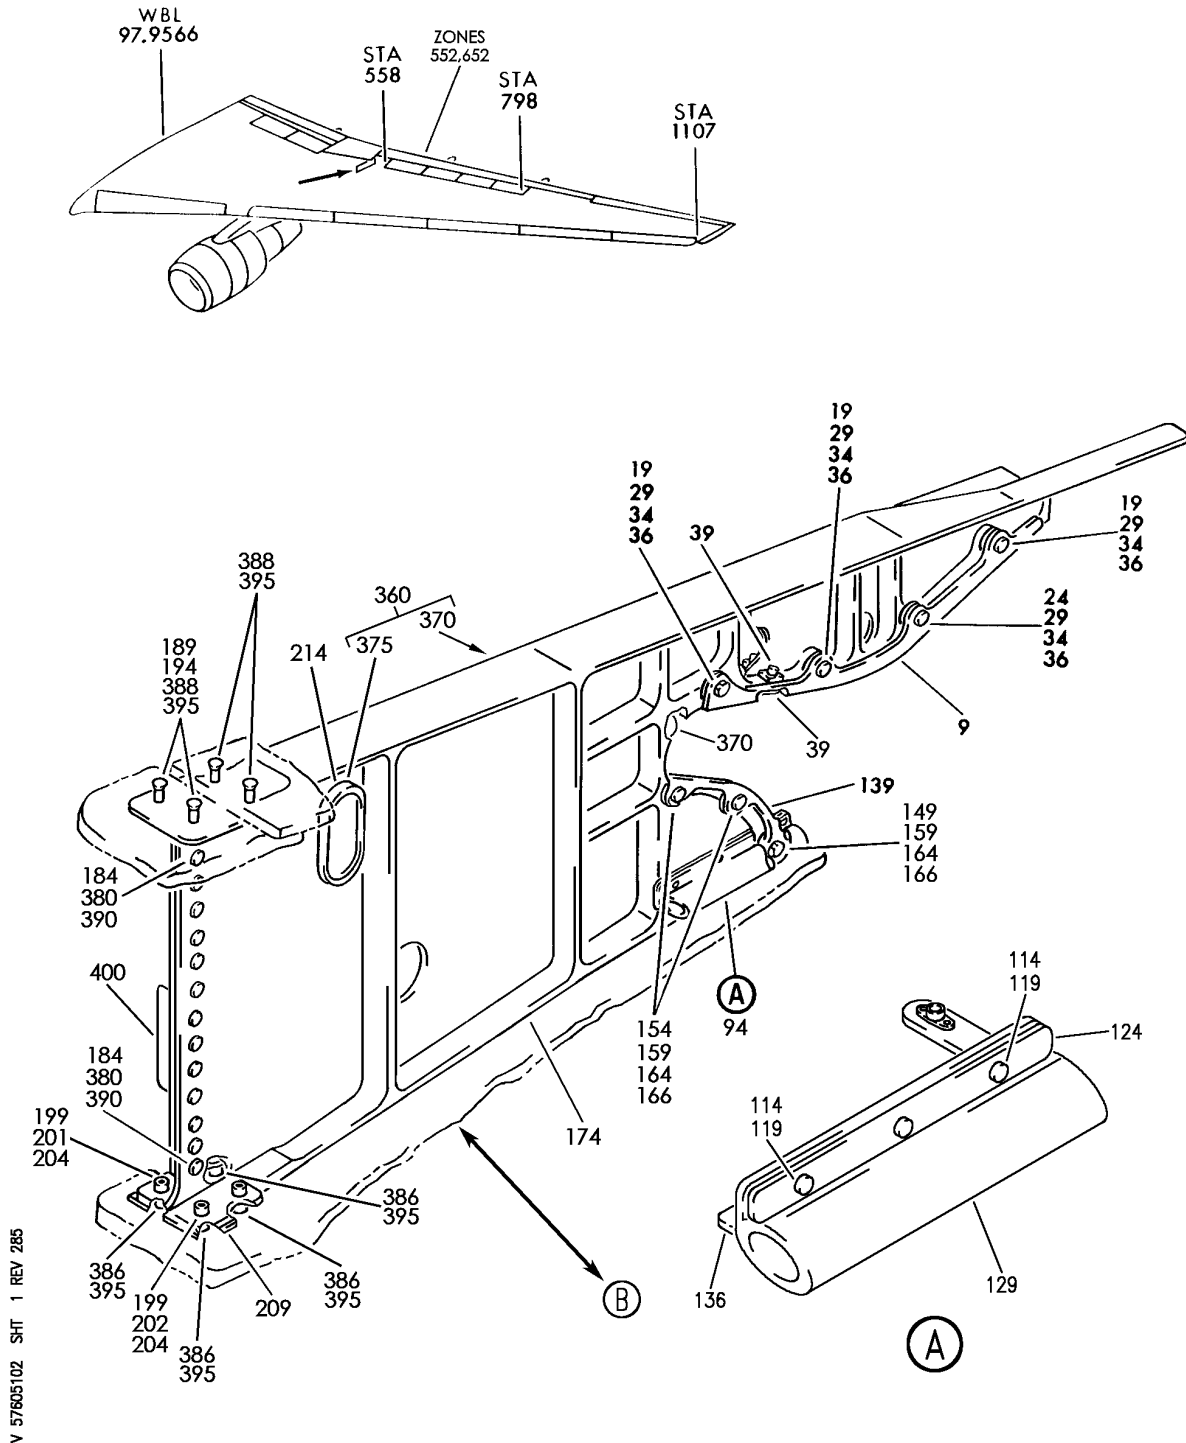


RIB INSTL-WING STA 534.27 INBD AIL. HINGE SPRT
FIGURE 2 (SHEET 1)

57-60-51-02

HXL
DEC 22/06

57-60-51-02
PAGE 0

BOEING
767
PARTS CATALOG (MAINTENANCE)

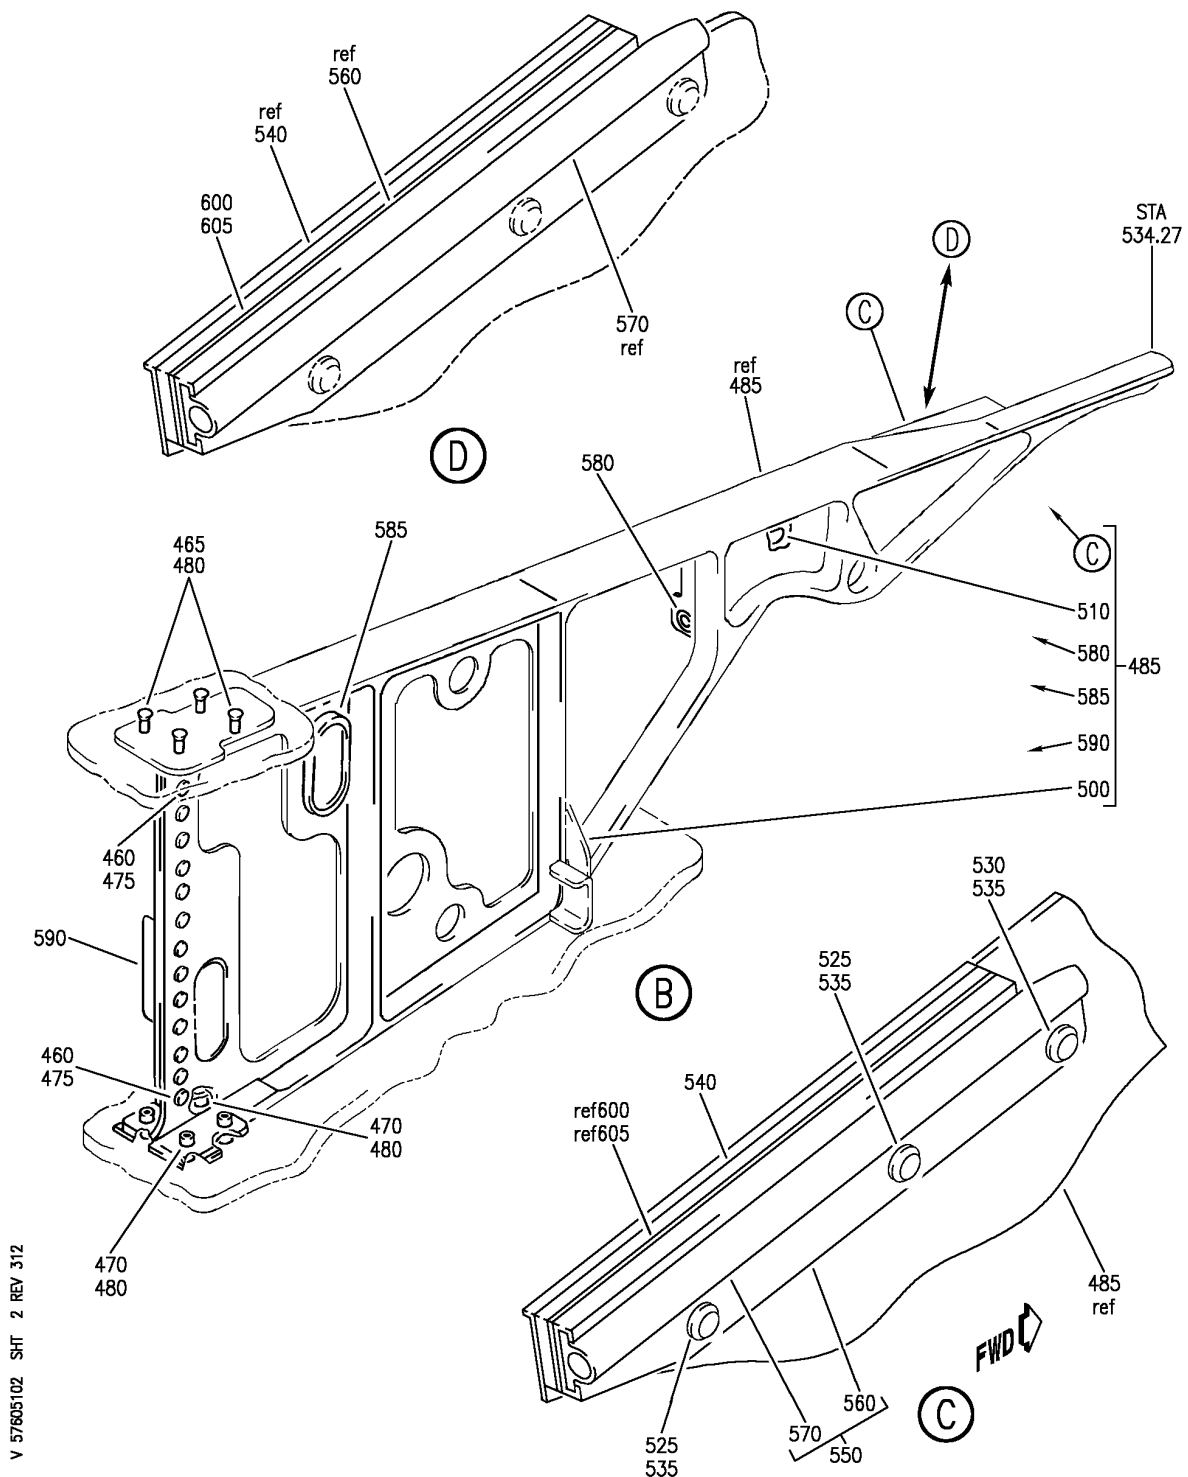

V 57605102 SHT 2 REV 312

RIB INSTL-WING STA 534.27 INBD AIL. HINGE SPRT
FIGURE 2 (SHEET 2)

57-60-51-02

HXL
APR 22/07

57-60-51-02
PAGE 0A

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			RIB INSTL-WING STA 534.27 INBD AIL. HINGE SPRT		
- 1	113T1554-1		RIB INSTL-AIL. HINGE SPRT POSITION DATA: WING STA 534.27 INBD LH FOR NHA SEE: 57-51-54-01		RF
- 5	113T1554-2		RIB INSTL-AIL. HINGE SPRT POSITION DATA: WING STA 534.27 INBD RH FOR NHA SEE: 57-51-54-01		RF
9	113T1530-9		.LINER- POSITION DATA: LH SIDE		1
- 14	113T1530-10		.LINER- POSITION DATA: RH SIDE ATTACHING PARTS		1
19	BACB30NR4K29		.BOLT		3
24	BACB30NN4K29		.BOLT		1
29	AN960PD416		.WASHER-		4
34	BRH10A4		.NUT- SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653 -----*-----		4
36	BACS40U4N4		.SHIM		4
39	BACS40R13F14F		.SHIM-		AR
94	113T1554-21		.BRACKET ASSY- POSITION DATA: LH SIDE		1
- 99	113T1554-22		.BRACKET ASSY- POSITION DATA: RH SIDE		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-60-51-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-60-51
FIG. 02
PAGE 1
DEC 22/07

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			ATTACHING PARTS		
- 104	L8006K3		.BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY6K3		2
- 109	HL79-6		.COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M6 OPTIONAL PART: HL79-6 V73197 HL79-6 V92215 66014-6 V56878 HL79-6 V56878 -----*-----		2
114	NAS623-3-6		..SCREW		3
119	AN960XC10L		..WASHER-		3
124	113T1502-40		..RETAINER-		1
129	113T1502-37		..SEAL- POSITION DATA: LH SIDE MANUFACTURED FROM: EXTR RUBBER F25.01 10-60754-319 X 8.00 IN. SPARES ORDER MATERIAL CODE: 5287003190		1
- 134	113T1502-38		..SEAL- POSITION DATA: RH SIDE MANUFACTURED FROM: EXTR RUBBER F25.01 10-60754-319 X 8.00 IN. SPARES ORDER MATERIAL CODE: 5287003190		1
136	113T1554-23		..BRACKET- POSITION DATA: LH SIDE		1
- 138	113T1554-24		..BRACKET- POSITION DATA: RH SIDE		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-60-51-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-60-51
 FIG. 02
 PAGE 2
 AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2					
139	113T1530-7		.LINER- POSITION DATA: LH SIDE MISCELLANEOUS DATA: (-7 T/W BACB30NN4K29 AND BACN10JC4 NUT AND AN960PD416 WASHER IS I/W -3 ON LH)		1
- 144	113T1530-8		.LINER- POSITION DATA: RH SIDE MISCELLANEOUS DATA: (-8 T/W BACB30NN4K29 AND BACN10JC4 NUT AND AN960PD416 WASHER IS I/W -3 ON RH) ATTACHING PARTS		1
149	BACB30NN4K29		.BOLT		1
154	BACB30NR4K29		.BOLT		2
159	AN960PD416		.WASHER-		3
164	BRH10A4		.NUT- SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653 -----*-----		3
166	BACS40U4N4		.SHIM		3
174	113T1554-15		.RIB ASSY- POSITION DATA: LH SIDE		1
- 179	113T1554-16		.RIB ASSY- POSITION DATA: RH SIDE ATTACHING PARTS		1
184	BACR15FT6KEC		.RIVET- SIZE DETERMINED ON INSTL.		13
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-60-51-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-60-51
 FIG. 02
 PAGE 3
 APR 22/08



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2 189	HL11VAZ10-8		.BOLT- SUPPLIER CODE: V60516 SPECIFICATION NUMBER: BACB30NW10K8 OPTIONAL PART: B30NW10K8 V97928 HL11VAZ10-8 V73197 HL11VAZ10-8 V92215 HL11VAZ10-8 V97928 L803-10K8 V06725 HL11VAZ10-8 V0PTK6 HL11VAZ10-8 V56878		2
194	HL79-10		.COLLAR- SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M10 OPTIONAL PART: HL79-10 V73197 HL79-10 V92215 66014-10 V56878 HL79-10 V56878		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-60-51-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-60-51
FIG. 02
PAGE 4
DEC 22/07

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2 199	HL11VAZ12-10		.BOLT- SUPPLIER CODE: V60516 SPECIFICATION NUMBER: BACB30NW12K10 OPTIONAL PART: B30NW12K10 V97928 HL11VAZ12-10 V73197 HL11VAZ12-10 V92215 HL11VAZ12-10 V97928 L803-12K10 V06725 HL11VAZ12-10 V0PTK6 HL11VAZ12-10 V56878		2
204	HL79-12		.COLLAR- SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M12 OPTIONAL PART: HL79-12 V73197 HL79-12 V92215 66014-12 V56878 HL79-12 V56878		2
209	BACS40R15C28F		.SHIM- -----*-----		1
214	BACG20ZE850		..GROMMET-		1
214	BACG20ZE000850		..GROMMET-		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-60-51-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-60-51
 FIG. 02
 PAGE 5
 DEC 22/07