RIGOH

Modification Bulletin

PAGE: 1/1

Reissued: 27-Aug-04

Model: Model C-C1	Date: 17-Nov-03	No.: MB173001a
-------------------	-----------------	----------------

MB Correction

The items in bold italics have been corrected or added.

Modified Article: Parts catalog correction			Prepared by: T. Shintani		
From: 1st Technical Support Sec. Service Support Dept.					
	☑ Parts catalog correction☐ To facilitate assembly☐ Part standardization	☐ Vendor change☐ To improve reliability☐ Other		☐ To meet standards ()	
Modification Schedule:	From first mass production.				

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B1739671	B1734231	Brand Plaque – B173 : RIC	1→1	0/0	8	2	1, 2

Note:

1. Applicable models:

B173						
17 27 29 21						
	1/	√	1/			

2. This change applies only to the part number modification. This was done for parts number management.

Modification Bulletin

Model: Model C-C1 China Model Date		te: 22-Oct-04		No.: MB173002			
Modified Article: Parts catalog correction			Prepared by: A. Ishiyama				
From: 1st Technical	Support Sec. Service Support	Dept.					
Reason for Modification:	☑ Parts catalog correction☐ To facilitate assembly☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other		☐ To n	neet standards)		
Modification Schedule:	This new part is available from	m the first	mas	s production).		

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	H9169508	PSU - 220V	1	ı	3	2	1
	B1739675	Fusing Unit – 220V : China	1		14	1	2

Change/Reason: These new parts were added for the C-C1 China model (B173-21) only.

Note: Applicable models.

B173						
	17	27	29	21		
1						
2						

Œ0	101
II In I II I	l n l
	ШЦ

Modification Bulletin

e: 22-Oct-04	No.: MB173003

PAGE: 1/1

Model: Model C-C1 Asia Model Date:		e: 22-Oct-04		No.: MB173003			
Modified Article: P	PCB - NCU		Prepared by: A. Ishiyama				
From: 1st Technical Support Sec. Service Support Dept.							
Reason for Modification:	☑ Parts catalog correction☐ To facilitate assembly☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other		☐ To n	neet standards)		
Modification Schedule:	This new part is available from	m the first mas	ss productior	٦.			

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B1739516		PCB – NCU : NA	1→0	X/O	3	11	1
	B1739676	PCB – NCU : Asia	0→1	7/0			•

Change/Reason: These new parts were added for the C-C1 Asia model (B173-29) only.

Note: Applicable models:

B173									
Part No.	17	27	29	21					
B1739516				1					
B1739676			1						

RIGOH

Schedule:

Modification Bulletin

PAGE: 1/1

Model: Model C-C1 EU Model			Date: 18-Nov-04			No.: MB173004		
lodified Article: PCB - NCU			Prepared by: A. Ishiyama					
rom: 1st Technical Support Sec. Service Support Dept.								
leason for lodification:	☐ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization	☐ Vend☐ To im☐ Other	prove	ange e reliability		neet standards r S. Africa regulation)		
Modification This new part is available from the Octob				'04 producti	on.			

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
B1739515		PCB – NCU : EU	1→0	0/0*	3	11	1. 2
	B1739677	PCB - NCU : EU/SA	0→1	0/0			., _

Change: Board components were added/deleted.

Reason: To make the EU model usable in South Africa.

Note:

➤ See RTB RB173003 and B173002b for more details.

➤ There is a round, green seal on the new NCU.

1. Applicable models:

B173									
Part No.	17	27	29	21					
B1739515		$\sqrt{}$							
B1739677									

> Applied to C-C1 EU model (B173-27) from: S/N **K2549423762 (Oct. 2004)**

2. Interchangeability

South Africa model: **Only the new board** can be used. Europe model: Interchangeability is **O/O on all machines**.


3. When you install the new NCU

- 1) If you install the <u>new NCU (B1739677)</u>, make sure to install firmware <u>v6.14 or later</u>.
- 2) When you install v6.14, make sure that the "LIU Select" setting is correct. (Tech Mode >> Data Setup >> LUI Setting):
- > v6.14 + New NCU: Select "EU&SA LIU"
- > v6.14 + Old NCU: Select: "EU LIU"

Model: Model C-C1 Date			e: 25-Mar-05		No.: MB173005		
Modified Article: Harness - ADF			Prepared by: A. Ishiyama				
From: 1st Technical	Support Sec. Service Support	Dept.					
Reason for Modification:	 ☑ Parts catalog correction ☐ To facilitate assembly ☐ Part standardization ☐ Other 		J	☐ To n ()	neet standards		
Modification Schedule:	This new part is available from	m the first mas	s production	1.			

Please apply the following P/N corrections to your Parts Catalogs.

Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
	B1739678	HARNESS - ADF	0→1	ı	7	25	

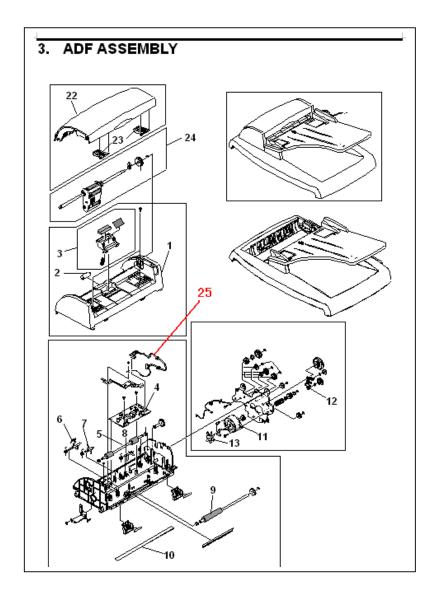

RIGOH

Modification **B**ulletin

PAGE: 1/1

Model: Model C-C1 Date			Date	e: 27-Sep-05		No.: MB173006	
Modified Article: Scanner harness			Prepared by: T. Shintani				
From: 1st Technical	Support Sec. Service Support	Dept.					
Reason for Modification:	☐ Parts catalog correction☐ To facilitate assembly☐ Part standardization	☐ Vendor change ☐ To improve reliability ☐ Other		· ·	☐ To n ()	neet standards	
Modification Schedule:	This new part is available from	m the firs	t mas	s production	1.		

Please apply the following P/N corrections to your Parts Catalogs.

New part number	Description	Q'ty	Int	Page	Index	Note
B1739679	SCANNER HARNESS	0→1	ı	2	13	

