	മ്പ	ПΠ
KU	GO	لتا

Modification Bulletin

lletin	PAGE: 1/1

Model: Adonis-C3 ARDF (DF76)	Date: 8-Jan-04	No.: MB541001
------------------------------	----------------	---------------

Number Correction

The bulletin number has been corrected. (MB082009→MB541001)

Modified Article: P	arts catalog correction	Prepared by: Y.Urushihara			
From: 1st Tech. Support Sec. Service Support Dept.					
Reason for	□ Parts catalog correction	☐ Vendor ch	ange	☐ To meet standards	
Modification:	☐ To facilitate assembly	☐ To improve reliability☐ Other		()	
	☐ Part standardization				

Please note the following revisions made to the parts catalog. These were applied from the beginning of mass production.

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
G5646041	G5646032	Decal – Exit Misfeed Removal	1-1		25	7	
B3516041	G5646041	Decal – Misfeed Removal - Exit	1-1		25	8	

RIGOH

Modification Bulletin

Model: Adonis-C3 ARDF (DF76) Date			e: 16-Sep-04		No.: MB541002		
Modified Article: Pressure Plate Assy				Prepared by: K. Takagi			
From: 1st Tech. Support Sec. Service Support Dept.							
Reason for	Parts catalog correction	☐ Vendor change☐ To improve rel		ange	☐ To m	neet standards	
Modification:	☐ To facilitate assembly			e reliability	()	
	□ Part standardization	Other					

PAGE: 1/2

Old part	New part	Description	Q'ty	Int	Page	Index	Note
number	number						
B3514351	B5974311	Pressure Plate Assy	1	X/O	21	10	
B3514333	-	Cushion - Pressure Plate	2-0		21	15	
B3514322	B3514322	Tape - Platen Sheet	4-1		21	9	
	B5974326	Cushion Tape - Left	2		21	16	
	B5974333	Cushion Tape - Middle	2		21	17	
	G5643622	Cushion - Guide Plate	2		21	18	
	G5643621	Cushion - Guide Plate - Middle	1		21	19	
	G5643631	Cushion - Pressure Plate - Rear	1		21	20	
		Right					
	B5973632	Cushion - Pressure Plate - Right:	1		21	21	
		T8					

Reason: Parts standardization with the Model - JC1 ARDF (DF77).

Important: See the next page for important notes on installing the new parts.

PAGE: 2/2


Model: Adonis-C3 ARDF (DF76)

Date: 16-Sep-04

No.: MB541002

Installing the Velcro Patches ("Cushion" and "Cushion Tape")

- 1. Remove the Pressure Plate.
- 2. Remove the 5 old Velcro patches from the underside of the ADF.
- 3. Attach the new Velcro patches to the underside of the ADF (#18-21 below).

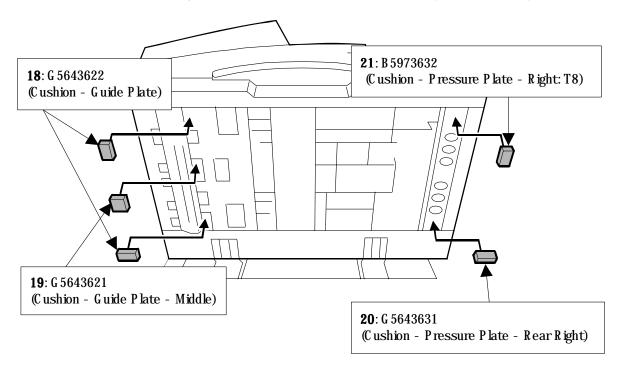

4. Attach the new Velcro patches to the underside of the Pressure Plate (#9, 10, 16, 17 below):

