ገጦጠ	ПЛ
](G(I)	別

Modification Bulletin

PAGE: 1/1

Model: Adonis-C2 PT1045 Date			e: 14-Sep-0	1	No.: MB376001	
Modified Article: Left Guide Plate - Middle				Prepared by: E. Fukuyama		
From: Technical Ser	vices Dept., GTS Division					
Reason for	Parts catalog correction	☐ Vend	lor ch	hange		neet standards
Modification: ☐ To facilitate assembly ☐ To impro				()	
	☐ Part standardization	☐ Othe	r			

To further ensure that the Middle Left Guide Plate stays securely attached, the width of the boss has been increased from 6 mm to 9 mm.


Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
A6842211	B3762211	Left Guide Plate - Middle	1-1	X/O	5	20	

MODEL NAME	DESTINATION	CODE	SERIAL NO.
1 – BIN TRAY	USA, Canada, Europe, Asia	B376-17	H7810500001
1 – BIN TRAY	USA, Canada, Europe, Asia	B376-14	L08441050001
1 – BIN TRAY	USA, Canada, Europe, Asia	B376-26	4J70510001

Model: Adonis-C2 PT1045 Date			e: 20-Mar-0	2	No.: MB376002
Modified Article: Upper Right Cover anad Mylar			Prepared	by: E.	Fukuyama
From: Technical Services Dept., GTS Division					
Reason for	☐ Parts catalog correction	☐ Vendor ch	hange		neet standards
Modification:	☐ To facilitate assembly			()
	☐ Part standardization	☐ Other			

To further ensure smooth paper transport and avoid paper jams, the shape of the Upper Right Cover has been changed and a Mylar has been added.

Old part	New part	Description	Q'ty	Int	Page	Index
number	number					
B3761551	B3761552	Upper Right Cover	1-1	X/O	3	2
-	B3761556	Paper Guide Mylar	0-1	-	3	34

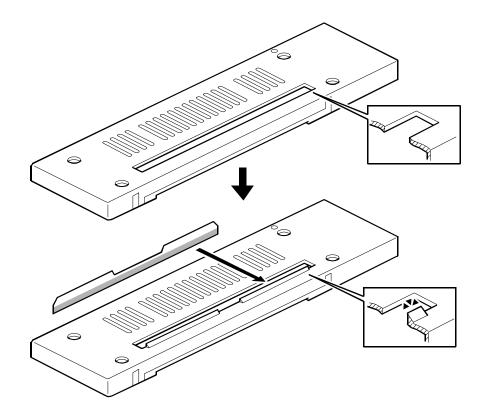

TOE (Capail) I Todac			
MODEL NAME	DESTINATION	CODE	SERIAL NO.
1 – BIN TRAY	USA, Canada, Europe, Asia	B376-17	H7811100001
1 – BIN TRAY	USA, Canada, Europe, Asia	B376-14	L0841110001
1 – BIN TRAY	USA, Canada, Europe, Asia	B376-26	4J71110001

RIGOH

Modification Bulletin

PAGE: 1/1

Model: Adonics-C2 1bin Tray (PT1045)			ate	ate: 25-Jul-02		No.: MB376003	
Modified Article: Chromium Free			Prepared by: K. Takagi				
From: Technical Services sec. Service Planning Dept.							
Reason for Modification:	☐ Parts catalog correction☐ To facilitate assembly		☐ Vendor change☐ To improve reliability		☐ To m	neet standards)	
Modification.	☐ Part standardization	☐ Other		Ī			

The following have been changed to chromium-free components to further minimize the impact on the environment.

Old part number	New part number	Description	Q'ty	Int.	Page	Index	Note
A6841111	B5441111	Side Plate - Front	1	O/O	5	32	
A6841112	B5441112	Transport Sensor Bracket	1	O/O	5	3	
A6841211	B5441211	Side Plate - Rear	1	O/O	5	31	
A6841212	B5441212	Safety Switch Bracket	1	O/O	5	10	
A6841213	B5441213	Sensor Bracket	1	O/O	5	29	
A6841214	B5441214	Main Board Bracket	1	O/O	3	26	
A6841311	B5441311	Upper Stay	1	O/O	5	9	
A6841401	B5441401	Base Assy	1	O/O	5	33	
A6841413	B5441413	Grounding Plate	1	O/O	3	20	
A6842332	B5442332	Pressure Release Bracket	1	O/O	5	14	
A6842511	B5442511	Motor Bracket	1	O/O	5	1	
A6843201	B5443201	Copy Tray Bracket	1	O/O	3	10	
B3761113	B5441113	Bracket - LED	1	O/O	5	7	

MODEL NAME	DESTINATION	CODE	SERIAL NO.
1 – BIN TRAY	USA, Canada, Europe, Asia	B376-17	H78208xxxxx
1 – BIN TRAY	USA, Canada, Europe, Asia	B376-14	L0842070034
1 – BIN TRAY	USA, Canada, Europe, Asia	B376-26	4J7082xxxx

	ΙПЛ
(G(O))[[]

Modification Bulletin

PAGE:	1	/1
-------	---	----

Model: Adonis-C2 1 bin Tray (PT1045) Date			e: 19-Sep-03		No.: MB376004		
Modified Article: Main Board				Prepared by: Y.Urushihara			
From: 1st Tech. Support Sec. Service Support Dept.							
Reason for	☐ Parts catalog correction			ange	☐ To m	neet standards	
Modification:	fication:		prove reliability		()	
	☐ Part standardization	Other					

The following has been changed due to a vendor change.

	Old part number	New part number	Description	Q'ty	Int	Page	Index	Note
ı	A6845100	B5445100	Main Board	1	0/0	3	25	

MODEL NAME	DESTINATION	CODE	SERIAL NO.
1 – Bin Tray	USA, Canada, Europe, Asia	B376-14	L0842100001
1 – Bin Tray	USA, Canada, Europe, Asia	B376-17	H7820900722
1 – Bin Tray	USA, Canada, Europe, Asia	B376-26	4J71120001