


VESTEL ELEKTRONİK A.Ş.	CHANGE BULLETIN (TCN)	CHANGE NO: 70 REF NO : UMB 1256
-----------------------------------	----------------------------------	--

AFFECTED MODELS: ALL NTSC-AMERICAN MODELS WITH 11AK19 CHASSIS INCLUDING V-CHIP CONTROLLER IC.

NOTE 1: The cable (6 cm.) must be connected between the Pin 20 of IC501 and Pin 7 of IC502 under the PCB.

START DATE : 20.11.1999

REASONS OF CHANGE: WRITE PROTECTION CONTROL OF IC502 (EEPROM).

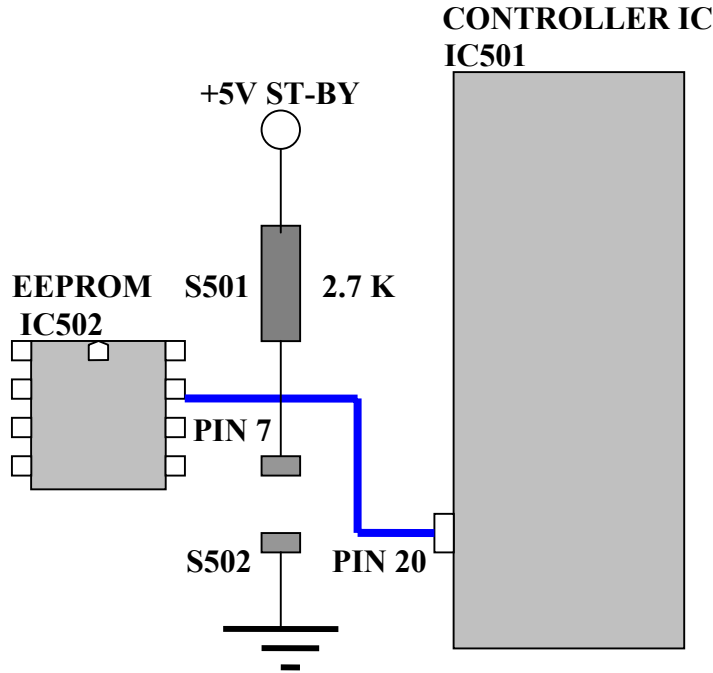

NO	PCB CODE	VESTEL CODE	COMPONENT NAME	POSITION NUMBER	QUANTITY
1	11AK19	30001734	JUMPER SMD 0805	S502	1

IN

NO	PCB CODE	VESTEL CODE	COMPONENT NAME	POSITION NUMBER	QUANTITY
1	11AK19	30000631	RES SMD 1/10W 2K7 J 0805	S501	1
2	11AK19	30009834	CABLE BLUE 0.6MM	NOTE 1	1

APPLICATION ENGINEER	APPLICATION ENGINEERING CHIEF	APPLICATION ENGINEERING MANAGER
-	YILDIRAY BAŞKURT	CELAL ÖZKUL