


WHEEL WELL FIRE DETECTION

BOEING
767
PARTS CATALOG (MAINTENANCE)

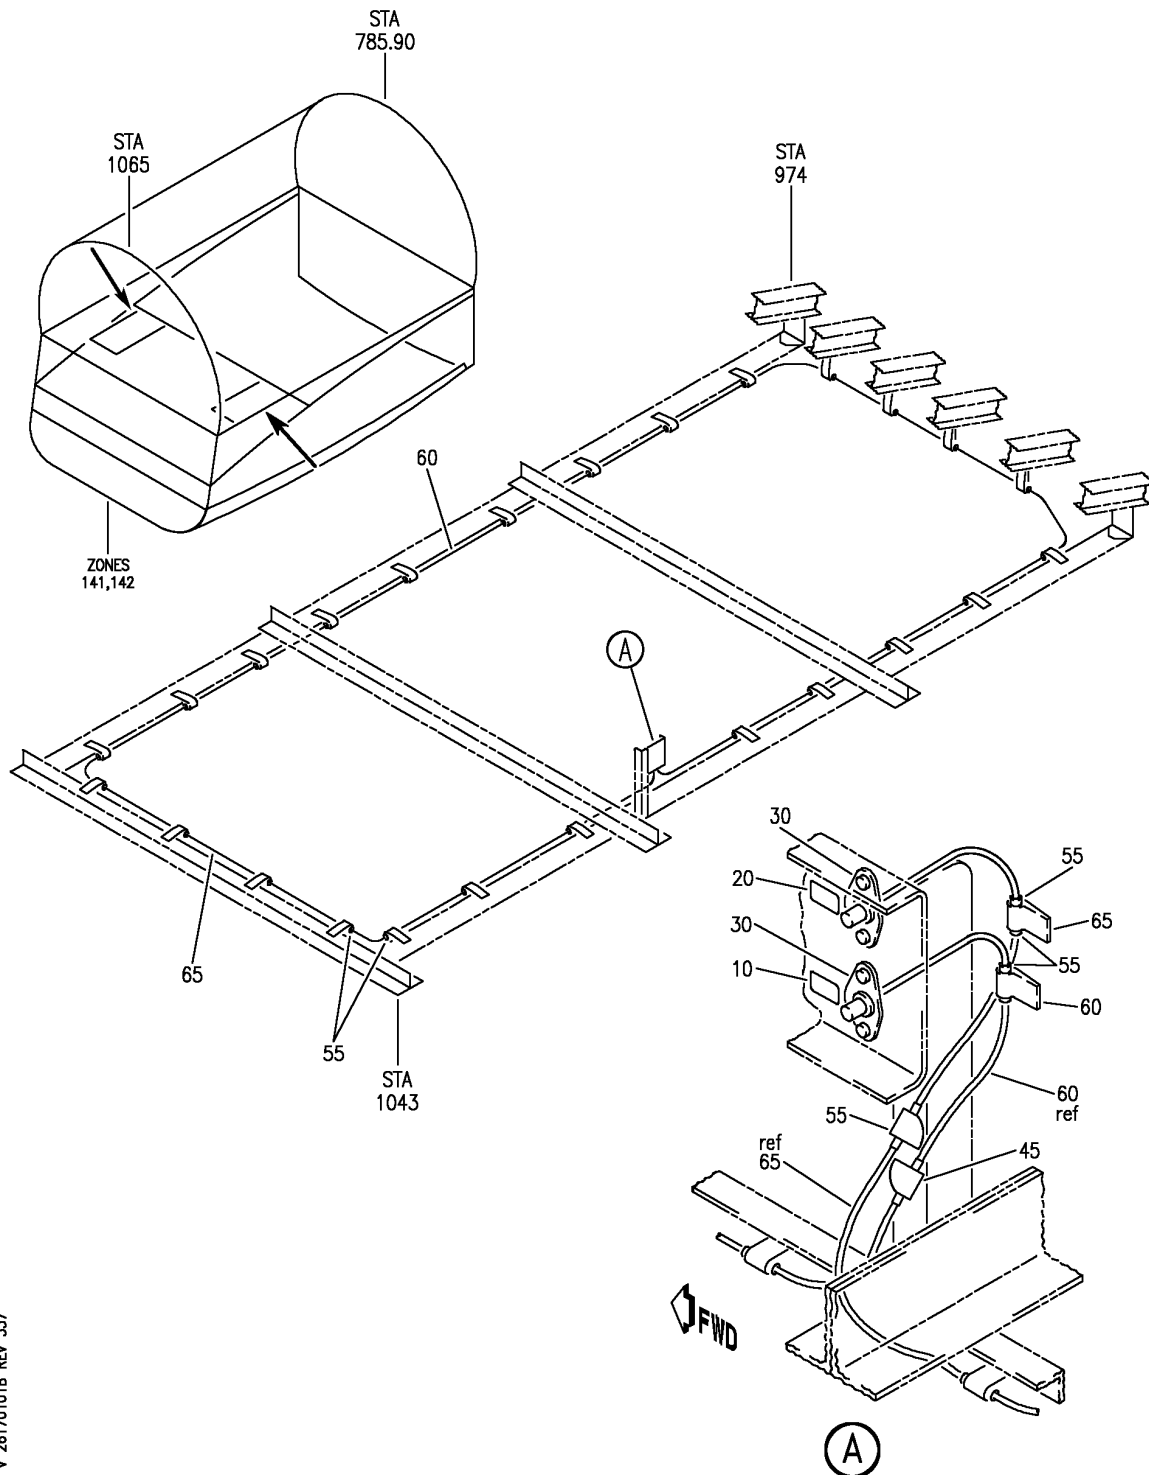

V 26170101B REV 337

DETECTOR INSTL-MAIN WHL WELL
FIGURE 1B

26-17-01-01B

HXL
APR 22/09

26-17-01-01B
PAGE 0

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1B			DETECTOR INSTL-MAIN WHL WELL		
- 1	284T0546-27		DETECTOR INSTL-MAIN WHL WELL POSITION DATA: LH FOR NHA SEE: 24-00-58-02		RF
- 5	284T0546-28		DETECTOR INSTL-MAIN WHL WELL POSITION DATA: RH FOR NHA SEE: 24-00-58-02		RF
10	BAC27TEX2308		.DECAL- POSITION DATA: LH SIDE PLACARD CONTENT: TS202		1
- 15	BAC27TEX2310		.DECAL- POSITION DATA: RH SIDE PLACARD CONTENT: TS204		1
20	BAC27TEX2309		.DECAL- POSITION DATA: LH SIDE PLACARD CONTENT: TS203		1
- 25	BAC27TEX2311		.DECAL- POSITION DATA: RH SIDE PLACARD CONTENT: TS205		1
30	35410-0		.BRACKET- SUPPLIER CODE: V73168		2
- 35	NAS1801-06-6		ATTACHING PARTS .SCREW		4
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

26-17-01-01B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

26-17-01
 FIG. 01B
 PAGE 1
 DEC 22/07

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1B					
- 40	BRH10A06		.NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC06 OPTIONAL PART: H10-06BAC V15653 RMLH9075-62W V72962 VN303A62 V92215 96-62 V80539 NS202101-62 V80539 T6S632J V11815 -----*-----		4
45	35401-5		.CLIP- SUPPLIER CODE: V73168 ATTACHING PARTS		1
- 50	NAS1801-3-6		.SCREW -----*-----		1
55	35450-3		.GROMMET- SUPPLIER CODE: V73168 OPTIONAL PART: 35450-1 V73168		30
55	35450-1		.GROMMET- SUPPLIER CODE: V73168 OPTIONAL PART: 35450-3 V73168		30
55	8507		.BUSHING- SUPPLIER CODE: V6F140		30
60	35599-4-400		.ELEMENT-SENSING SUPPLIER CODE: V73168 SPECIFICATION NUMBER: S283T004-25 ELECTRICAL EQUIP NUMBER: TS0202 TS0204		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

26-17-01-01B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

26-17-01
 FIG. 01B
 PAGE 2
 DEC 22/07

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1B				
65	35612-2-400	.ELEMENT-DETECTOR SUPPLIER CODE: V73168 SPECIFICATION NUMBER: S283T004-26 ELECTRICAL EQUIP NUMBER: TS0203 TS0205		1
- 800	286T0626-002	WIRE BUNDLE ASSY- POSITION DATA: LH		RF
805	35303-68	.PLUG- SUPPLIER CODE: V73168 ELECTRICAL EQUIP NUMBER: D00942 D00944 WIRING DIAGRAM REF: 261711		2
- 850	286T0964-001	WIRE BUNDLE ASSY- POSITION DATA: RH		RF
855	35303-68	.PLUG- SUPPLIER CODE: V73168 ELECTRICAL EQUIP NUMBER: D00946 D00948 WIRING DIAGRAM REF: 261711		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED


HXL

26-17-01-01B

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

26-17-01
 FIG. 01B
 PAGE 3
 DEC 22/07

BOEING
767
PARTS CATALOG (MAINTENANCE)

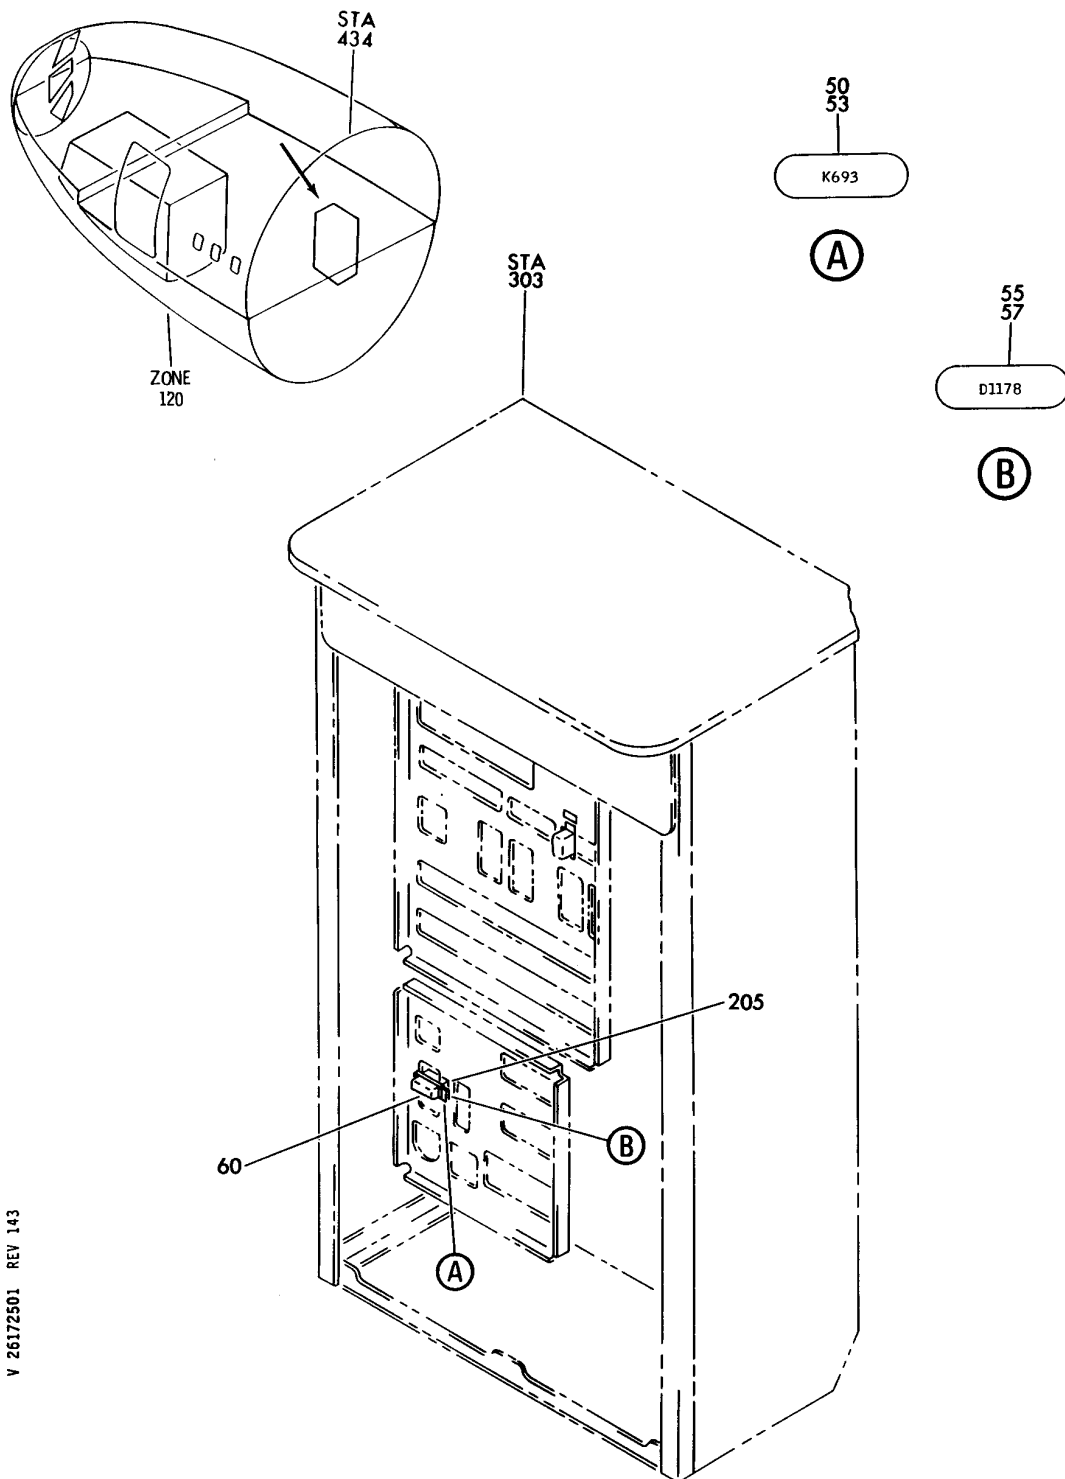

V 26172501 REV 143

EQUIPMENT ASSY-P37 MISC ELEC PNL R (WHEEL WELL OVERHEAT DETECTION ONLY)

FIGURE 1

26-17-25-01

HXL
DEC 22/06

26-17-25-01
PAGE 0

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			EQUIPMENT ASSY-P37 MISC ELEC PNL R (WHEEL WELL OVERHEAT DETECTION ONLY)		
- 9	284T0188-157		EQUIPMENT ASSY-P37 MISC ELEC PNL (WHEEL WELL OVERHEAT DETECTION ONLY) POSITION DATA: R FOR NHA/OTHER SYS DET SEE: 53-11-70-05	155162	RF
- 10	284T0188-172		EQUIPMENT ASSY-P37 MISC ELEC PNL (WHEEL WELL OVERHEAT DETECTION ONLY) POSITION DATA: R FOR NHA/OTHER SYS DET SEE: 53-11-70-05	163163	RF
- 11	284T0188-194		EQUIPMENT ASSY-P37 MISC ELEC PNL (WHEEL WELL OVERHEAT DETECTION ONLY) POSITION DATA: R FOR NHA/OTHER SYS DET SEE: 53-11-70-05	164999	RF
50	BAC27TEX3732		.DECALSET-INCLUDES DECALS IDENTIFIED ON THE ILLUSTRATION		RF
55	BAC27TEX3730		.DECALSET-INCLUDES DECALS IDENTIFIED ON THE ILLUSTRATION		RF
60	W460F1A		.RELAY- SUPPLIER CODE: VF0219 SPECIFICATION NUMBER: BACR13CE2 OPTIONAL PART: 3SAH5-13-4K1 V01526 3SAH1326A2 V01526 ELECTRICAL EQUIP NUMBER: K00693		1
- 200	286T0198-300		.WIRE BUNDLE ASSY		RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

26-17-25-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

26-17-25
 FIG. 01
 PAGE 1
 DEC 22/07



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 205	RSE120027		.. SOCKET- SUPPLIER CODE: V58982 SPECIFICATION NUMBER: BACS16AF1 OPTIONAL PART: 451120-027 V58982 ELECTRICAL EQUIP NUMBER: D01178 WIRING DIAGRAM REF: 261711		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED



HXL

26-17-25-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

26-17-25
FIG. 01
PAGE 2
DEC 22/07

BOEING
767
PARTS CATALOG (MAINTENANCE)

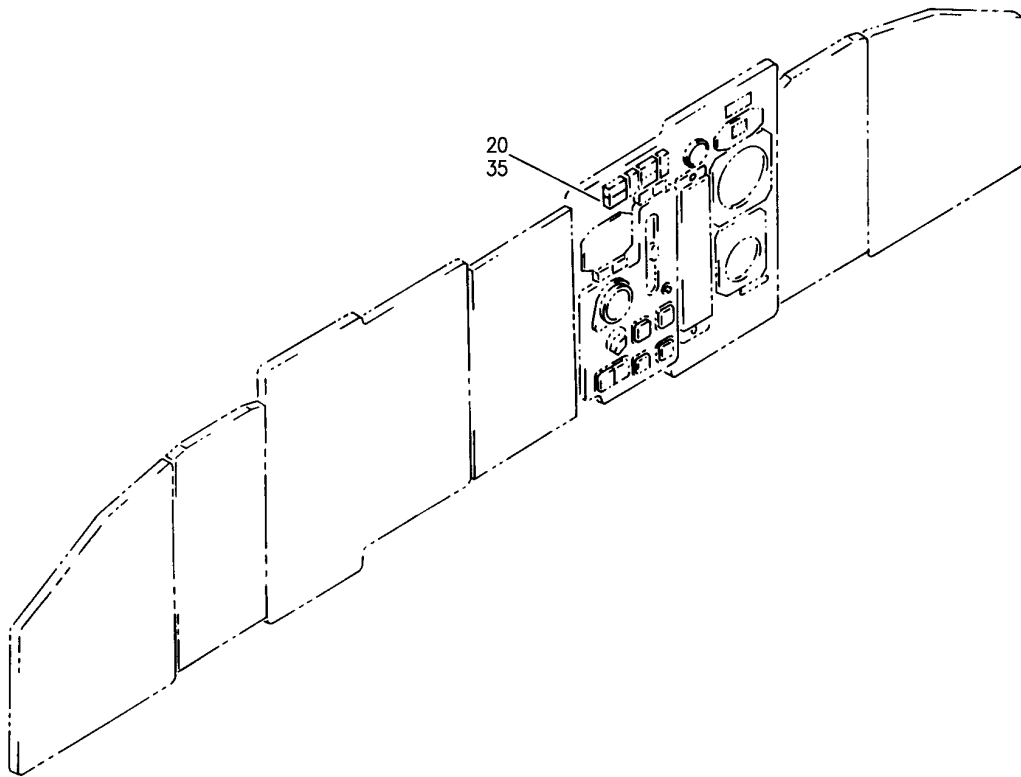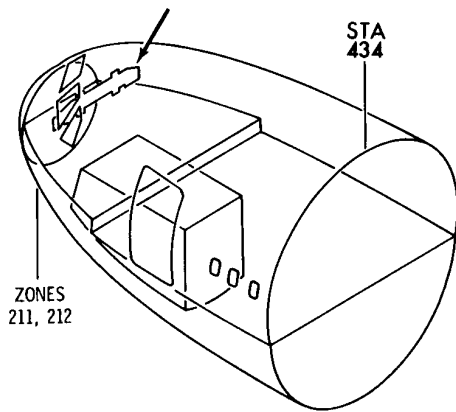

V 26175202 REV 263

PANEL INSTL-PILOTS MAIN (FIRE PROTECTION ONLY)
FIGURE 2

26-17-52-02

HXL
DEC 22/06

26-17-52-02
PAGE 0



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			PANEL INSTL-PILOTS MAIN (FIRE PROTECTION ONLY)		
- 1	233T2100-1		PANEL INSTL-PILOTS MAIN (FIRE PROTECTION ONLY) VARIABLE DRAWING REF: 233T2100-5048 FOR NHA/OTHER SYS DET SEE: 25-10-00-03		RF
- 9	233T2223-120		.PANEL ASSY-2 CREW CONT P3-1 PRE ALERT SB: 33A0087		RF
- 12	233T2223-1120		.PANEL ASSY-2 CREW CONT P3-1 POST ALERT SB: 33A0087		RF
20	BCREF6413		..LIGHT ASSY-WHL/WELL FIRE IND SUPPLIER CODE: V81590 OVERLENGTH PART NUMBER: 434-674-1005-1294 SPECIFICATION NUMBER: S231T300-1294 ELECTRICAL EQUIP NUMBER: L00680 FOR DETAILS SEE: 33-16-02-02		1
20	BCREF8596		..LIGHT ASSY-WHL/WELL FIRE IND SUPPLIER CODE: V81590 OVERLENGTH PART NUMBER: 434-674-1031-2294 SPECIFICATION NUMBER: S231T300-2294 ELECTRICAL EQUIP NUMBER: L00680 FOR DETAILS SEE: 33-16-02-03		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HXL

26-17-52-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

26-17-52
FIG. 02
PAGE 1
DEC 22/07

BOEING
767
PARTS CATALOG (MAINTENANCE)

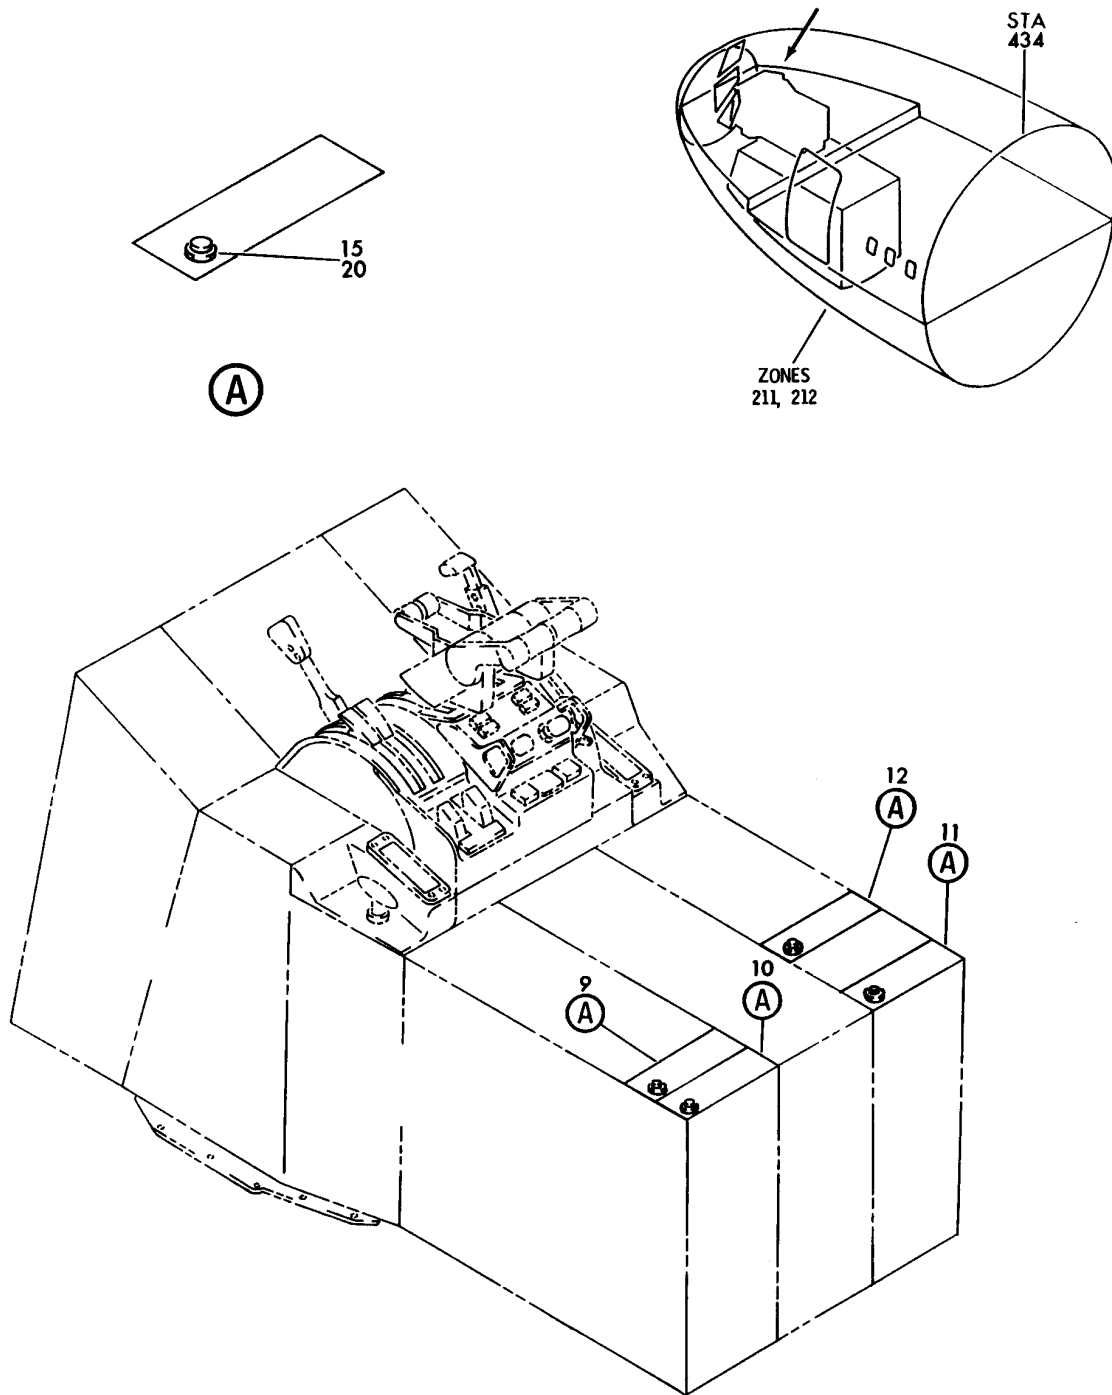

V 26175301 REV 122

PANEL INSTL-ELECTRONICS (WHEEL WELL OVERHEAT DETECTION ONLY)
FIGURE 1

26-17-53-01

HXL
DEC 22/06

26-17-53-01
PAGE 0

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			PANEL INSTL-ELECTRONICS (WHEEL WELL OVERHEAT DETECTION ONLY)		
- 1	233T6100-1		PANEL INSTL-ELECTRONICS (WHEEL WELL OVERHEAT DETECTION ONLY) VARIABLE DRAWING REF: 233T6100-5048 FOR NHA/OTHER SYS DET SEE: 25-10-00-06		RF
- 5	233T6100-16		.PANEL ASSY-FIRE/OVERHEAT TEST		RF
- 5	233T6100-18		.PANEL ASSY-FIRE/OVERHEAT TEST		RF
- 5	233T6100-26		.PANEL ASSY-FIRE/OVERHEAT TEST		RF
- 5	233T6100-64		.PANEL ASSY-FIRE/OVERHEAT TEST		RF
- 5	233T6100-75		.PANEL ASSY-FIRE/OVERHEAT TEST		RF
- 5	233T6204-301		COMPONENT MAINT MANUAL REF: 26-11-51 .PANEL ASSY-FIRE/OVERHEAT TEST SUPPLIER CODE: V89954 COMPONENT MAINT MANUAL REF: 26-11-51 QUALIFIED I/W DATA: 233T6204-301 PANEL ASSY IS I/W 233T6204-13 PANEL ASSY T/W S233T100-538 LIGHTPLATE		RF
10	233T6204-7		..PANEL ASSY- SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: M10445 COMPONENT MAINT MANUAL REF: 26-11-51		RF
10	233T6204-11		..PANEL ASSY- SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: M10445 COMPONENT MAINT MANUAL REF: 26-11-51		RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

26-17-53-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

26-17-53
 FIG. 01
 PAGE 1
 APR 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
10	233T6204-12	..PANEL ASSY- SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: M10445 COMPONENT MAINT MANUAL REF: 26-11-51		RF
10	233T6204-13	..PANEL ASSY- SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: M10445 COMPONENT MAINT MANUAL REF: 26-11-51 QUALIFIED I/W DATA: 233T6204-301 PANEL ASSY IS I/W 233T6204-13 PANEL ASSY T/W S233T100-538 LIGHTPLATE		RF
10	233T6204-16	..PANEL ASSY- SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: M10445 COMPONENT MAINT MANUAL REF: 26-11-51 QUALIFIED I/W DATA: 233T6204-315 PANEL ASSY IS I/W 233T6204-16 PANEL ASY T/W THE S233T100-538 LIGHTPLATE		RF
15	120092	...GUARD-SWITCH SUPPLIER CODE: V81640		1
20	2PB901T2	...SWITCH- SUPPLIER CODE: V91929		1
20	702PB1	...SWITCH- SUPPLIER CODE: V91929		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

HXL

26-17-53-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

26-17-53
 FIG. 01
 PAGE 2
 APR 22/09