


ENGINE INDICATION AND CREW ALERTING SYSTEMS

BOEING
767
PARTS CATALOG (MAINTENANCE)

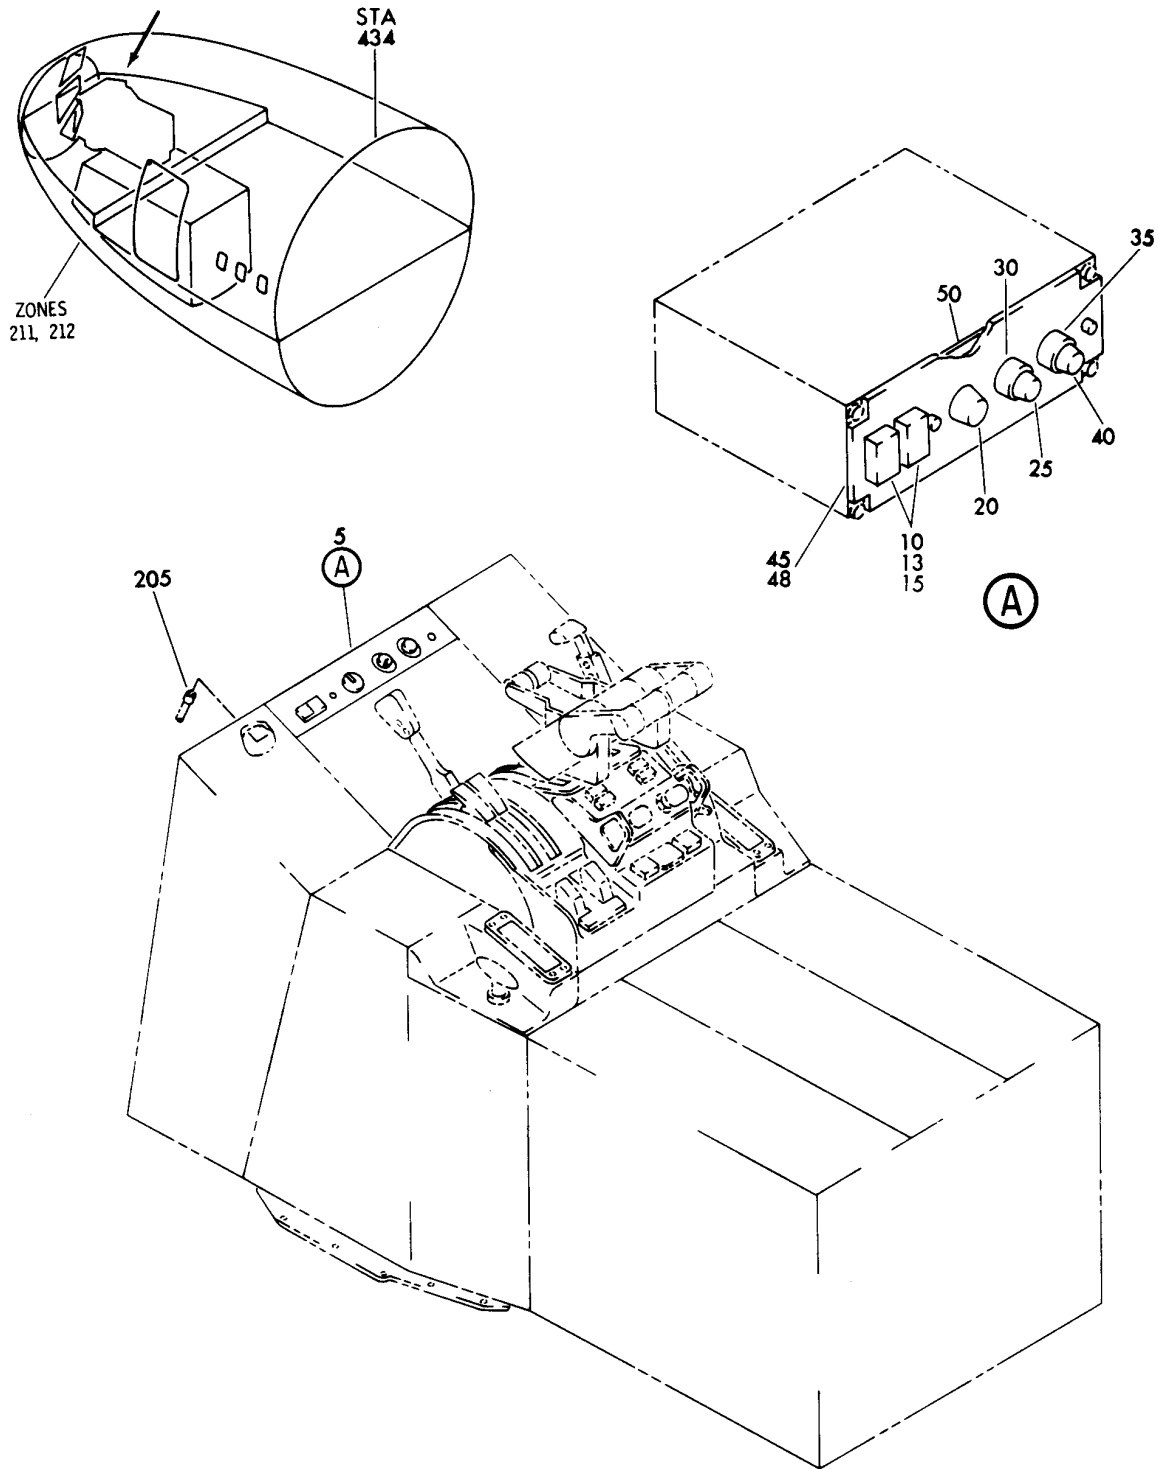

V 31410301 SHT 1 REV 084

PANEL INSTL-ELECTRONICS (ENGINE INDICATION AND CREW ALERTING SYSTEMS ONLY)

FIGURE 1

31-41-03-01

HXL
DEC 22/06

31-41-03-01
PAGE 0

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			PANEL INSTL-ELECTRONICS (ENGINE INDICATION AND CREW ALERTING SYSTEMS ONLY)		
- 1	233T6100-1		PANEL INSTL-ELECTRONICS (ENGINE INDICATION AND CREW ALERTING SYSTEMS ONLY)		RF
			VARIABLE DRAWING REF: 233T6100-5048 FOR NHA/OTHER SYS DET SEE: 25-10-00-06		
5	622-6089-101		.PANEL ASSY-ENG INDICATION AND CREW ALERTING SYS SELECT SUPPLIER CODE: V4V792 SPECIFICATION NUMBER: S242N701-205 ELECTRICAL EQUIP NUMBER: M10195 COMPONENT MAINT MANUAL REF: 31-41-75		1
5	622-6089-102		.PANEL ASSY-ENG INDICATION AND CREW ALERTING SYS SELECT SUPPLIER CODE: V4V792 FUNCTIONAL DESCRIPTION: PROVIDES ANALOG AND DIGITAL MODE/CONTROL SIGNALS TO THE EICAS COMPUTER AND DISPLAY UNITS SPECIFICATION NUMBER: S242N701-206 ELECTRICAL EQUIP NUMBER: M10195 COMPONENT MAINT MANUAL REF: 31-41-75		1
10	647-9083-001		..PUSHBUTTON ASSY- SUPPLIER CODE: V4V792		2
13	FGBLACK		...BUTTON- SUPPLIER CODE: V31918 CONFIG CHG DATA FROM A CMM: SUPERSEDES 266-7508-130		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

31-41-03-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-03
 FIG. 01
 PAGE 1
 DEC 22/07

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
13	266-7508-130	...	SWITCH- SUPPLIER CODE: V4V792 CONFIG CHG DATA FROM A CMM: SUPSD BY FGBLACK		1
15	647-9081-001	...	PUSHBUTTON- SUPPLIER CODE: V4V792		1
20	RD240-112	..	KNOB-PLASTIC SUPPLIER CODE: V81590		1
25	RD238-110	..	KNOB-PLASTIC SUPPLIER CODE: V81590		1
30	RC446-113	..	KNOB-PLASTIC SUPPLIER CODE: V81590		1
35	RC446-106	..	KNOB-PLASTIC SUPPLIER CODE: V81590		1
40	RD238-118	..	KNOB-PLASTIC SUPPLIER CODE: V81590		1
45	754-0517-002	..	PANEL ASSY-EDGELIGHT A4 SUPPLIER CODE: V4V792 USED ON: 622-6089-101		1
45	754-0517-003	..	PANEL ASSY-EDGELIGHT A4 SUPPLIER CODE: V4V792 USED ON: 622-6089-102		1
48	MS90451-6832	...	LAMP		18
50	647-5942-001	..	GASKET-PNL SUPPLIER CODE: V4V792		1
- 200	286T1711-121		WIRE BUNDLE ASSY-		RF
205	BACC45FT20A41S6	.	CONNECTOR- ELECTRICAL EQUIP NUMBER: D00209 WIRING DIAGRAM REF: 314111		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HXL

31-41-03-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-03
 FIG. 01
 PAGE 2
 DEC 22/07

BOEING
767
PARTS CATALOG (MAINTENANCE)

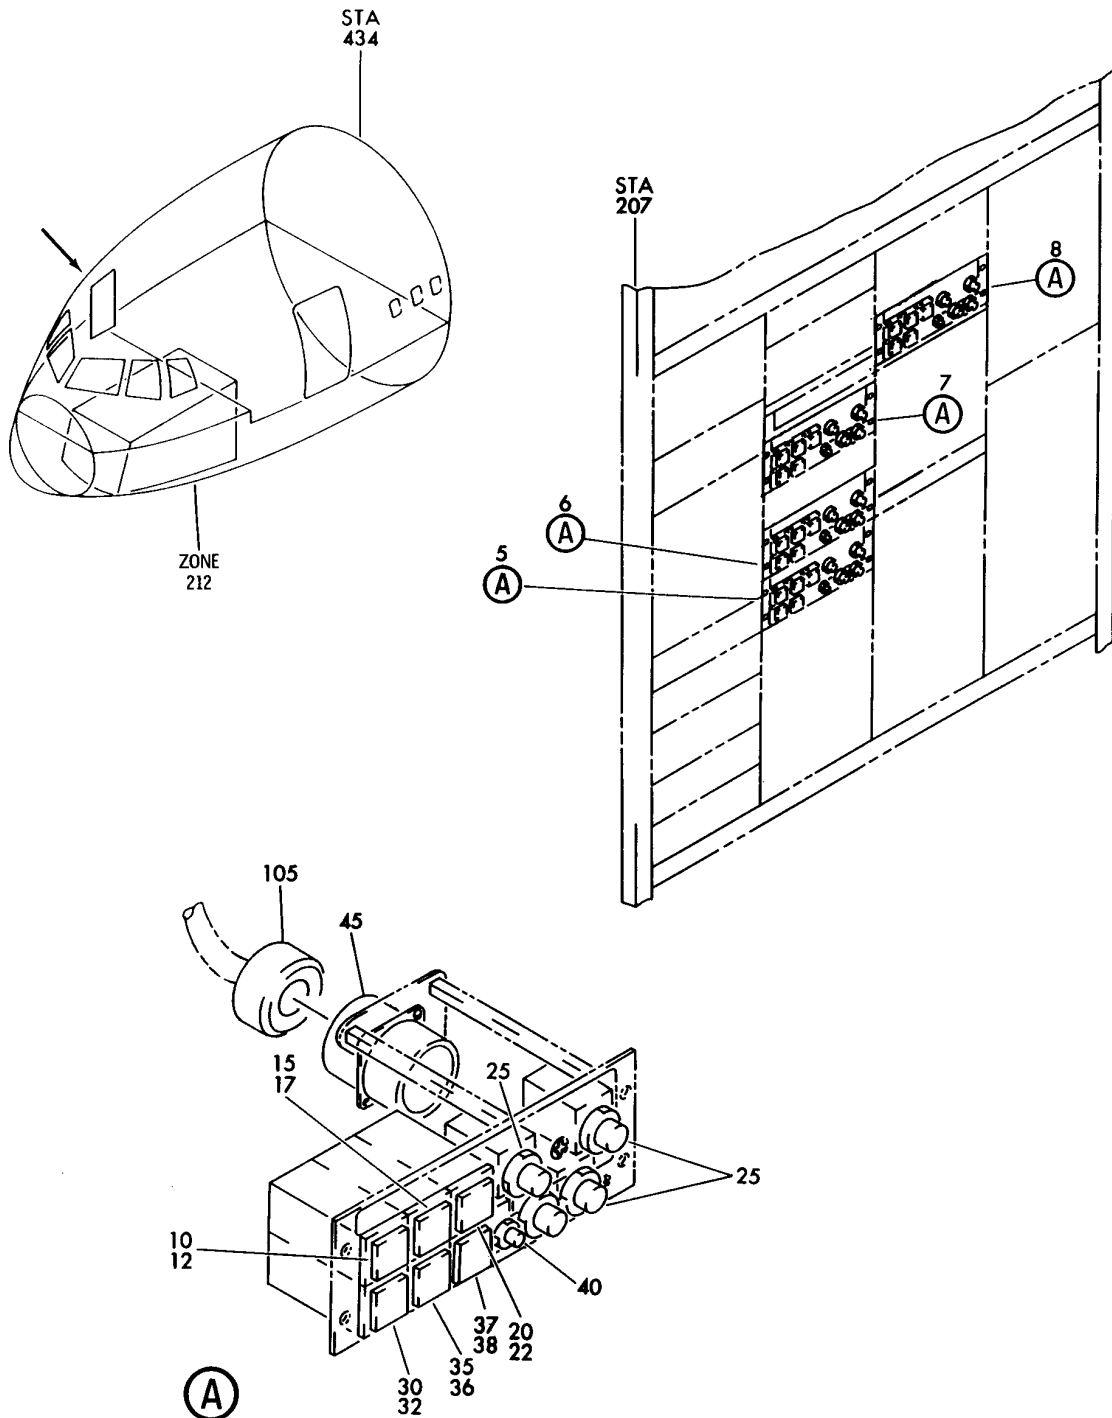

V 31415101 REV 109

PANEL INSTL-R SIDE (ENGINE INDICATION AND CREW ALERTING SYSTEMS ONLY)

FIGURE 1

31-41-51-01

HXL
DEC 22/06

31-41-51-01
PAGE 0

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			PANEL INSTL-R SIDE (ENGINE INDICATION AND CREW ALERTING SYSTEMS ONLY)		
- 1	233T4100-1		PANEL INSTL-(ENGINE INDICATION AND CREW ALERTING SYSTEMS ONLY) POSITION DATA: R SIDE VARIABLE DRAWING REF: 233T4100-5048 FOR NHA/OTHER SYS DET SEE: 25-10-00-03		RF
5	233N7509-6		.PANEL ASSY-ENG INDICATION AND CREW ALERTING SYS MAINT SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: M10372 COMPONENT MAINT MANUAL REF: 31-41-54		RF
10	2100-14		..SWITCH-ECS/MSG SUPPLIER CODE: V91929		1
12	2100-111		...CAP- SUPPLIER CODE: V91929		1
15	2100-15		..SWITCH-ELEC/HYD SUPPLIER CODE: V91929		1
17	2100-112		...CAP- SUPPLIER CODE: V91929		1
20	2100-16		..SWITCH-PERF/APU SUPPLIER CODE: V91929		1
22	2100-113		...CAP- SUPPLIER CODE: V91929		1
25	2PB11T2		..SWITCH- SUPPLIER CODE: V91929		4
30	2100-17		..SWITCH-CONF/MCDP SUPPLIER CODE: V91929		1
32	2100-114		...CAP- SUPPLIER CODE: V91929		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

31-41-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-51
 FIG. 01
 PAGE 1
 DEC 22/08

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
35	2100-18		..SWITCH-ENG/EXCD SUPPLIER CODE: V91929		1
36	2100-115		...CAP- SUPPLIER CODE: V91929		1
37	2100-19		..SWITCH-EPCS SUPPLIER CODE: V91929		1
38	2100-140		...CAP- SUPPLIER CODE: V91929		1
40	1PB5		..SWITCH- SUPPLIER CODE: V91929		1
45	BACC45FN20-41P8		..CONNECTOR ATTACHING PARTS		1
- 50	NAS1801-04-5		..SCREW		3
- 55	K19798-04		..NUT SUPPLIER CODE: V15653 SPECIFICATION NUMBER: BACN10NW1 OPTIONAL PART: RMA4812-160-40 V72962 293162 V60119 -----*-----		3
- 100	286T0062-300		WIRE BUNDLE ASSY-(ENGINE INDICATION AND CREW ALERTING SYSTEMS ONLY)		RF
105	BACC45FT20A41S8		.CONNECTOR- ELECTRICAL EQUIP NUMBER: D00419 WIRING DIAGRAM REF: 314113		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HXL

31-41-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-51
 FIG. 01
 PAGE 2
 DEC 22/08

BOEING
767
PARTS CATALOG (MAINTENANCE)

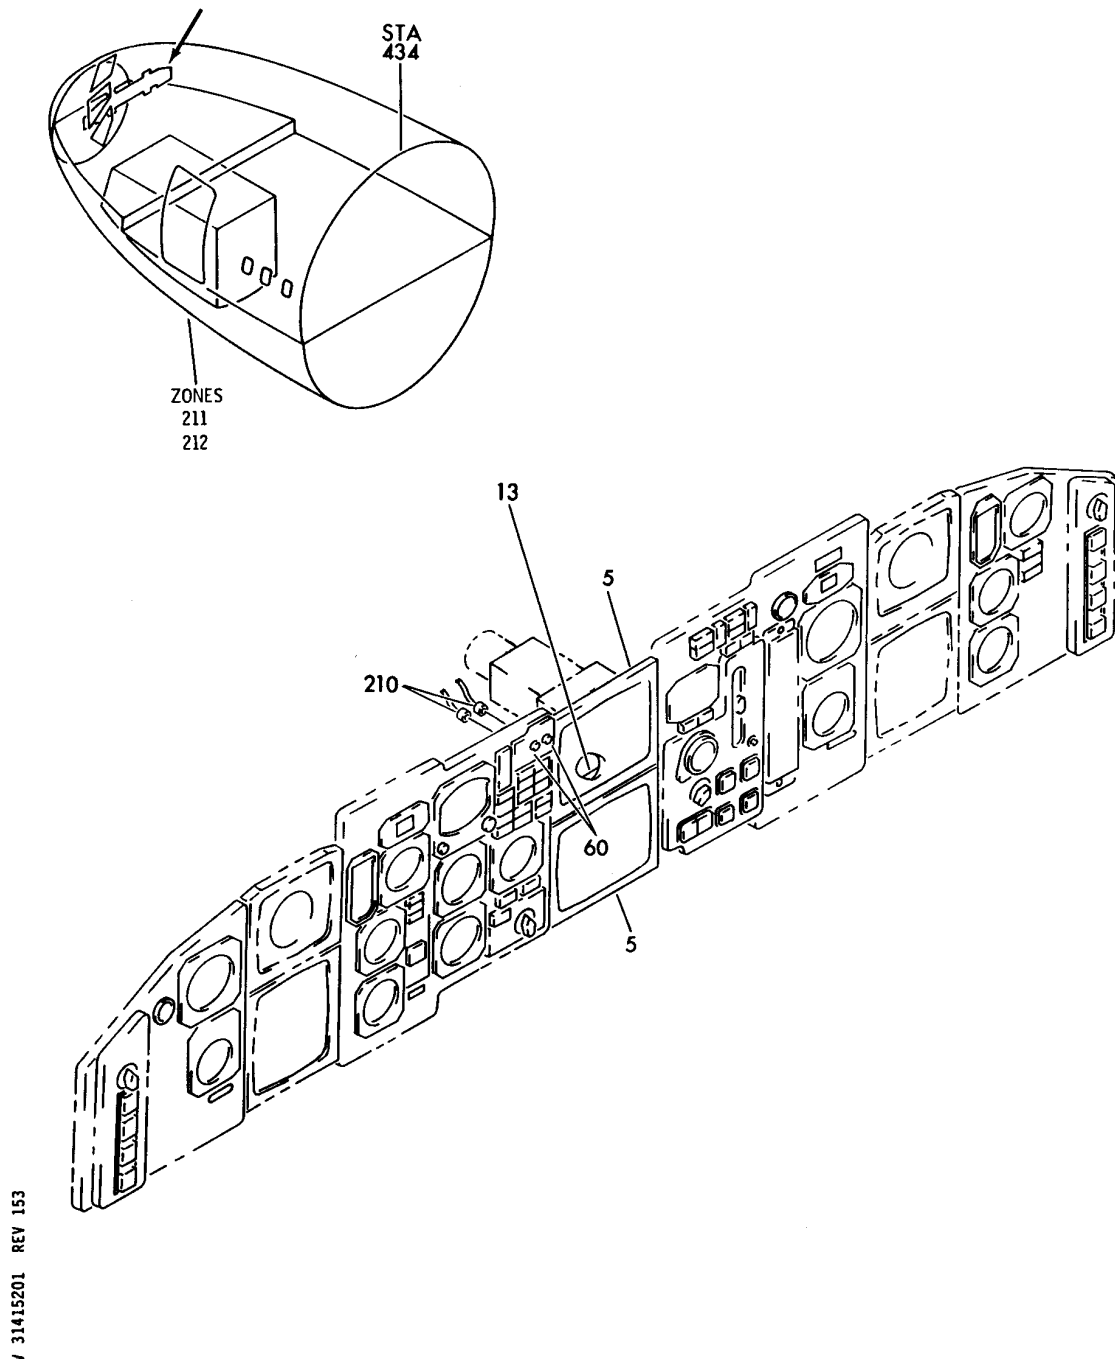

V 31415201 REV 153

PANEL INSTL-PILOTS MAIN (ENGINE INDICATION AND CREW ALERTING SYSTEMS ONLY)

FIGURE 1

31-41-52-01

HXL
DEC 22/06

31-41-52-01
PAGE 0



767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			PANEL INSTL-PILOTS MAIN (ENGINE INDICATION AND CREW ALERTING SYSTEMS ONLY)		
- 1	233T2100-1		PANEL INSTL-PILOTS MAIN (ENGINE INDICATION AND CREW ALERTING SYSTEMS ONLY)		RF
5	622-5046-100		VARIABLE DRAWING REF: 233T2100-5048 FOR NHA/OTHER SYS DET SEE: 25-10-00-03 .INDICATOR ASSY-ENG INDICATION AND CREW ALERTING SYS SUPPLIER CODE: V4V792 SPECIFICATION NUMBER: S242T404-601 MISCELLANEOUS DATA: 622-7999-013 IS IDENTICAL TO 622-7999-003 EXCEPT THAT THE BEZEL COLOR IS GRAY INSTEAD OF BROWN. 622-7999-013 IS INTERCHANGEABLE WITH 622-7999-003 SUBJECT TO CUSTOMER PREFERENCE. ELECTRICAL EQUIP NUMBER: N10013 N10014 COMPONENT MAINT MANUAL REF: 34-22-71		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

31-41-52-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-52
FIG. 01
PAGE 1
AUG 22/09



767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 5	622-5046-101		.INDICATOR ASSY-ENG INDICATION AND CREW ALERTING SYS SUPPLIER CODE: V4V792 SPECIFICATION NUMBER: S242T404-602 MISCELLANEOUS DATA: 622-7999-013 IS IDENTICAL TO 622-7999-003 EXCEPT THAT THE BEZEL COLOR IS GRAY INSTEAD OF BROWN. 622-7999-013 IS INTERCHANGEABLE WITH 622-7999-003 SUBJECT TO CUSTOMER PREFERENCE ELECTRICAL EQUIP NUMBER: N10013 N10014 COMPONENT MAINT MANUAL REF: 34-22-71		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

31-41-52-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-52
FIG. 01
PAGE 2
DEC 22/06



767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1	5 622-7999-002		.INDICATOR ASSY-ENG INDICATION AND CREW ALERTING SYS SUPPLIER CODE: V4V792 FUNCTIONAL DESCRIPTION: CATHODE RAY TUBE USED AS AN HSI TO DISPLAY INERTIAL REFERENCE SYSTEM GENERATED TRACK AND HEADING AND AS A DISPLAY UNIT FOR THE EICAS SYSTEM SPECIFICATION NUMBER: S242T404-610 MISCELLANEOUS DATA: 622-7999-013 IS IDENTICAL TO 622-7999-003 EXCEPT THAT THE BEZEL COLOR IS GRAY INSTEAD OF BROWN. 622-7999-013 IS INTERCHANGEABLE WITH 622-7999-003 SUBJECT TO CUSTOMER PREFERENCE. ELECTRICAL EQUIP NUMBER: N10013 N10014 COMPONENT MAINT MANUAL REF: 34-22-61		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

31-41-52-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-52
FIG. 01
PAGE 3
AUG 22/09



767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1	5 622-7999-003		.INDICATOR ASSY-ENG INDICATION AND CREW ALERTING SYS SUPPLIER CODE: V4V792 SPECIFICATION NUMBER: S242T404-611 MISCELLANEOUS DATA: 622-7999-013 IS IDENTICAL TO 622-7999-003 EXCEPT THAT THE BEZEL COLOR IS GRAY INSTEAD OF BROWN. 622-7999-013 IS INTERCHANGEABLE WITH 622-7999-003 SUBJECT TO CUSTOMER PREFERENCE ELECTRICAL EQUIP NUMBER: N10013 N10014 COMPONENT MAINT MANUAL REF: 34-22-61 TEMPORARY BREAKDOWN FOR: 622-7999-003		2
13	025-0767-001		..CAP-CONDUCTIVE SUPPLIER CODE: V71468 USED ON: 622-7999-002		1
- 57	233T2222-58		.PANEL ASSY-2 CREW CONT STATIC SENSITIVE PART P1-3		RF
60	2PB11H58		..SWITCH- SUPPLIER CODE: V91929 ELECTRICAL EQUIP NUMBER: S10170 S10230		2
- 200	286T1435-120		WIRE BUNDLE ASSY		RF
- 205	286T1437-120		WIRE BUNDLE ASSY		RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

31-41-52-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-52
FIG. 01
PAGE 4
AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 210	BCREF6372		.PLUG- SUPPLIER CODE: V71468 OVERLENGTH PART NUMBER: DPXBMB67-33S0002 ELECTRICAL EQUIP NUMBER: D00205 D00207 WIRING DIAGRAM REF: 314111		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HXL

31-41-52-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-52
 FIG. 01
 PAGE 5
 AUG 22/09

BOEING
767
PARTS CATALOG (MAINTENANCE)

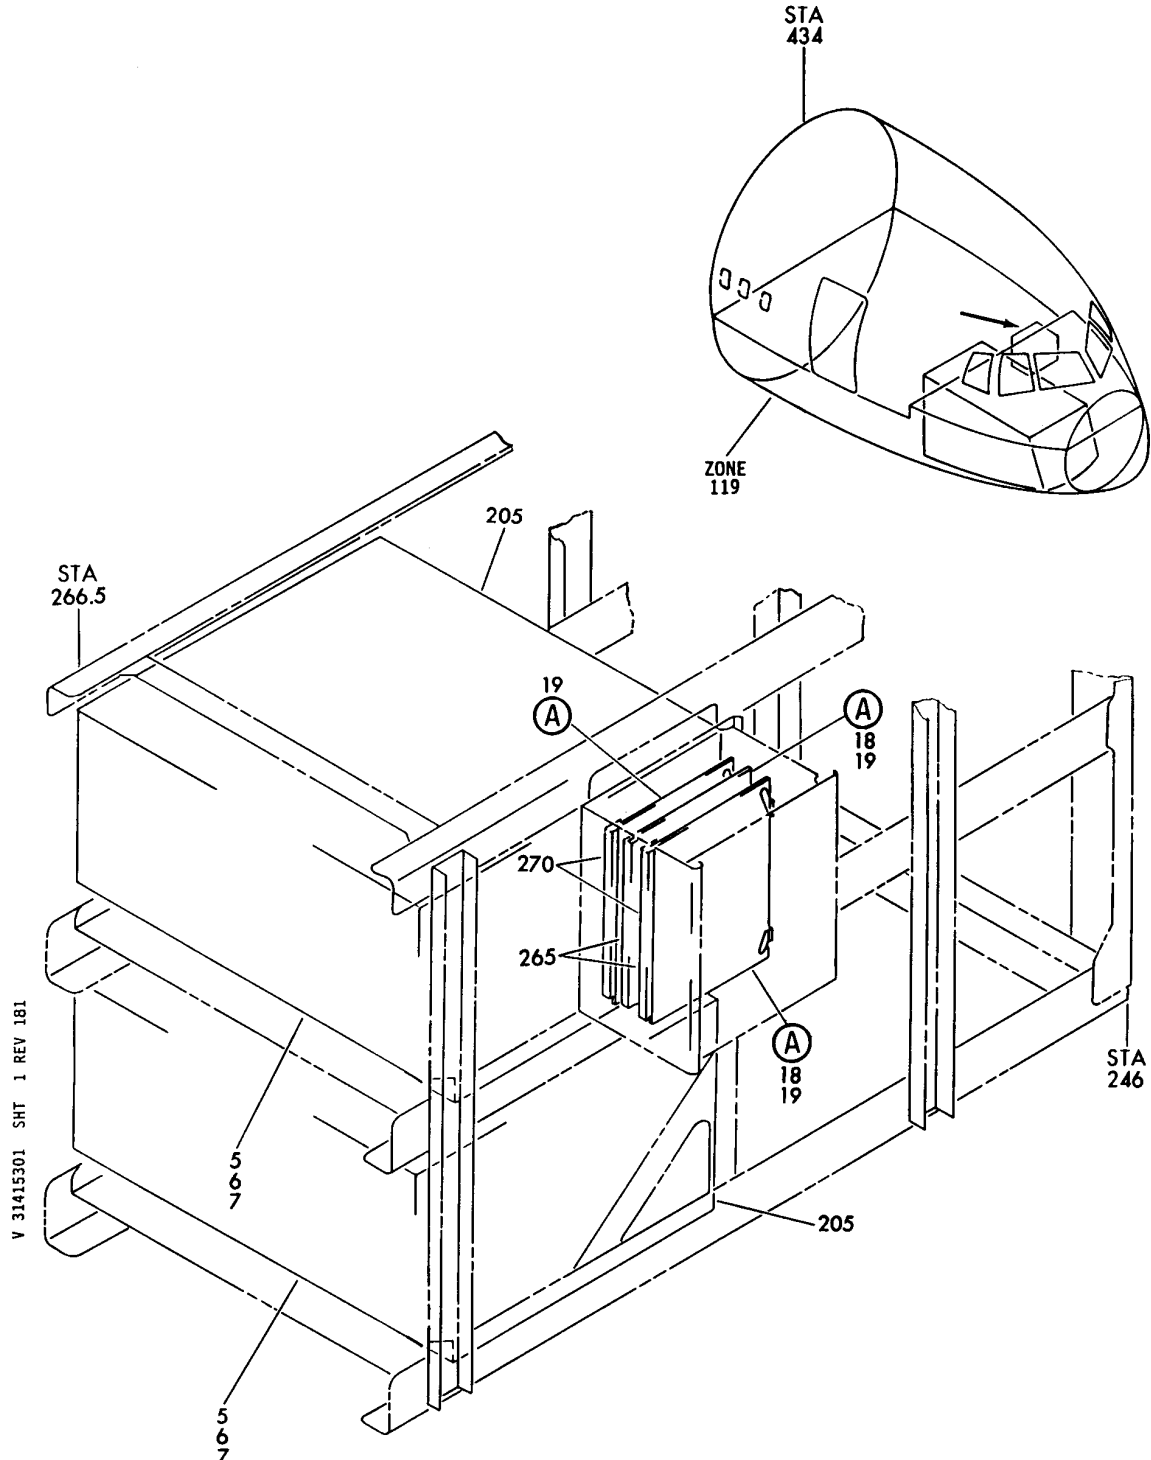

V 31415301 SHT 1 REV 181


EQUIPMENT INSTL-E8 RACK
FIGURE 1 (SHEET 1)

31-41-53-01

HXL
DEC 22/06

31-41-53-01
PAGE 0

BOEING
767
PARTS CATALOG (MAINTENANCE)

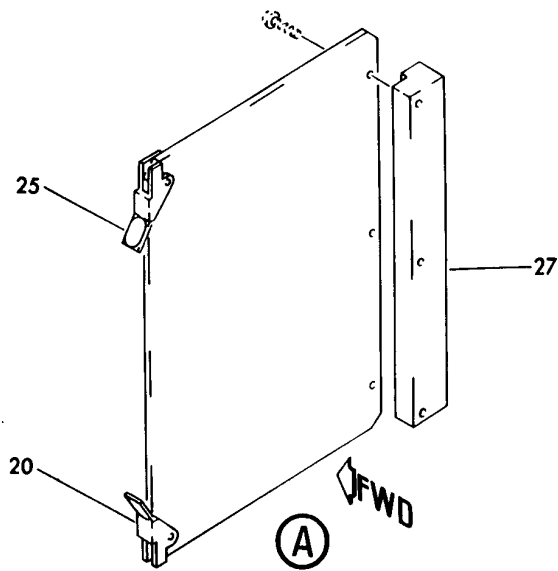

V 31415301 SHT 2 REV 177

EQUIPMENT INSTL-E8 RACK
FIGURE 1 (SHEET 2)

31-41-53-01

HXL
DEC 22/06

31-41-53-01
PAGE 0A



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 1	284T0970-1		EQUIPMENT INSTL-E8 RACK EQUIPMENT INSTL-E8 RACK VARIABLE DRAWING REF: 284T0970-5032 FOR NHA SEE: 24-00-58-01D		R F
6	622-8303-105		.COMPUTER ASSY-ENG INDICATION AND CREW ALERTING SYS SUPPLIER CODE: V4V792 POSITION DATA: L AND R SPECIFICATION NUMBER: S242N701-604 ELECTRICAL EQUIP NUMBER: M10181 M10182 COMPONENT MAINT MANUAL REF: 31-41-83 QUALIFIED I/W DATA: 622-8303-104 INTERCHANGEABLE AND INTERMIXABLE WITH 622-8303-105 EXCEPT ACFT WITH PW4062 ENGINES REQUIRE 622-8303-105 622-8303-101 I/W 622-8303-105 IN SHIPSETS ONLY POST SERVICE BULLETIN: EAP-701D-31-AC V4V792 POST SERVICE LETTER: 31-030		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

31-41-53-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-53
FIG. 01
PAGE 1
DEC 22/07



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1	6 622-9153-101		.COMPUTER ASSY-ENG INDICATION AND CREW ALERTING SYS SUPPLIER CODE: V4V792 POSITION DATA: L AND R SPECIFICATION NUMBER: S242N701-802 ELECTRICAL EQUIP NUMBER: M10181 M10182 COMPONENT MAINT MANUAL REF: 31-41-84 QUALIFIED I/W DATA: 622-9153-100 I/W 622-9153-101 IN SHIPSET UNTIL WIRING CHANGES INCORPORATED PER BOEING S. B. 767-31-0041 AT WHICH TIME THE 622-9153-101 MUST BE INSTALLED		2
7	822-1033-100		.COMPUTER ASSY-ENG INDICATION AND CREW ALERTING SYS SUPPLIER CODE: V4V792 POSITION DATA: L AND R SPECIFICATION NUMBER: S242N701-1001 ELECTRICAL EQUIP NUMBER: M10181 M10182 COMPONENT MAINT MANUAL REF: 31-41-86 SOFTWARE DRAWING REF: 31-41-53-01 POST SERVICE BULLETIN: 31-0100 31-0126		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

31-41-53-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-53
FIG. 01
PAGE 2
DEC 22/06



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 8	3170COLDE0-03		.SOFTWARE-31 EICAS OPS SUPPLIER CODE: V4V792 MISCELLANEOUS DATA: DISKETTE QUANTITY: 1 USED WITH: 822-1033-100 FOR SPARES PROCURE: 831-4565-102 POST SERVICE BULLETIN: 31-0126 POST SERVICE BULLETIN: EICAS-31-2 V4V792		2
- 14	3174BCG013-13		.SOFTWARE-EICAS OPC MISCELLANEOUS DATA: DISKETTE QUANTITY; 1 DISK USED WITH: 822-1033-100 HARDWARE REFERENCE SEE: 31-41-53-01 FOR SPARES PROCURE: 242T7001-2379 POST SERVICE BULLETIN: 31-0233		2
18	285T0496-1		.MODULE ASSY-ENG INDICATION AND CREW ALERTING SYS DISPLAY SWITCHING SUPPLIER CODE: V89954 POSITION DATA: UPR AND LWR ELECTRICAL EQUIP NUMBER: M10417 M10418 COMPONENT MAINT MANUAL REF: 31-41-52		2
20	71-2RA		..EJECTOR-CARD SUPPLIER CODE: V18915		1
25	71-2LA		..EJECTOR-CARD SUPPLIER CODE: V18915		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

31-41-53-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-53
FIG. 01
PAGE 3
APR 22/08



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 27	300046-003	..CONNECTOR- SUPPLIER CODE: V0D9V3 SPECIFICATION NUMBER: BACC65K114 OPTIONAL PART: 200626-01 V16512 300046-003 V03877 191-314-0001 V26742 S1027-00001 V03877 ELECTRICAL EQUIP NUMBER: P00001 ATTACHING PARTS		1
- 30	MS35214-14	..SCREW -----*-----		3
- 140	SB31-0168	SOFTWARE INSTL- POST SERVICE BULLETIN: 31-0168		1
- 140	31-0180	SOFTWARE INSTL- POST SERVICE BULLETIN: 31-0180		1
- 200 205	286T2000-310 BCREFA2171	WIRE BUNDLE ASSY- .CONNECTOR- OVERLENGTH PART NUMBER: BACC66K33C54AA01 ELECTRICAL EQUIP NUMBER: D00881 D00883 WIRING DIAGRAM REF: 314112		RF 2
R R R R R R	- 215 289T0326-113	.SLEEVE- POST SERVICE BULLETIN: 21-0129R1		1
- 220	289T0326-114	.SLEEVE- POST SERVICE BULLETIN: 21-0129R1		2
- 250	286T1035-106	WIRE BUNDLE ASSY-		RF
- 255	286T1037-106	WIRE BUNDLE ASSY-		RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

- ITEM NOT ILLUSTRATED

HXL

31-41-53-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-53
FIG. 01
PAGE 4
AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 265	300206-001	.CONNECTOR- SUPPLIER CODE: V0D9V3 SPECIFICATION NUMBER: BACC65L114 OPTIONAL PART: 200627-01 V16512 300206-001 V03877 192-314-0007 V26742 S1026-00833 V03877 ELECTRICAL EQUIP NUMBER: D00875 D00877 WIRING DIAGRAM REF: 314117		2
- 277	M39029-11-145	.CONTACT- POST SERVICE BULLETIN: 31-0100 31-0100R1 34-0100R2		2
- 550	286T2002-310	WIRE BUNDLE ASSY- POST ALERT SB: 34A0332		RF
- 565	BCREFA2171	.CONNECTOR- OVERLENGTH PART NUMBER: BACC66K33C54AA01 ELECTRICAL EQUIP NUMBER: D00881 D00883 WIRING DIAGRAM REF: 314112 POST ALERT SB: 34A0332		2
- 572	289T1127-13101	.TAPE-IDENT PLACARD CONTENT: D00881 M/W M10181 POST ALERT SB: 34A0332		1
- 574	289T1127-13102	.TAPE-IDENT PLACARD CONTENT: D00883 M/W M10182 POST ALERT SB: 34A0332		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				


— ITEM NOT ILLUSTRATED

HXL

31-41-53-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-53
 FIG. 01
 PAGE 5
 APR 22/08

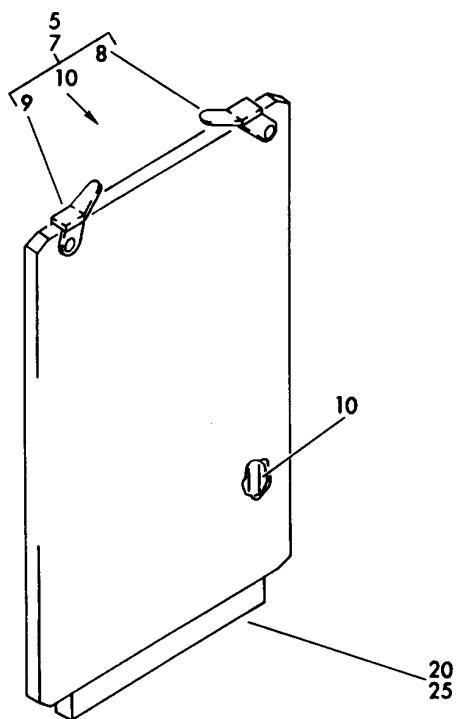

W 31415305 REV 177

Ⓐ

CARD FILE AND BOX INSTL-R FWD EQPT CTR (P51) (ENGINE INDICATION AND CREW ALERTING SYS ONLY)

FIGURE 5

31-41-53-05

HXL
DEC 22/06

31-41-53-05
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5			CARD FILE AND BOX INSTL-R FWD EQPT CTR (P51) (ENGINE INDICATION AND CREW ALERTING SYS ONLY)		
- 1	284T0049-13		CARD FILE AND BOX INSTL- EQPT CTR P51 (EICAS ONLY) POSITION DATA: R FWD VARIABLE DRAWING REF: 284T0049-5235 FOR NHA/OTHER SYS DET SEE: 24-00-58-01W		RF
5	285N0432-1		.PRINTED WIRING ASSY-EICAS SIGN CONSOLIDATION SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: M10727 COMPONENT MAINT MANUAL REF: 31-41-16 OPTIONAL PART: 285N0432-8 V89954 FUNCTIONAL REFERENCE: PLACARDS AND MARKINGS FOR DETAILS SEE 11-36-16-10		1
5	285N0432-8		.PRINTED WIRING ASSY-EICAS SIGN CONSOLIDATION SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: M10727 COMPONENT MAINT MANUAL REF: 31-41-16 OPTIONAL PART: 285N0432-1 V89954 FUNCTIONAL REFERENCE: PLACARDS AND MARKINGS FOR DETAILS SEE 11-36-16-10		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

31-41-53-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-53
FIG. 05
PAGE 1
DEC 22/07

BOEING
767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
5					
5	285N0432-9		.PRINTED CIRCUIT ASSY-EICAS SIGN CONSOLIDATION SUPPLIER CODE: V89954 ELECTRICAL EQUIP NUMBER: M10727 COMPONENT MAINT MANUAL REF: 31-41-16 FUNCTIONAL REFERENCE: PLACARDS AND MARKINGS FOR DETAILS SEE 11-36-16-10		1
8	71-2RA		..EJECTOR-CARD SUPPLIER CODE: V18915		1
9	71-2LA		..EJECTOR-CARD SUPPLIER CODE: V18915		1
10	HS1-3182-8		..CIRCUIT-ARINC 429 STATIC SENSITIVE PART SUPPLIER CODE: V34371		1
- 15	286T0045-101		WIRE BUNDLE ASSY-EICAS SIGN CONSOLIDATION		RF
20	300052-001		.CONNECTOR- SUPPLIER CODE: V0D9V3 SPECIFICATION NUMBER: BACC65L66 OPTIONAL PART: 200620-01 V16512 300052-001 V03877 192-366-0010 V26742 S1009-00833 V03877 ELECTRICAL EQUIP NUMBER: D02261 WIRING DIAGRAM REF: 314135		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED



HXL

31-41-53-05

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-53
 FIG. 05
 PAGE 2
 DEC 22/07

BOEING
767
PARTS CATALOG (MAINTENANCE)

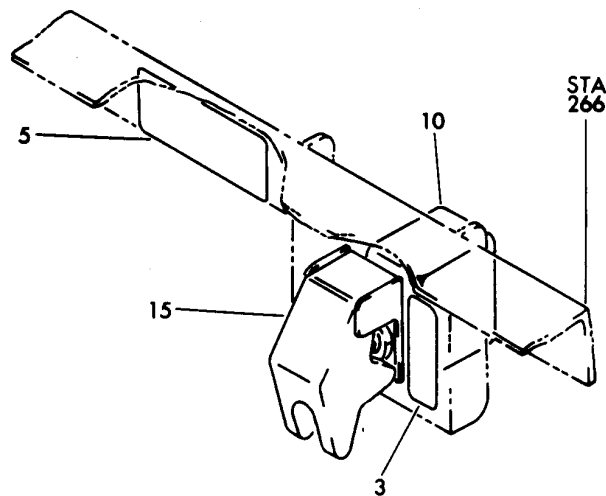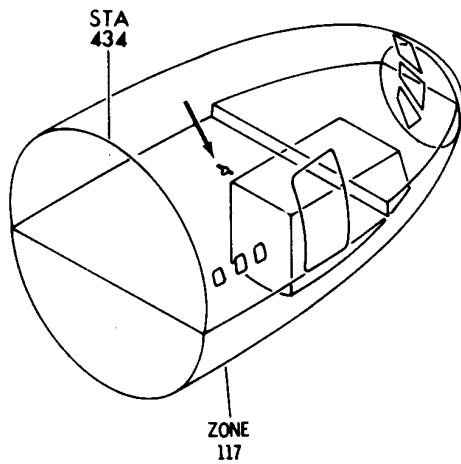

V 31415401 SHY 1 REV 02S

SWITCH INSTL-SECT. 41 ENGINE INDICATING AND CREW ALERTING SYSTEM MAINT ENABLE BYPASS

FIGURE 1

31-41-54-01

HXL
DEC 22/06

31-41-54-01
PAGE 0



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			SWITCH INSTL-SECT. 41 ENGINE INDICATING AND CREW ALERTING SYSTEM MAINT ENABLE BYPASS		
- 1	284T0919-5		SWITCH INSTL-ENGINE INDICATING AND CREW ALERTING SYSTEM MAINT ENABLE BYPASS POSITION DATA: SECT. 41 FOR NHA SEE: 24-00-58-01B		RF
3	BAC27TEX3095		.DECAL- PLACARD CONTENT: BYPASS/NORMAL		1
5	BAC27TEX2962		.DECAL- PLACARD CONTENT: S612 EICAS MAINT ENABLE BYPASS		1
10	1TL187-3		.SWITCH- SUPPLIER CODE: V91929 ELECTRICAL EQUIP NUMBER: S00612		1
15	405-112		.GUARD-SWITCH SUPPLIER CODE: V33463		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

31-41-54-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

31-41-54
FIG. 01
PAGE 1
DEC 22/06