


GROUND PROXIMITY WARNING SYSTEM

BOEING
767
PARTS CATALOG (MAINTENANCE)

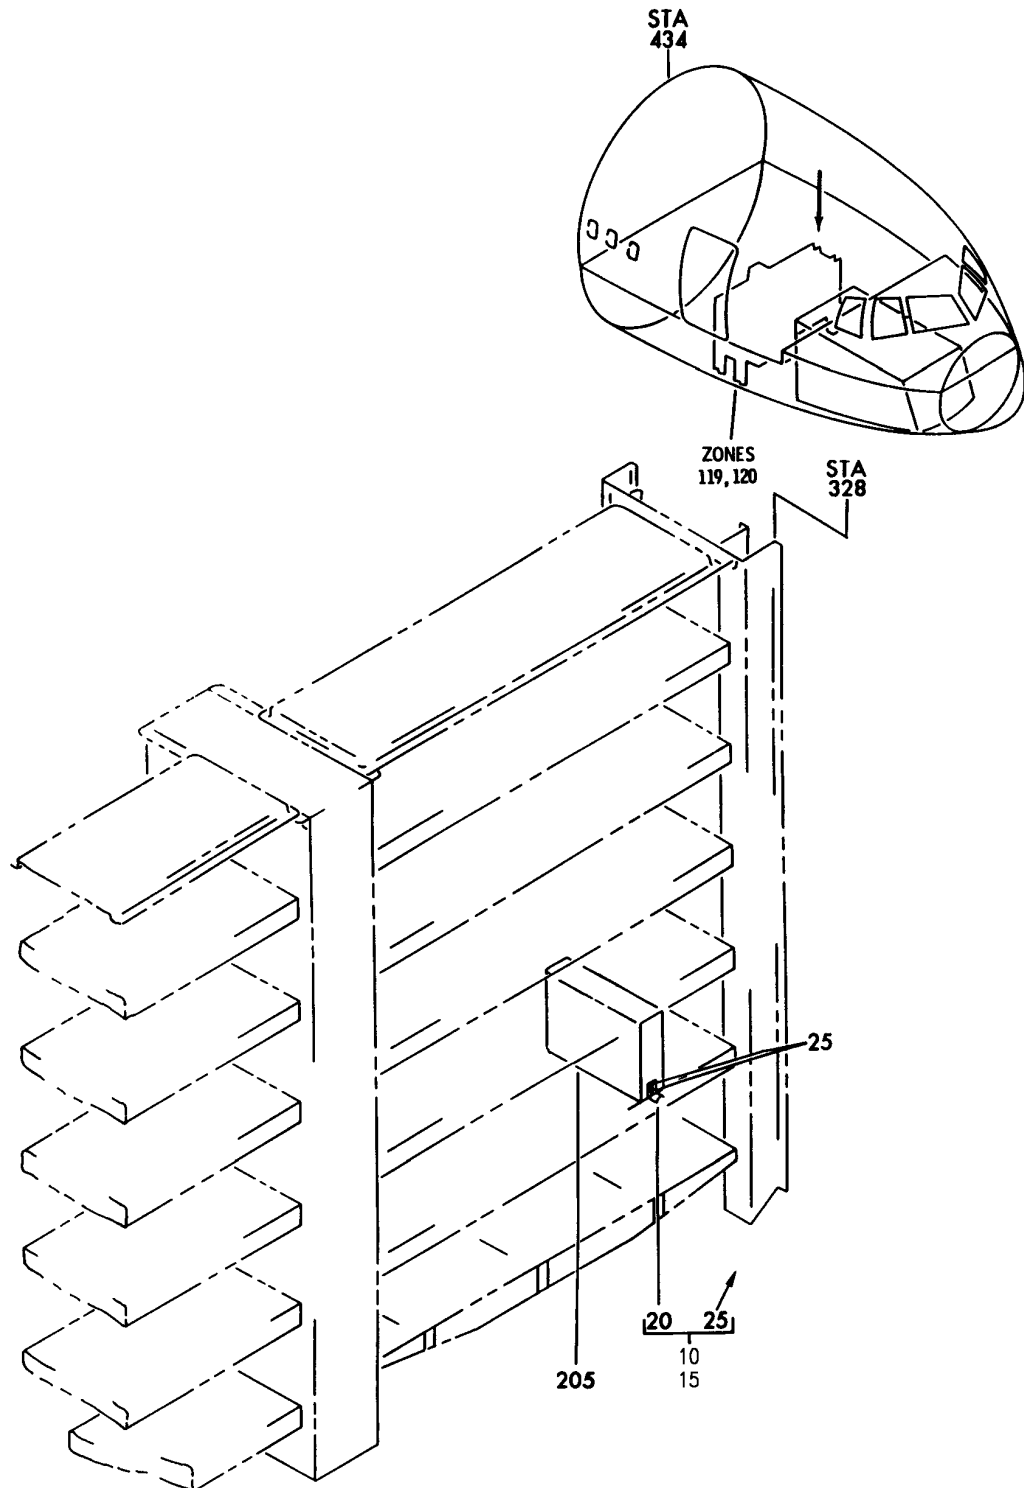

V 34460102 REV 326

EQUIPMENT INSTL-EQPT CTR E1/E2 RACK (FLIGHT MANAGEMENT COMPUTER ONLY)

FIGURE 2

34-46-01-02

HXL
APR 22/08

34-46-01-02
PAGE 0

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			EQUIPMENT INSTL-EQPT CTR E1/E2 RACK (FLIGHT MANAGEMENT COMPUTER ONLY)		
- 1	284T0400-618		EQUIPMENT INSTL-ELECT. EQPT CTR E1/E2 RACK (FLIGHT MANAGEMENT COMPUTER ONLY) VARIABLE DRAWING REF: 284T0400-5284 FOR NHA/OTHER SYS DET SEE: 24-00-58-01J	155162	RF
- 2	284T0400-630		EQUIPMENT INSTL-ELECT. EQPT CTR E1/E2 RACK (FLIGHT MANAGEMENT COMPUTER ONLY) VARIABLE DRAWING REF: 284T0400-5349 284T0400-5357 FOR NHA/OTHER SYS DET SEE: 24-00-58-01J	163999	RF
10	965-0648-006		.COMPUTER ASSY-GND PROXIMITY WARNING SUPPLIER CODE: V97896 SPECIFICATION NUMBER: S220T102-207 ELECTRICAL EQUIP NUMBER: M00147 COMPONENT MAINT MANUAL REF: 34-45-25 POST SERVICE BULLETIN: 965-0648-003-34-3 V55820 POST SERVICE LETTER: 34-72 PRE AIRLINE MOD: MT0-340961 VSAS		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

34-46-01-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-01
 FIG. 02
 PAGE 1
 DEC 22/07



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2					
10	965-0648-007		.COMPUTER ASSY-GND PROXIMITY WARNING SUPPLIER CODE: V97896 SPECIFICATION NUMBER: S220T102-208 ELECTRICAL EQUIP NUMBER: M00147 COMPONENT MAINT MANUAL REF: 34-45-34 POST SERVICE BULLETIN: 965-0648-004-34-10 V55820 POST SERVICE LETTER: 34-72 PRE AIRLINE MOD: MT0-340961 VSAS		1
10	BCREF19315		.COMPUTER ASSY-GND PROXIMITY WARNING SUPPLIER CODE: V97896 OVERLENGTH PART NUMBER: 965-0976-020-210-210 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MT0-340961 HONEYWELL STC NO. ST00417SE ELECTRICAL EQUIP NUMBER: M00147 POST AIRLINE MOD: MT0-340961 VSAS		1
20	NAS622CT2		..HOOK- USED ON: 965-0577-001 965-0577-002 965-0648-001 965-0648-002 965-0648-004		1
20	405-0255-001		..HOOK- SUPPLIER CODE: V97896 ATTACHING PARTS		1
25	MS24693C27		..SCREW -----*-----		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

34-46-01-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-01
FIG. 02
PAGE 2
DEC 22/07

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2				
- 200	286T0109-120	WIRE BUNDLE ASSY-(GROUND PROXIMITY WARNING SYSTEM ONLY) PRE AIRLINE MOD: MTO-340961 VSAS		R F
- 200	DA400972	WIRE BUNDLE ASSY-(GROUND PROXIMITY WARNING SYSTEM ONLY) SUPPLIER CODE: V97896 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 POST AIRLINE MOD: MTO-340961 VSAS		R F
205	BKA11C08AA01	.CONNECTOR- SUPPLIER CODE: V71468 SPECIFICATION NUMBER: BCREF9338 OPTIONAL PART: NIC66F11C08AA01 V00779 OVERLENGTH PART NUMBER: BACC66F11C08AA01 ELECTRICAL EQUIP NUMBER: D00435 WIRING DIAGRAM REF: 344611 PRE AIRLINE MOD: MTO-340961 VSAS		1
205	NSXN1P101S00	.CONNECTOR- SUPPLIER CODE: V97896 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 ELECTRICAL EQUIP NUMBER: D00435 POST AIRLINE MOD: MTO-340961 VSAS		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED


HXL

34-46-01-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-01
 FIG. 02
 PAGE 3
 DEC 22/07

BOEING
767
PARTS CATALOG (MAINTENANCE)

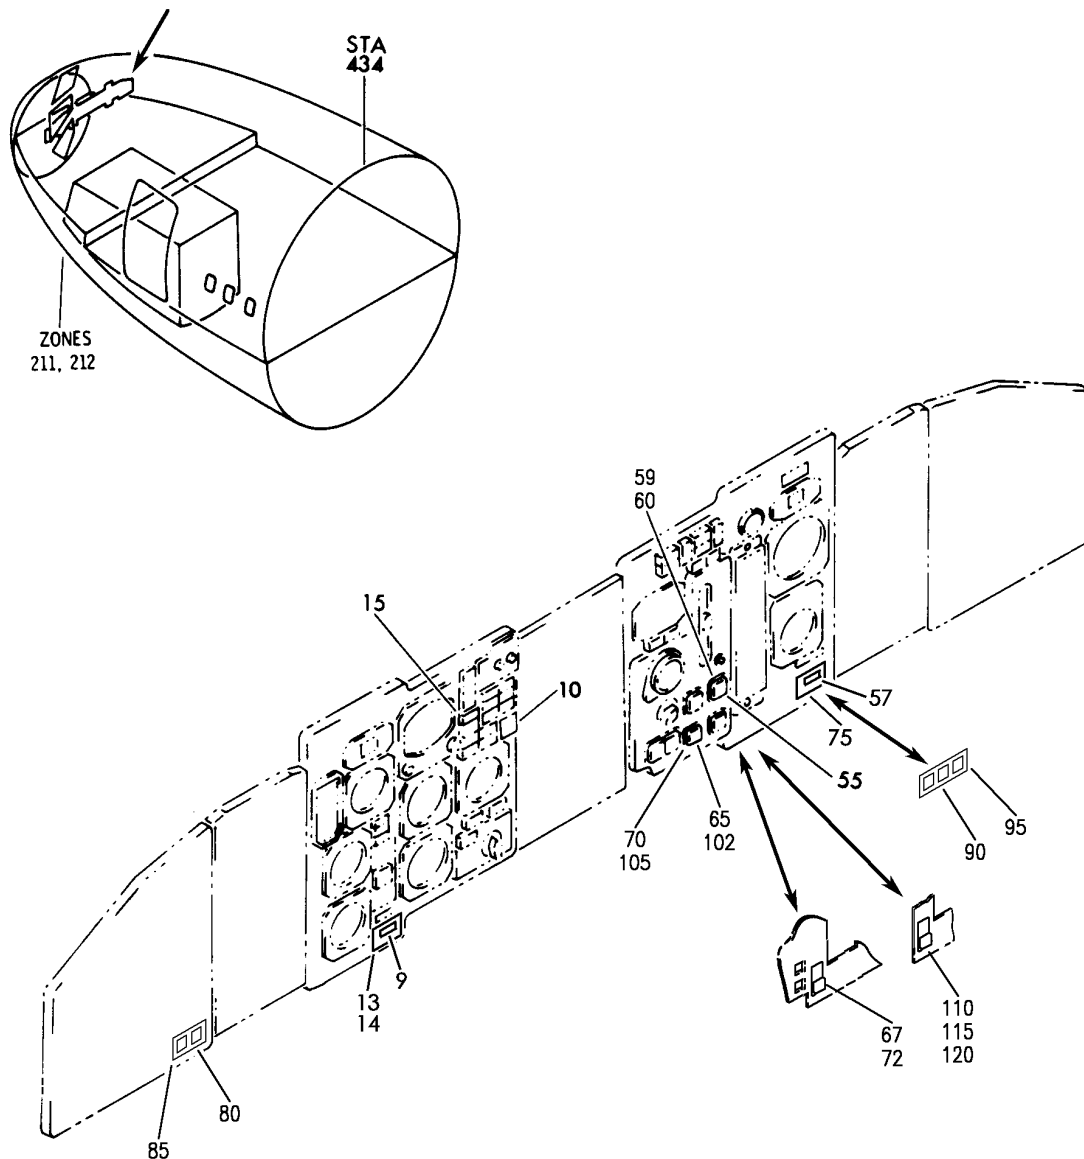

V 34465302 REV 320

PANEL INSTL-PILOTS MAIN (GROUND PROXIMITY WARNING SYSTEM ONLY)

FIGURE 2

34-46-53-02

HXL
DEC 22/07

34-46-53-02
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2			PANEL INSTL-PILOTS MAIN (GROUND PROXIMITY WARNING SYSTEM ONLY)		
- 1	233T2100-1		PANEL INSTL-PILOTS MAIN (GROUND PROXIMITY WARNING SYSTEM ONLY) VARIABLE DRAWING REF: 233T2100-5048 FOR NHA/OTHER SYS DET SEE: 25-10-00-03		RF
- 7	233T2222-58		.PANEL ASSY-2 CREW CONT STATIC SENSITIVE PART P1-3		RF
10	BCREFA0531		..SWITCH ASSY-LIGHTED PUSH BUTTON IND ON/VALVE SUPPLIER CODE: V81590 OVERLENGTH PART NUMBER: 433-673-1004-4070 SPECIFICATION NUMBER: S231T290-4070 ELECTRICAL EQUIP NUMBER: S00016 OPTIONAL PART: S231T290-5070 V96182 FOR DETAILS SEE: 33-13-75-35		1
10	851-30768-2070		..SWITCH ASSY-LIGHTED PUSH BUTTON IND GND/PROX G/S INHB SUPPLIER CODE: V96182 SPECIFICATION NUMBER: S231T290-2070 ELECTRICAL EQUIP NUMBER: S00016 FOR DETAILS SEE: 33-13-75-05		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

34-46-53-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-53
FIG. 02
PAGE 1
DEC 22/07



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2					
10	851-30768-3070		..SWITCH ASSY-LIGHTED PUSH BUTTON IND GND/PROX G/S INHB SUPPLIER CODE: V96182 SPECIFICATION NUMBER: S231T290-3070 ELECTRICAL EQUIP NUMBER: S00016 FOR DETAILS SEE: 33-13-75-25		1
10	S231T290-5070		..SWITCH ASSY-LIGHTED PUSH BUTTON IND ON/VALVE SUPPLIER CODE: V96182 ELECTRICAL EQUIP NUMBER: S00016 OPTIONAL PART: BCREFA0531 V81590		1
10	4336731004-4270		..SWITCH ASSY-LIGHTED PUSH BUTTON IND GND/PROX G/S INHB SUPPLIER CODE: V81590 SPECIFICATION NUMBER: S231T290-4270 FOR DETAILS SEE: 33-13-75-31C		1
15	BCREF9430		..LIGHT ASSY-WINDSHEAR IND SUPPLIER CODE: V81590 OVERLENGTH PART NUMBER: 434-674-1031-2308 SPECIFICATION NUMBER: S231T300-2308 ELECTRICAL EQUIP NUMBER: L00890 FOR DETAILS SEE: 33-16-02-03		1
- 47	233T2223-1120		.PANEL ASSY-2 CREW CONT P3-1 POST ALERT SB: 33A0087		RF
- 54	233T2223-120		.PANEL ASSY-2 CREW CONT P3-1 PRE ALERT SB: 33A0087		RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

34-46-53-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-53
FIG. 02
PAGE 2
AUG 22/09



767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2					
65	433-100-002		.. GUARD-SWITCH SUPPLIER CODE: V81590 SPECIFICATION NUMBER: S231T290-821		1
70	BCREF7682		.. SWITCH ASSY-LIGHTED PUSH BUTTON IND OVRD SUPPLIER CODE: V81590 OVERLENGTH PART NUMBER: 433-673-1001-1057 SPECIFICATION NUMBER: S231T290-1057 ELECTRICAL EQUIP NUMBER: S00603 FOR DETAILS SEE: 33-13-75-14		1
70	851-30768-3057		.. SWITCH ASSY-LIGHTED PUSH BUTTON IND OVRD SUPPLIER CODE: V96182 SPECIFICATION NUMBER: S231T290-3057 ELECTRICAL EQUIP NUMBER: S00603 OPTIONAL PART: S231T290-5057 FOR DETAILS SEE: 33-13-75-24		1
70	BCREFA0524		.. SWITCH ASSY-LIGHTED PUSH BUTTON IND OVRD SUPPLIER CODE: V81590 OVERLENGTH PART NUMBER: 433-673-1004-4057 SPECIFICATION NUMBER: S231T290-4057 ELECTRICAL EQUIP NUMBER: S00603 OPTIONAL PART: S231T290-5057 FOR DETAILS SEE: 33-13-75-31		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

34-46-53-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-53
FIG. 02
PAGE 3
DEC 22/07

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2					
70	851-30768-2057		..SWITCH ASSY-LIGHTED PUSH BUTTON IND OVRD SUPPLIER CODE: V96182 SPECIFICATION NUMBER: S231T290-2057 ELECTRICAL EQUIP NUMBER: S00603 FOR DETAILS SEE: 33-13-75-04		1
70	S231T290-5057		..SWITCH ASSY-LIGHTED PUSH BUTTON IND OVRD ELECTRICAL EQUIP NUMBER: S00603 OPTIONAL PART: BCREFA0524 V81590		1
70	4336731004-4257		..SWITCH ASSY-LIGHTED PUSH BUTTON IND OVRD SUPPLIER CODE: V81590 SPECIFICATION NUMBER: S231T290-4257 MISCELLANEOUS DATA: WHEN REPLACING THE PUSHBUTTON SWITCH ASSY OR THE MASTER MODULE WITHIN, VERIFY THAT A CONFIG D MASTER MODULE P/N 13206-001 IS INSTALLED IN LIEU OF ANY EARLIER CONFIGURATION MASTER MODULES ELECTRICAL EQUIP NUMBER: S00603 COMPONENT MAINT MANUAL REF: 33-10-22 FOR DETAILS SEE: 33-13-75-31C		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

34-46-53-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-53
 FIG. 02
 PAGE 4
 AUG 22/09



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
2					
80	24013-001	..	PANEL-SWITCH CAPTAIN'S EGPWS SUPPLIER CODE: V81590 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 ELECTRICAL EQUIP NUMBER: M09053 POST AIRLINE MOD: MTO-340961 VSAS		1
85	5544-6015-02	..	SEAL-CAPTAIN'S PNL SUPPLIER CODE: V81590 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 POST AIRLINE MOD: MTO-340961 VSAS		1
90	24014-001	..	PANEL-SWITCH F/O'S EGPWS SUPPLIER CODE: V81590 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 ELECTRICAL EQUIP NUMBER: M09054 POST AIRLINE MOD: MTO-340961 VSAS		1
95	5544-6015-02	..	SEAL-F/O'S PNL SUPPLIER CODE: V81590 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 POST AIRLINE MOD: MTO-340961 VSAS		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HXL

34-46-53-02

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-53
FIG. 02
PAGE 5
DEC 22/07

BOEING
767
PARTS CATALOG (MAINTENANCE)

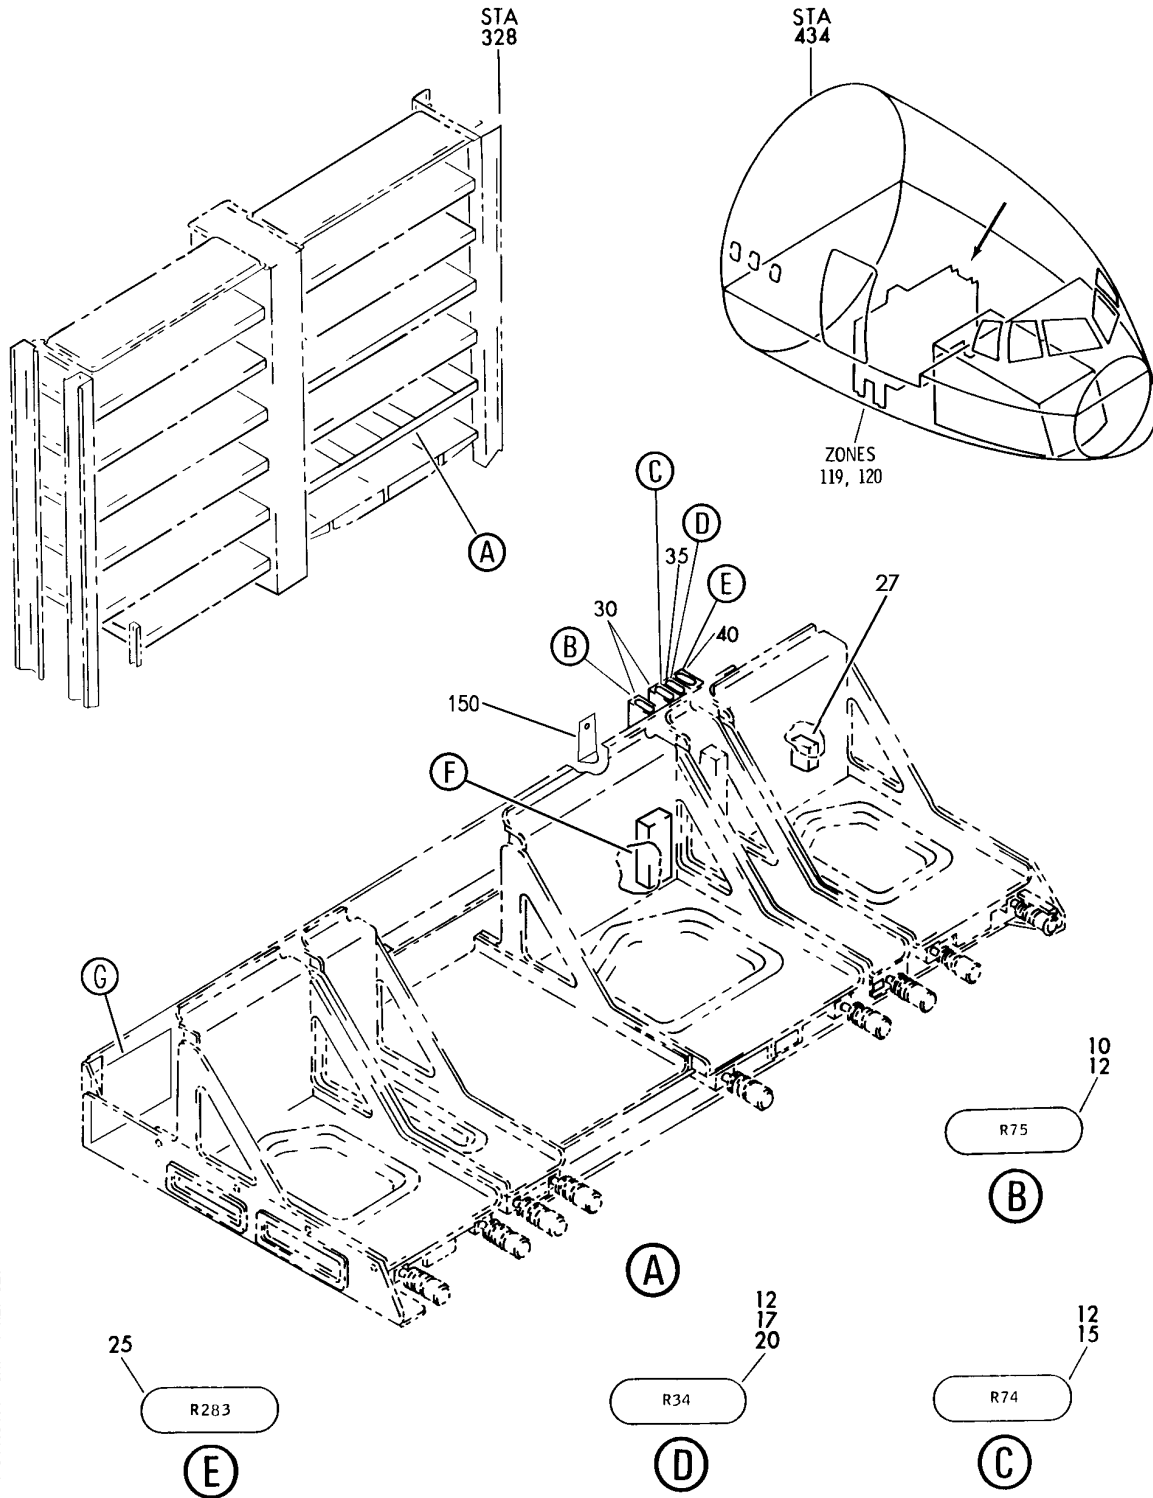

V 34465401 SHT 1 REV 320



SHelf ASSY-ELECT. EQPT CTR E1-5 (GROUND PROXIMITY WARNING SYSTEM ONLY)
FIGURE 1 (SHEET 1)

HXL
DEC 22/07

34-46-54-01

34-46-54-01
PAGE 0

BOEING
767
PARTS CATALOG (MAINTENANCE)

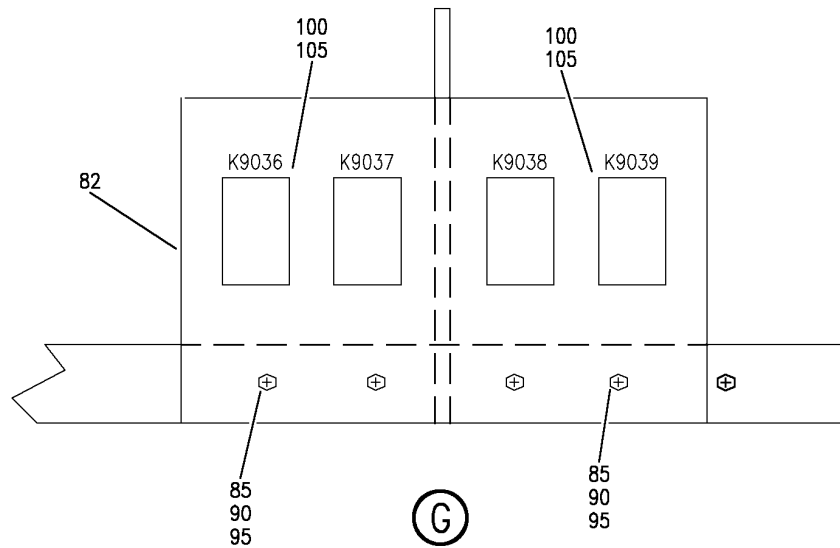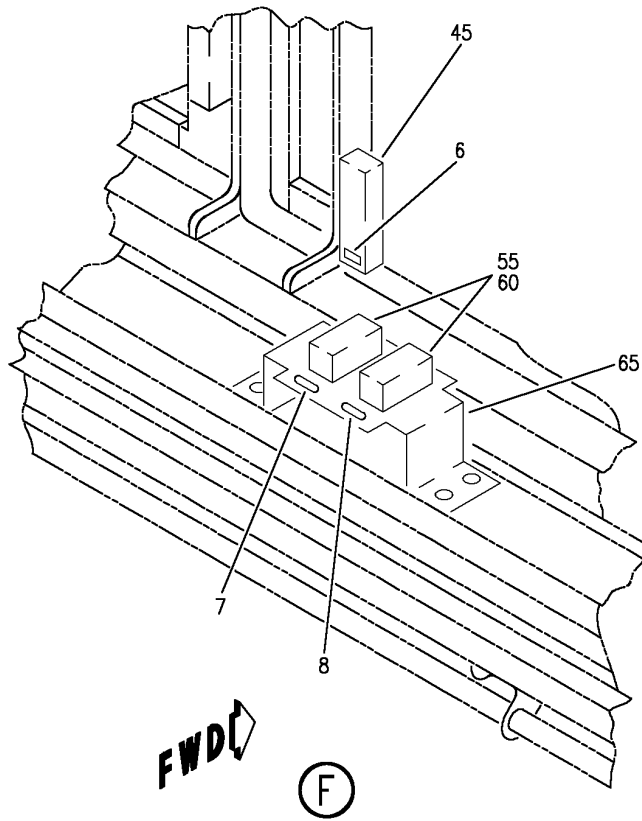

V 34465401 SHT 2 REV 254

SHELF ASSY-ELECT. EQPT CTR E1-5 (GROUND PROXIMITY WARNING SYSTEM ONLY)
FIGURE 1 (SHEET 2)

HXL
DEC 22/06

34-46-54-01

34-46-54-01
PAGE 0A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			SHELF ASSY-ELECT. EQPT CTR E1-5 (GROUND PROXIMITY WARNING SYSTEM ONLY)		
- 3	284T0115-58		SHELF ASSY-ELECT. EQPT CTR E1-5 (GROUND PROXIMITY WARNING SYSTEM ONLY) FOR NHA/OTHER SYS DET SEE: 53-11-64-01B		RF
12	BAC27TEX3281		.DECALSET-INCLUDES DECALS IDENTIFIED ON THE ILLUSTRATION		RF
25	BAC27TEX3644		.DECAL- PLACARD CONTENT: R283		1
30	YHLZD30		.DIODE- SUPPLIER CODE: V09922 ELECTRICAL EQUIP NUMBER: R00074 R00075		2
35	YHLZD30		.DIODE- SUPPLIER CODE: V09922 ELECTRICAL EQUIP NUMBER: R00034		1
40	YHLZD30		.DIODE- SUPPLIER CODE: V09922 ELECTRICAL EQUIP NUMBER: R00283		1
82	DA400988		.BRACKET-RELAY SUPPLIER CODE: V1009B MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 POST AIRLINE MOD: MTO-340961 VSAS		1
85	NAS1801-06-7		ATTACHING PARTS .SCREW- MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961		4
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

34-46-54-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-54
 FIG. 01
 PAGE 1
 DEC 22/07



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
90	AN960-6		. WASHER- MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MT0-340961		4
95	MS20364-632A		. NUT- MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MT0-340961		4
100	W460F1A		-----*----- .. RELAY- SUPPLIER CODE: VF0219 SPECIFICATION NUMBER: BACR13CE2 OPTIONAL PART: 3SAH5-13-4K1 V01526 3SAH1326A2 V01526 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MT0-340961 ELECTRICAL EQUIP NUMBER: K09036 K09037 K09038 K09039		4
105	RSE120027		.. SOCKET- SUPPLIER CODE: V58982 SPECIFICATION NUMBER: BACS16AF1 OPTIONAL PART: 451120-027 V58982 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MT0-340961 ELECTRICAL EQUIP NUMBER: D09127 D09128 D09129 D09130		4
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

34-46-54-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-54
FIG. 01
PAGE 2
DEC 22/07

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 - 110	YHLZD33		..DIODE- SUPPLIER CODE: V09922 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 ELECTRICAL EQUIP NUMBER: R09036 R09037 R09038 R09039 R09040 R09041		6
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED


HXL

34-46-54-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-54
 FIG. 01
 PAGE 3
 DEC 22/07

BOEING
767
PARTS CATALOG (MAINTENANCE)

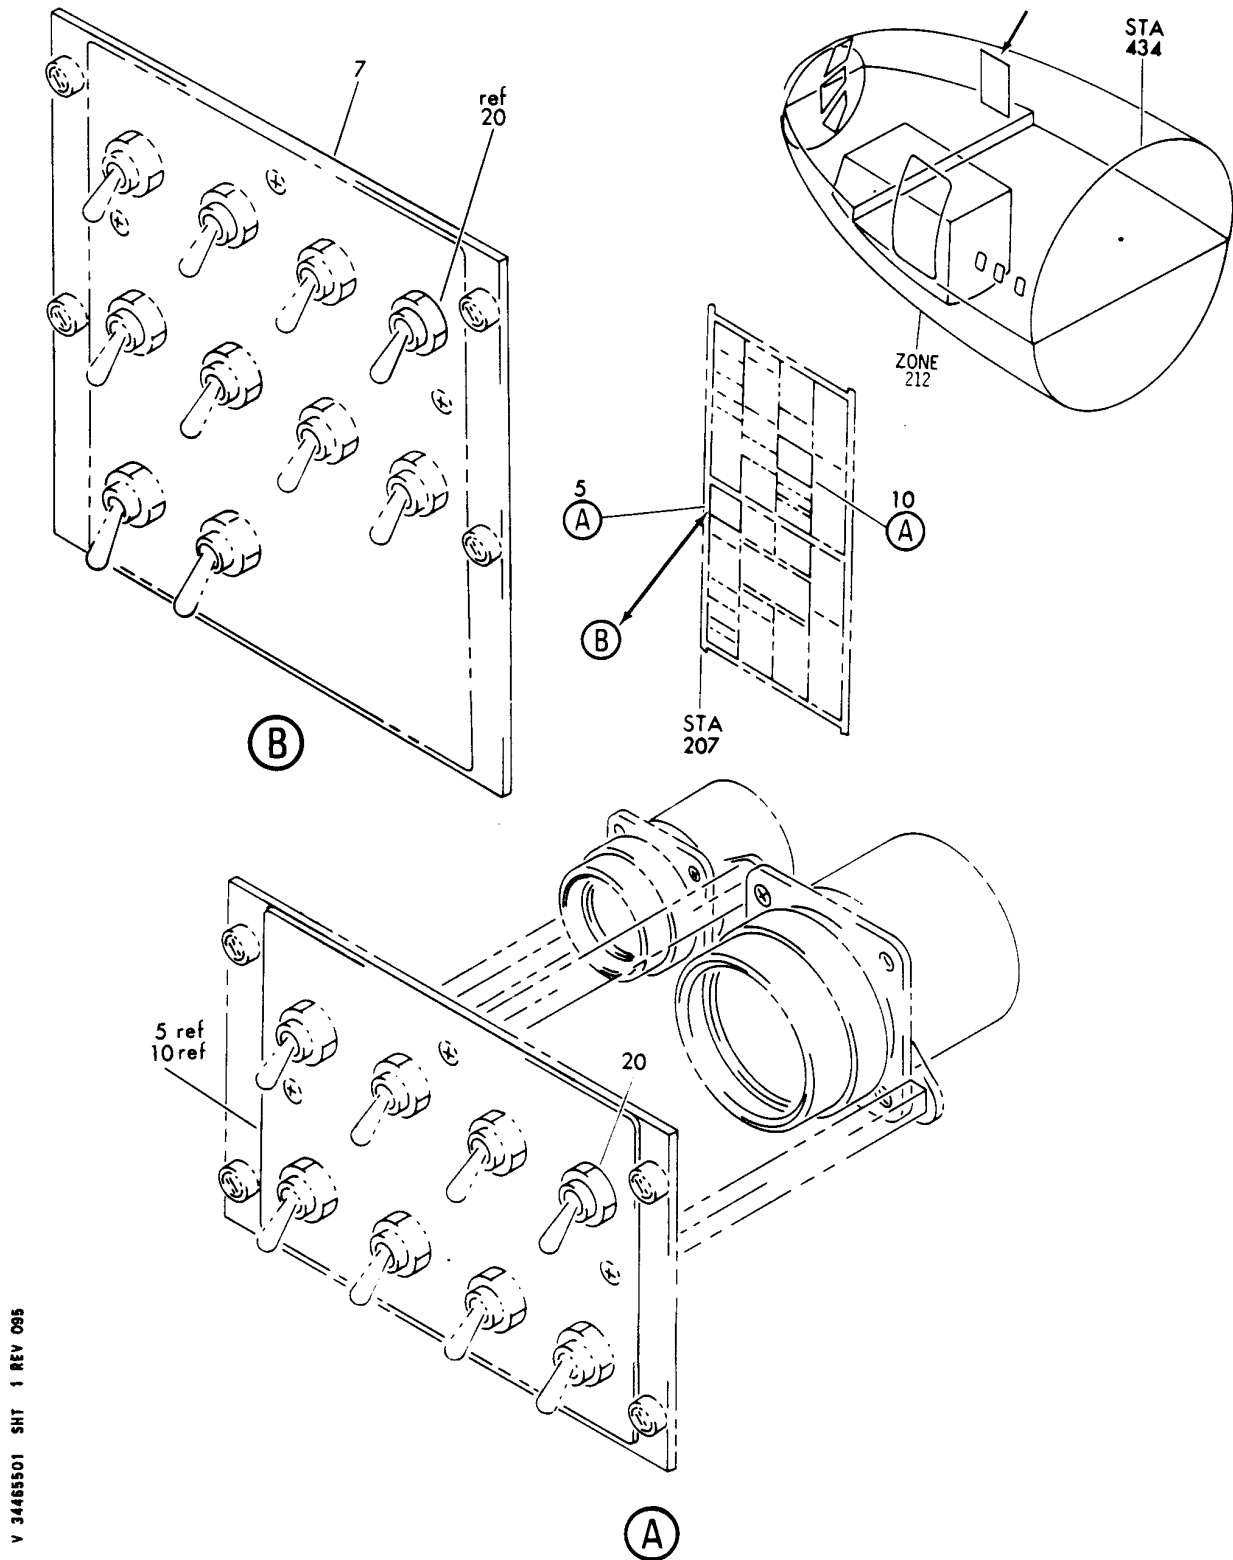

PANEL INSTL-R SIDE (GROUND PROXIMITY WARNING SYSTEM ONLY)

FIGURE 1

34-46-55-01

HXL
DEC 22/06

34-46-55-01
PAGE 0

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

V 34465501 SHY 1 REV 095



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			PANEL INSTL-R SIDE (GROUND PROXIMITY WARNING SYSTEM ONLY)		
- 1	233T4100-1		PANEL INSTL-(GROUND PROXIMITY WARNING SYSTEM ONLY) POSITION DATA: R SIDE VARIABLE DRAWING REF: 233T4100-5048		RF
- 1	233T4100-1		PANEL INSTL-(GROUND PROXIMITY WARNING SYSTEM ONLY) POSITION DATA: R SIDE FOR NHA/OTHER SYS DET SEE: 25-10-00-03		RF
5	233T4239-26		.PANEL ASSY-M10398 MISC TEST SUPPLIER CODE: V89954 COMPONENT MAINT MANUAL REF: 33-16-53		RF
20	68AT22-7		..SWITCH- SUPPLIER CODE: V91929		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HXL

34-46-55-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-55
FIG. 01
PAGE 1
DEC 22/07

BOEING
767
PARTS CATALOG (MAINTENANCE)

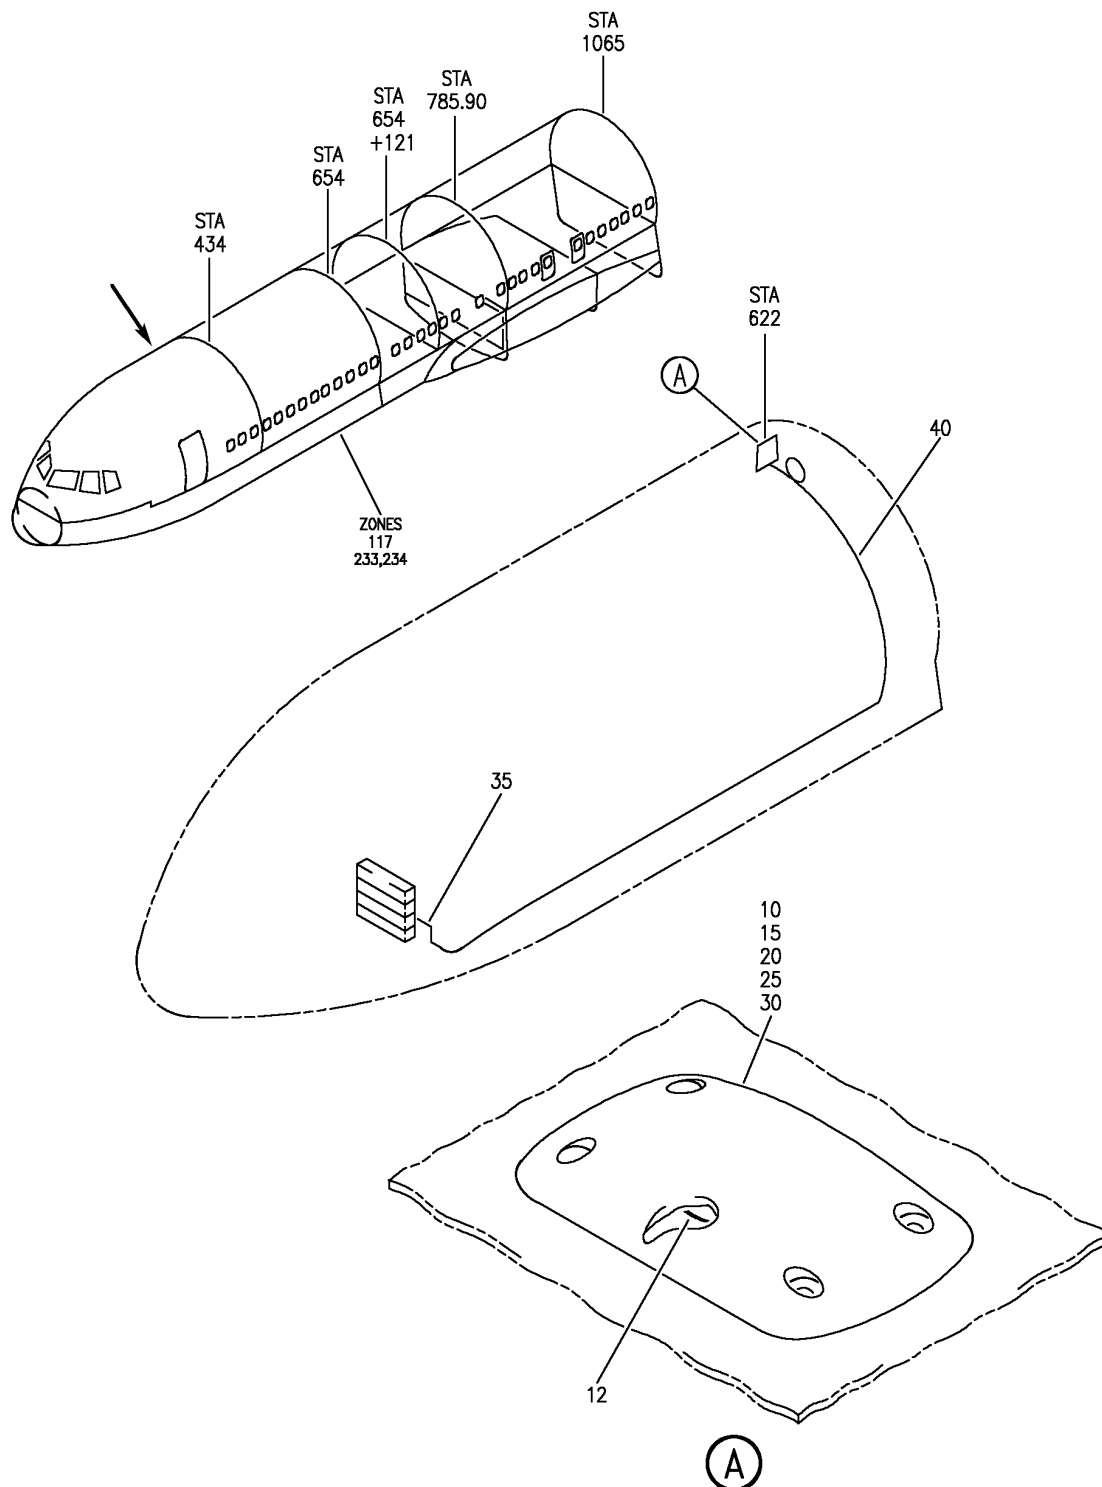

V 34466001 REV 318

ANTENNA INSTL-GPS
FIGURE 1

34-46-60-01

HXL
AUG 22/07

34-46-60-01
PAGE 0



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 1	MT0-340961-1		ANTENNA INSTL-GPS ANTENNA INSTL-GPS SUPPLIER CODE: V1009B POSITION DATA: STA 622 BL 0.0 POST AIRLINE MOD: MT0-340961 VSAS		R F
10	S67-1575-133		.ANTENNA- SUPPLIER CODE: V13691 POSITION DATA: STA 622 BL 0.0 SPECIFICATION NUMBER: S242T104-102 MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MT0-340961 ANTENNA INSTALLATION ACC. TO MT0-530863 ELECTRICAL EQUIP NUMBER: M11248 POST AIRLINE MOD: MT0-340961 VSAS		1
12	MS28775-143		..0 RING		1
15	PM570		.BOOT-EROSION SUPPLIER CODE: V1009B MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MT0-340961 ANTENNA INSTALLATION ACC. TO MT0-530863		1
20	TA71000438		.GASKET- SUPPLIER CODE: V1009B MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MT0-340961 ANTENNA INSTALLATION ACC. TO MT0-530863		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

34-46-60-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-60
FIG. 01
PAGE 1
AUG 22/07



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
25	MS24693C275		.SCREW- MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 ANTENNA INSTALLATION ACC. TO MTO-530863		4
30	TMS165-1		.PLUG-COAX SUPPLIER CODE: V1009B MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 ELECTRICAL EQUIP NUMBER: D09126		1
35	TFS165-2		.SOCKET-COAX SUPPLIER CODE: V1009B MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961 ELECTRICAL EQUIP NUMBER: D9125J		1
40	DA400972W9092		.WIRE BUNDLE ASSY- SUPPLIER CODE: V1009B MISCELLANEOUS DATA: AFTER INSTALLATION OF ENHANCED GPWS REF. MTO-340961		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

34-46-60-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

34-46-60
FIG. 01
PAGE 2
DEC 22/06