



FLIGHT CONTROL ATTACH FITTINGS

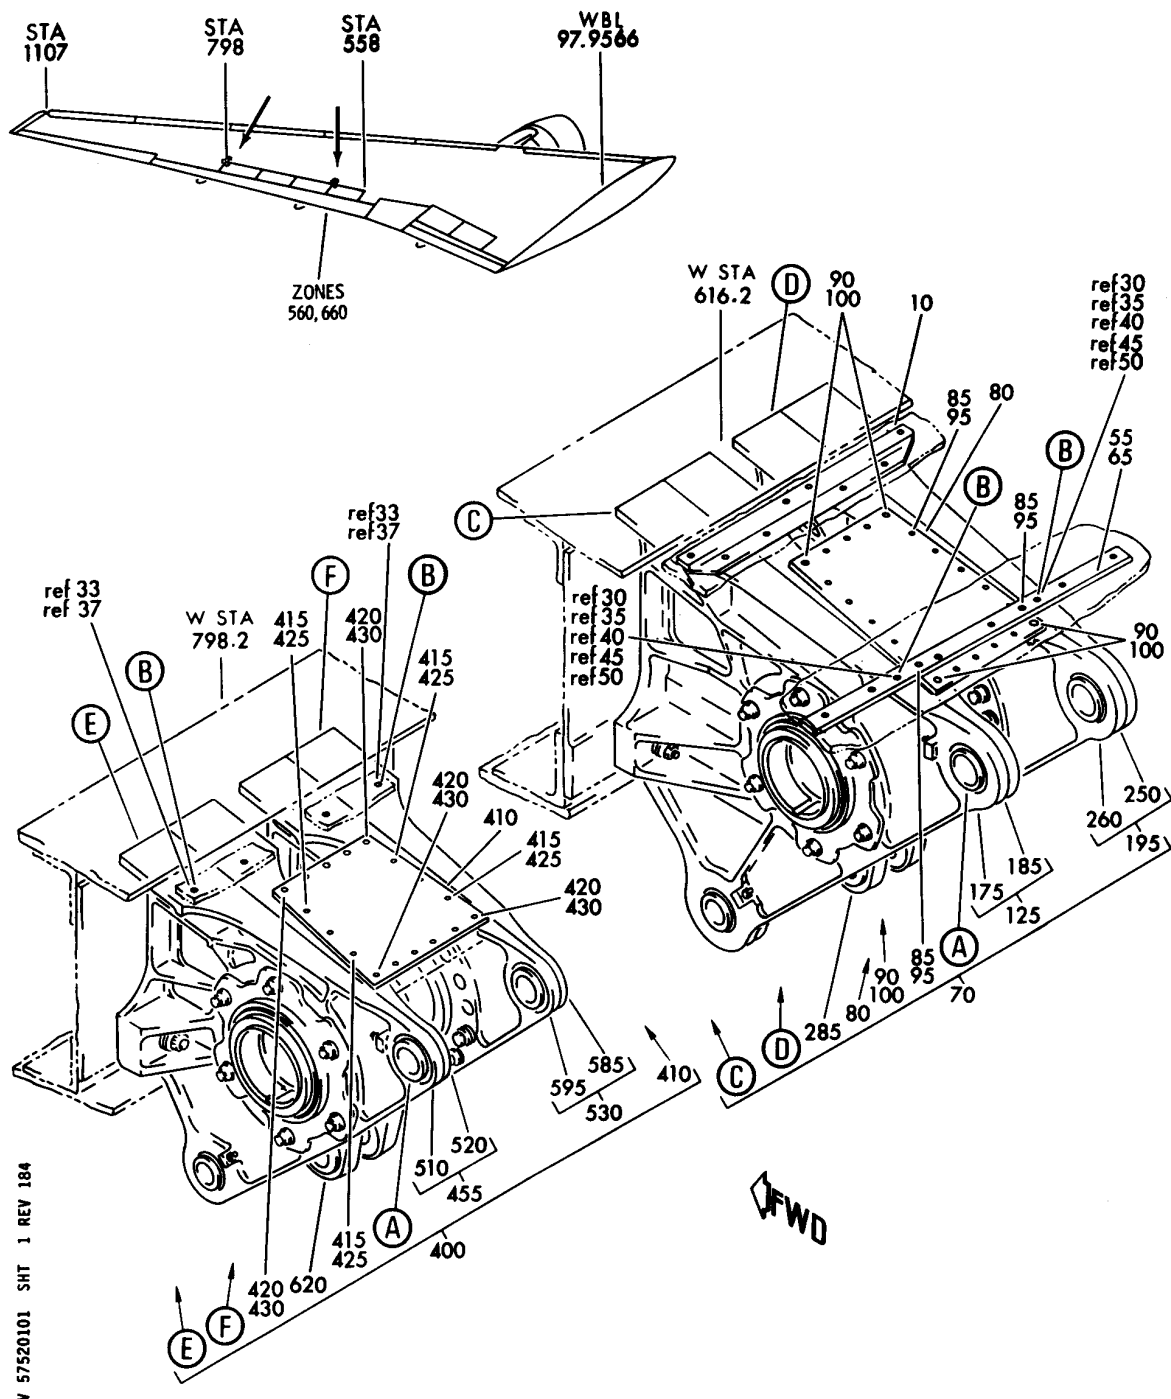

BOEING
767
PARTS CATALOG (MAINTENANCE)

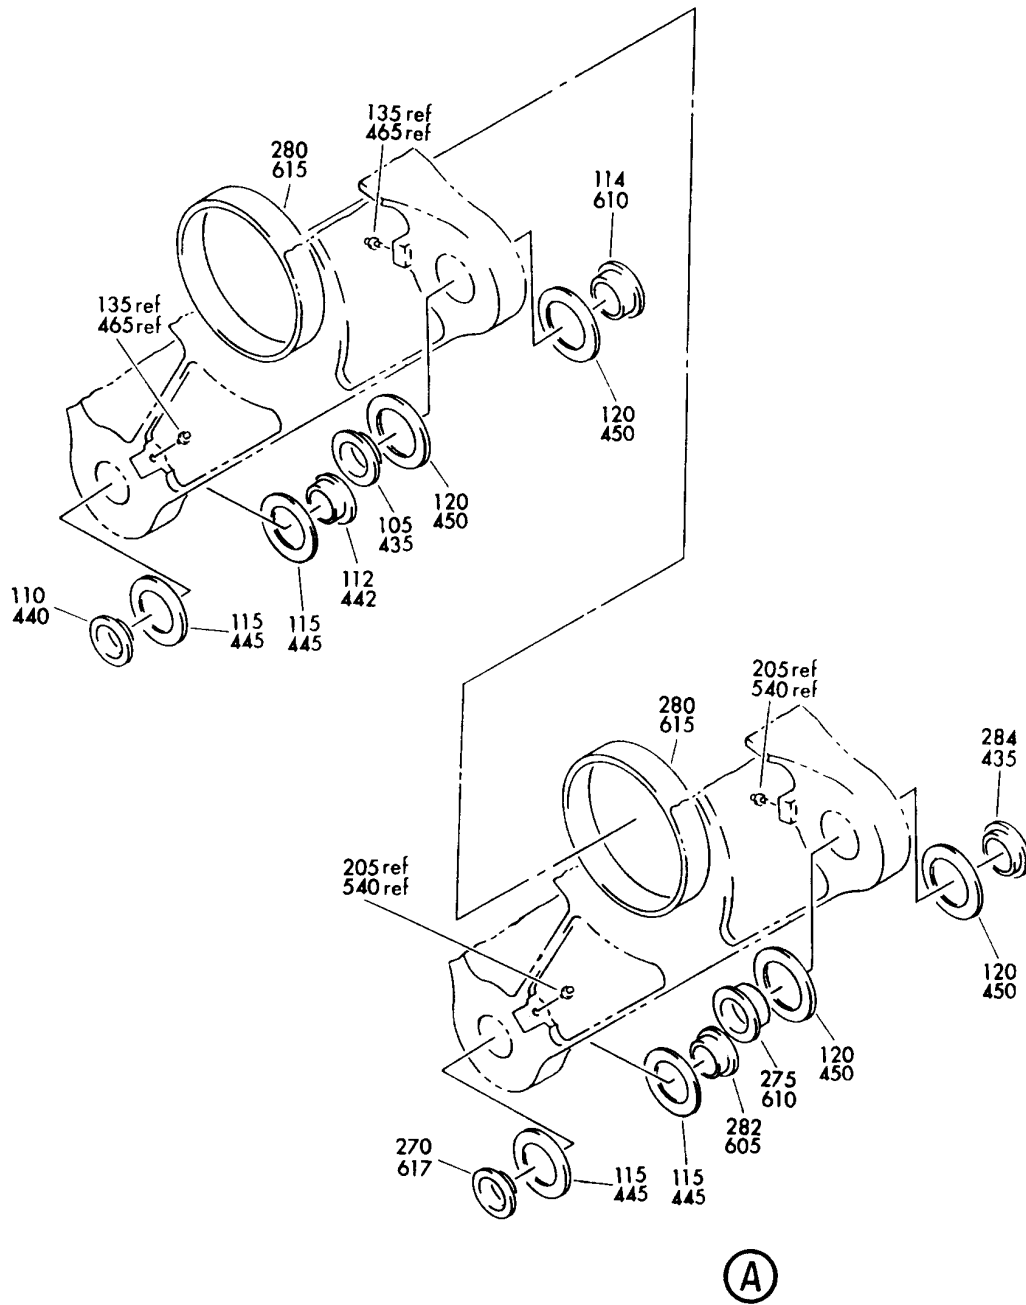

V 57520101 SHT 2 REV 207


RIB INSTL-OUTBD TE FLAP SPRT
FIGURE 1 (SHEET 2)

57-52-01-01

HXL
DEC 22/06

57-52-01-01
PAGE 0A

BOEING
767
PARTS CATALOG (MAINTENANCE)

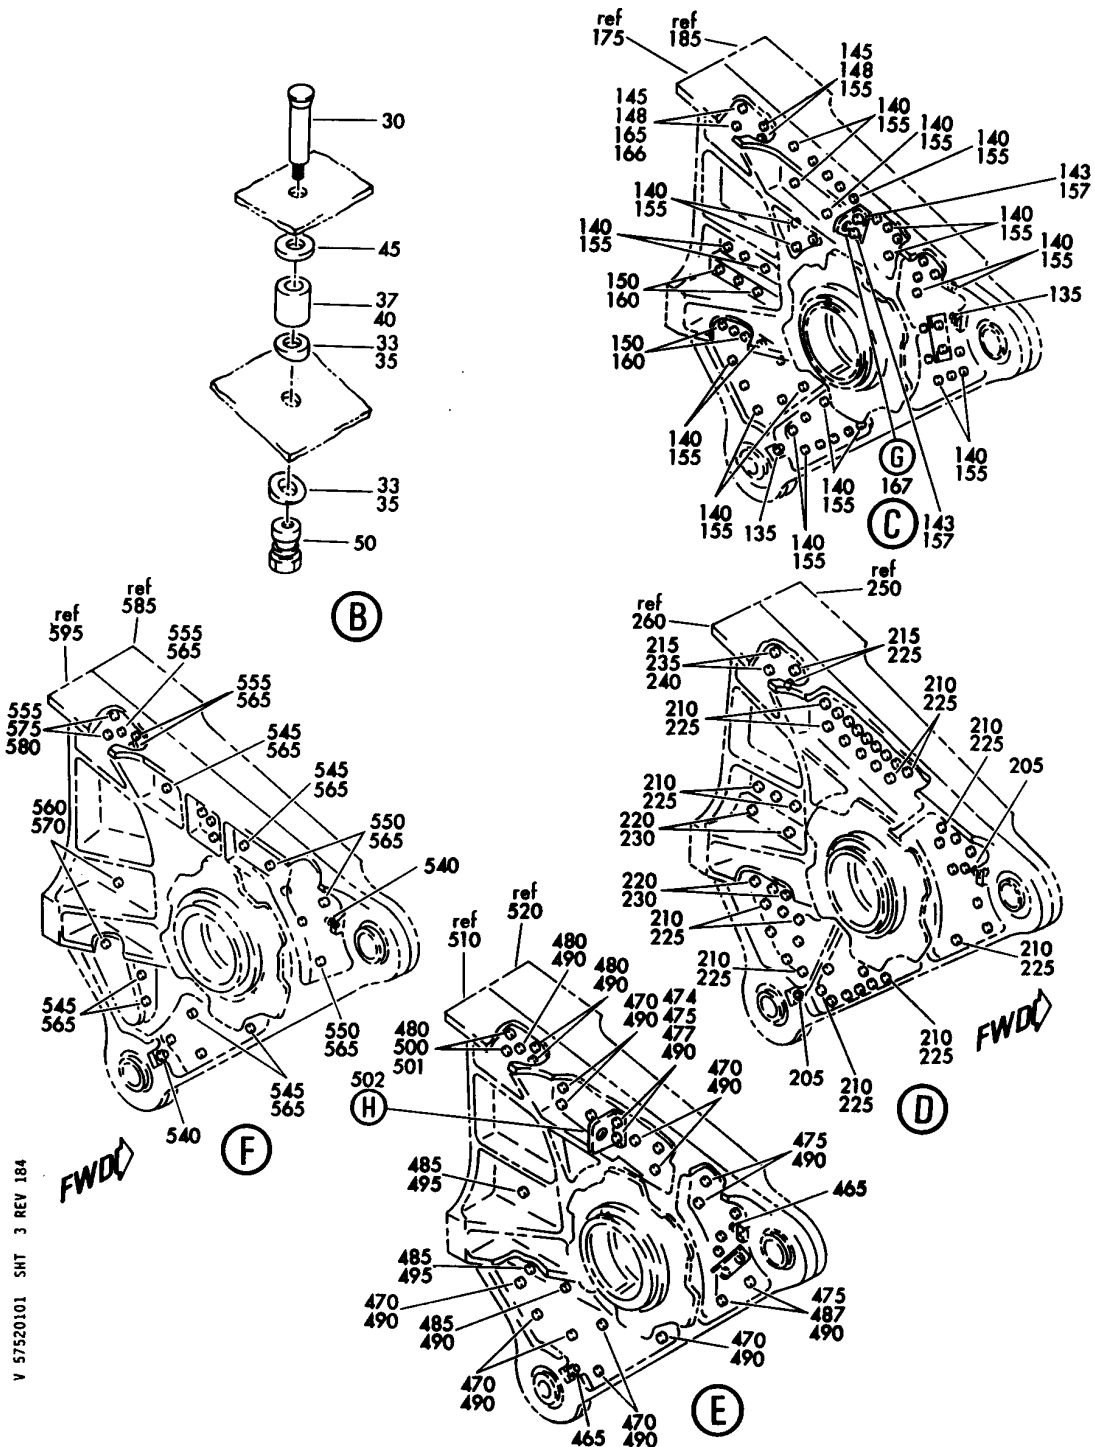

V 57520101 SHT 3 REV 184


RIB INSTL-OUTBD TE FLAP SPRT
FIGURE 1 (SHEET 3)

57-52-01-01


HXL
DEC 22/06

57-52-01-01
PAGE 0B

BOEING
767
PARTS CATALOG (MAINTENANCE)

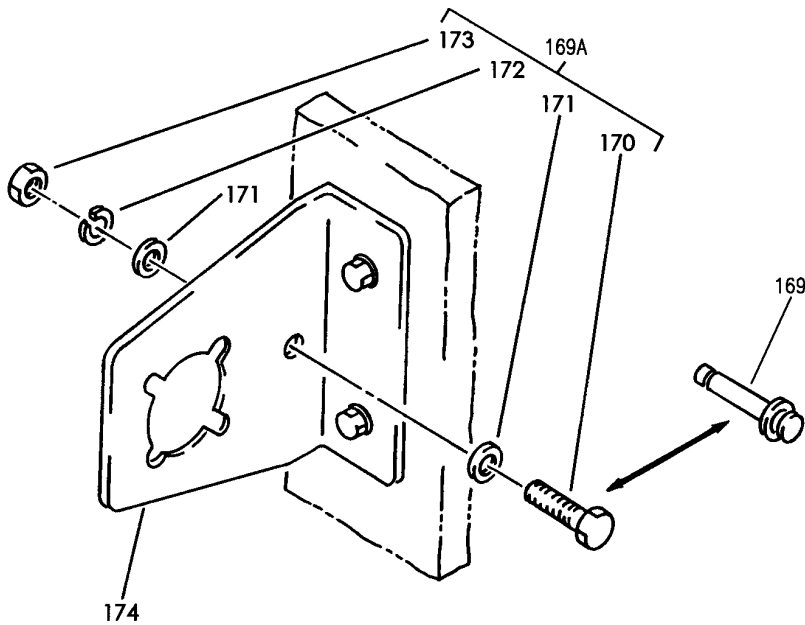

(G)

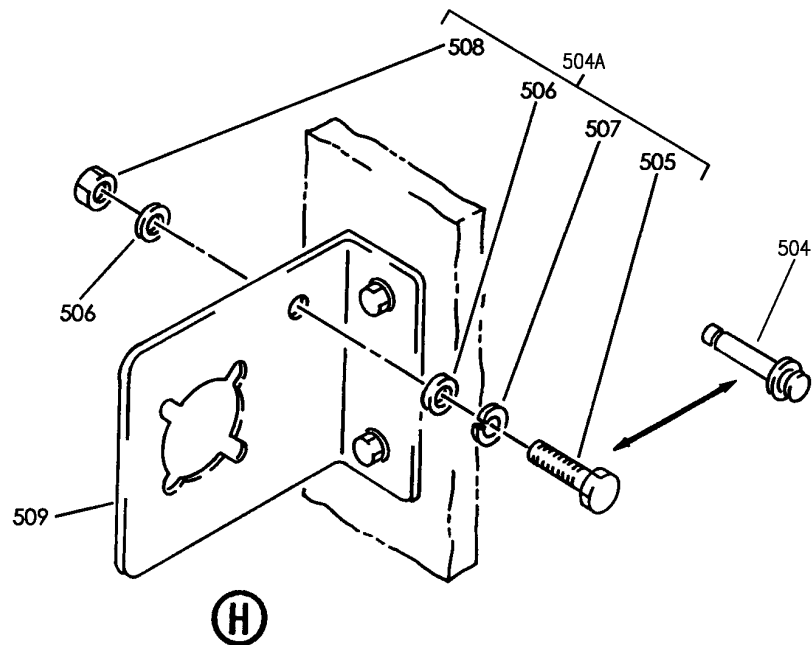

(H)

V 57520101 SHIT 4 REV 309

RIB INSTL-OUTBD TE FLAP SPRT
FIGURE 1 (SHEET 4)

57-52-01-01

HXL
DEC 22/06

57-52-01-01
PAGE 0C

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			RIB INSTL-OUTBD TE FLAP SPRT		
- 1	113T1345-73		RIB INSTL-TE FLAP SPRT POSITION DATA: OUTBD LH VARIABLE DRAWING REF: 113T1345-5013 FOR NHA SEE: 57-11-53-02		RF
- 5	113T1345-74		RIB INSTL-TE FLAP SPRT POSITION DATA: OUTBD RH VARIABLE DRAWING REF: 113T1345-5014 FOR NHA SEE: 57-11-53-02		RF
10	113T1547-1		.SUPPORT ASSY- POSITION DATA: LH SIDE		1
- 15	113T1547-2		.SUPPORT ASSY- POSITION DATA: RH SIDE		1
- 20	L8006K5		ATTACHING PARTS .BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY6K5		4
- 25	HL79-6		.COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M6 OPTIONAL PART: HL79-6 V73197 HL79-6 V92215 66014-6 V56878 HL79-6 V56878 -----*-----		4
30	BACB30MN6K		.BOLT- SIZE DETERMINED ON INSTL.		2
33	BACF3T02D5-5B		.FILLER		8
35	BACF3T03D5-8B		.FILLER		4
37	NAS42DD6-10		.SPACER		4
40	NAS43DD3-44		.SPACER-		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
FIG. 01
PAGE 1
APR 22/08

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
45	AN960-10L		.WASHER		2
50	HL79-6		.COLLAR		2
			SUPPLIER CODE: V5M902		
			SPECIFICATION NUMBER: BACC30M6		
			OPTIONAL PART:		
			HL79-6		
			V73197		
			HL79-6		
			V92215		
			66014-6		
			V56878		
			HL79-6		
			V56878		
55	113T1547-15		.SUPPORT ASSY-		1
			POSITION DATA:		
			LH SIDE		
- 60	113T1547-16		.SUPPORT ASSY-		1
			POSITION DATA:		
			RH SIDE		
70	113T1345-85		.RIB ASSY-		1
			POSITION DATA:		
			STA 616.2 LH SIDE		
- 75	113T1345-86		.RIB ASSY-		1
			POSITION DATA:		
			STA 616.2 RH SIDE		
80	113T1345-8		..SKIN		1
			ATTACHING PARTS		
85	L8006K5		..BOLT		10
			SUPPLIER CODE: V06725		
			SPECIFICATION NUMBER: BACB30MY6K5		
90	L8008K7		..BOLT		4
			SUPPLIER CODE: V06725		
			SPECIFICATION NUMBER: BACB30MY8K7		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 2
 APR 22/08

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
95	HL79-6		.. COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M6 OPTIONAL PART: HL79-6 V73197 HL79-6 V92215 66014-6 V56878 HL79-6 V56878		10
100	HL79-8		.. COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M8 OPTIONAL PART: HL79-8 V73197 HL79-8 V92215 66014-8 V56878 HL79-8 V56878 -----*-----		4
105	113T1347-30		.. BUSHING-		1
105	113T1347-117		.. BUSHING-		1
110	113T1347-32		.. BUSHING-		1
110	113T1347-118		.. BUSHING-		1
112	113T1347-31		.. BUSHING-		1
112	113T1347-119		.. BUSHING-		1
114	113T1347-35		.. BUSHING-		1
114	113T1347-120		.. BUSHING-		1
115	113T1347-62		.. SPACER		4
120	113T1347-63		.. SPACER		4
125	113T1345-89		.. RIB ASSY-HALF POSITION DATA: LH SIDE USED ON: 113T1345-85		1
- 130	113T1345-90		.. RIB ASSY-HALF POSITION DATA: RH SIDE USED ON: 113T1345-86 ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE		1

— ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 3
 APR 22/08

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
135	MS15001-1	...	FITTING		2
140	L8008K4	...	BOLT		43
			SUPPLIER CODE: V06725		
			SPECIFICATION NUMBER: BACB30MY8K4		
143	L8008K4	...	BOLT		2
			SUPPLIER CODE: V06725		
			SPECIFICATION NUMBER: BACB30MY8K4		
148	L8008K5	...	BOLT		4
			SUPPLIER CODE: V06725		
			SPECIFICATION NUMBER: BACB30MY8K5		
150	HL1012AZ12-8	...	BOLT		6
			SUPPLIER CODE: VOPTK6		
			SPECIFICATION NUMBER: BACB30NX12K8		
			OPTIONAL PART: HL12VAZ12-8		
			V73197		
			HL12VAZ12-8		
			V92215		
			HL12VAZ12-8		
			V97928		
			L802-12K8		
			V06725		
			HL12VAZ12-8		
			V56878		
			HL1012AZ12-8		
			V06725		
			HL1012AZ12-8		
			V06950		
			HL1012AZ12-8		
			V17446		
			HL1012AZ12-8		
			V56878		
			HL1012AZ12-8		
			V60516		
			HL1012AZ12-8		
			V73197		
			HL1012AZ12-8		
			V97928		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 4
 APR 22/08



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
155	HL79-8		... COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M8 OPTIONAL PART: HL79-8 V73197 HL79-8 V92215 66014-8 V56878 HL79-8 V56878		45
157	HL79-8		... COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M8 OPTIONAL PART: HL79-8 V73197 HL79-8 V92215 66014-8 V56878 HL79-8 V56878		2
160	HL1187-12		... COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30X12 OPTIONAL PART: HL1187-12 V73197 HL1187-12 V56878 HL1187-12 V92215		6
165	BACW10BP4P		... WASHER		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
FIG. 01
PAGE 5
AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 166	BRH10A4	...	NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653		2
175	113T1324-21	...	RIB- OPTIONAL PART: 113T1324-29 USED ON: 113T1345-89		1
175	113T1324-29	...	RIB- OPTIONAL PART: 113T1324-21 USED ON: 113T1345-60 113T1345-89		1
- 180	113T1324-22	...	RIB- OPTIONAL PART: 113T1324-30 USED ON: 113T1345-90		1
- 180	113T1324-30	...	RIB- OPTIONAL PART: 113T1324-22 USED ON: 113T1345-61 113T1345-90		1
185	113T1324-23	...	RIB- USED ON: 113T1345-89		1
- 190	113T1324-24	...	RIB- USED ON: 113T1345-90		1
195	113T1345-87	..	RIB ASSY-HALF USED ON: 113T1345-85		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 6
 DEC 22/06

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 200	113T1345-88		..RIB ASSY-HALF USED ON: 113T1345-86		1
205	MS15001-1		...FITTING		2
210	L8008K4		...BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY8K4		42
215	L8008K5		...BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY8K5		4
220	HL1012AZ12-8		...BOLT SUPPLIER CODE: VOPTK6 SPECIFICATION NUMBER: BACB30NX12K8 OPTIONAL PART: HL12VAZ12-8 V73197 HL12VAZ12-8 V92215 HL12VAZ12-8 V97928 L802-12K8 V06725 HL12VAZ12-8 V56878 HL1012AZ12-8 V06725 HL1012AZ12-8 V06950 HL1012AZ12-8 V17446 HL1012AZ12-8 V56878 HL1012AZ12-8 V60516 HL1012AZ12-8 V73197 HL1012AZ12-8 V97928		5
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 7
 APR 22/08

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
225	HL79-8		...COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M8 OPTIONAL PART: HL79-8 V73197 HL79-8 V92215 66014-8 V56878 HL79-8 V56878		44
230	HL1187-12		...COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30X12 OPTIONAL PART: HL1187-12 V73197 HL1187-12 V56878 HL1187-12 V92215		5
235	BACW10BP4P		...WASHER		2
240	BRH10A4		...NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653		2
250	113T1324-27		...RIB- USED ON: 113T1345-87		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 8
 AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 255	113T1324-28	...	RIB- USED ON: 113T1345-88		1
260	113T1324-25	...	RIB- OPTIONAL PART: 113T1324-31 USED ON: 113T1345-87		1
260	113T1324-31	...	RIB- OPTIONAL PART: 113T1324-25 USED ON: 113T1345-25 113T1345-87		1
- 265	113T1324-26	...	RIB- OPTIONAL PART: 113T1324-32 USED ON: 113T1345-88		1
- 265	113T1324-32	...	RIB- OPTIONAL PART: 113T1324-26 USED ON: 113T1345-26 113T1345-88		1
270	113T1347-31	..	BUSHING-		1
270	113T1347-119	..	BUSHING-		1
275	113T1347-35	..	BUSHING-		1
275	113T1347-120	..	BUSHING-		1
280	113T1312-5	..	BUSHING		2
282	113T1347-32	..	BUSHING-		1
282	113T1347-118	..	BUSHING-		1
284	113T1347-30	..	BUSHING-		1
284	113T1347-117	..	BUSHING-		1
285	113T3000-53	..	ARM INSTL-DRIVE POSITION DATA: LH SIDE VARIABLE DRAWING REF: 113T3000-5041 FOR DETAILS SEE: 27-51-20-01		1
- 290	113T3000-54	..	ARM INSTL-DRIVE POSITION DATA: RH SIDE VARIABLE DRAWING REF: 113T3000-5042 FOR DETAILS SEE: 27-51-20-01		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 9
 AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
400	113T1345-99		.RIB ASSY- POSITION DATA: STA 798.2 LH SIDE		1
- 405	113T1345-100		.RIB ASSY- POSITION DATA: STA 798.2 RH SIDE		1
410	113T1345-7		..SKIN ATTACHING PARTS		1
415	L8006K5		..BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY6K5		6
420	L8008K6		..BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY8K6		4
425	HL79-6		..COLLAR- SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M6 OPTIONAL PART: HL79-6 V73197 HL79-6 V92215 66014-6 V56878 HL79-6 V56878		6
430	HL79-8		..COLLAR- SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M8 OPTIONAL PART: HL79-8 V73197 HL79-8 V92215 66014-8 V56878 HL79-8 V56878 -----*-----		4
435	113T1347-21		..BUSHING-		2
440	113T1347-23		..BUSHING-		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 10
 AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
440	113T1347-115		..BUSHING-		1
442	113T1347-22		..BUSHING-		1
442	113T1347-114		..BUSHING-		1
445	113T1347-60		..SPACER		4
450	113T1347-61		..SPACER		4
455	113T1345-19		..RIB ASSY-HALF		1
			USED ON:		
			113T1345-55		
			USED ON:		
			113T1345-43		
			113T1345-51		
455	113T1345-101		..RIB ASSY-HALF		1
			USED ON:		
			113T1345-99		
- 460	113T1345-65		..RIB ASSY-HALF		1
			USED ON:		
			113T1345-64		
- 460	113T1345-102		..RIB ASSY-HALF		1
			USED ON:		
			113T1345-100		
465	MS15001-1		...FITTING		2
470	L8008K4		...BOLT		13
			SUPPLIER CODE:		
			V06725		
			SPECIFICATION NUMBER:		
			BACB30MY8K4		
474	L8008K4		...BOLT-		2
			SUPPLIER CODE:		
			V06725		
			SPECIFICATION NUMBER:		
			BACB30MY8K4		
			USED ON:		
			113T1345-102		
475	L8008K5		...BOLT		7
			SUPPLIER CODE:		
			V06725		
			SPECIFICATION NUMBER:		
			BACB30MY8K5		
477	L8008K5		...BOLT-		2
			SUPPLIER CODE:		
			V06725		
			SPECIFICATION NUMBER:		
			BACB30MY8K5		
			USED ON:		
			113T1345-19		
			113T1345-35		
			113T1345-101		
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 11
 AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
480	L8008K7	...	BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY8K7		5
485	HL1012AZ12-8	...	BOLT SUPPLIER CODE: VOPTK6 SPECIFICATION NUMBER: BACB30NX12K8 OPTIONAL PART: HL12VAZ12-8 V73197 HL12VAZ12-8 V92215 HL12VAZ12-8 V97928 L802-12K8 V06725 HL12VAZ12-8 V56878 HL1012AZ12-8 V06725 HL1012AZ12-8 V06950 HL1012AZ12-8 V17446 HL1012AZ12-8 V56878 HL1012AZ12-8 V60516 HL1012AZ12-8 V73197 HL1012AZ12-8 V97928		3
490	HL79-8	...	COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M8 OPTIONAL PART: HL79-8 V73197 HL79-8 V92215 66014-8 V56878 HL79-8 V56878		27
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 12
 AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
R R R R R R R R R R	1 495	HL1187-12 ...COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30X12 OPTIONAL PART: HL1187-12 V73197 HL1187-12 V56878 HL1187-12 V92215		3
	500	BACW10BP4P		2
	501	BRH10A4 ...WASHER ...NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653		2
	502	287T0020-563		1
	504	VNS1924CA2-8 ...BRACKET ASSYSTUD-GND SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACS53B1EA2 OPTIONAL PART: VNS1924CA3-2-8 V92215 287T0020-640		1
	504A	287T0020-640STUD ASSY- OPTIONAL PART: BACS53B1EA2		1
	505	NAS1801-3-12SCREW- OPTIONAL PART: BACS12HN3-12		1

ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE

— ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
FIG. 01
PAGE 13
AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
505	BACS12HN3-12		SCREW- OPTIONAL PART: NAS1801-3-12		1
506	NAS1149D0316H		WASHER-		2
507	BACW10EC3S		WASHER-		1
508	MS35650-305T		NUT		1
509	287T0020-488		ANGLE		1
510	113T1323-1	...RIB-	OPTIONAL PART: 113T1323-29 USED ON: 113T1345-19 113T1345-101		1
510	113T1323-29	...RIB-	OPTIONAL PART: 113T1323-1 USED ON: 113T1345-19 113T1345-101		1
- 515	113T1323-2	...RIB-	OPTIONAL PART: 113T1323-30 USED ON: 113T1345-20 113T1345-65 113T1345-102		1
- 515	113T1323-30	...RIB-	OPTIONAL PART: 113T1323-2 USED ON: 113T1345-20 113T1345-65 113T1345-102		1
520	113T1323-25	...RIB-	USED ON: 113T1345-101		1
- 525	113T1323-26	...RIB-	USED ON: 113T1345-102		1
530	113T1345-53	..RIB ASSY-HALF	USED ON: 113T1345-55 USED ON: 113T1345-51		1
530	113T1345-103	..RIB ASSY-HALF	USED ON: 113T1345-99		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 14
 AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 535	113T1345-54		..RIB ASSY-HALF USED ON: 113T1345-56 113T1345-64 USED ON: 113T1345-52		1
- 535	113T1345-104		..RIB ASSY-HALF USED ON: 113T1345-100		1
540	MS15001-1		...FITTING		2
545	L8008K4		...BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY8K4		11
550	L8008K5		...BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY8K5		5
555	L8008K7		...BOLT SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY8K7		5
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 15
 AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1 560	HL1012AZ12-8	...	BOLT SUPPLIER CODE: VOPTK6 SPECIFICATION NUMBER: BACB30NX12K8 OPTIONAL PART: HL12VAZ12-8 V73197 HL12VAZ12-8 V92215 HL12VAZ12-8 V97928 L802-12K8 V06725 HL12VAZ12-8 V56878 HL1012AZ12-8 V06725 HL1012AZ12-8 V06950 HL1012AZ12-8 V17446 HL1012AZ12-8 V56878 HL1012AZ12-8 V60516 HL1012AZ12-8 V73197 HL1012AZ12-8 V97928		2
565	HL79-8	...	COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M8 OPTIONAL PART: HL79-8 V73197 HL79-8 V92215 66014-8 V56878 HL79-8 V56878		19
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
 FIG. 01
 PAGE 16
 AUG 22/09



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1	HL1187-12	...COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30X12 OPTIONAL PART: HL1187-12 V73197 HL1187-12 V56878 HL1187-12 V92215		2
575	BACW10BP4P	...WASHER		2
580	BRH10A4	...NUT SUPPLIER CODE: V52828 SPECIFICATION NUMBER: BACN10JC4 OPTIONAL PART: T6S428J V11815 96-048 V80539 VN303A048 V92215 RMLH9075-4W V72962 NS202101-048 V80539 H10-4BAC V15653		2
585	113T1323-7	...RIB- OPTIONAL PART: 113T1323-35 USED ON: 113T1345-21 113T1345-53 113T1345-103		1
585	113T1323-35	...RIB- OPTIONAL PART: 113T1323-7 USED ON: 113T1345-21 113T1345-53 113T1345-103		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
FIG. 01
PAGE 17
AUG 22/09



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 590	113T1323-8	...	RIB- OPTIONAL PART: 113T1323-36 USED ON: 113T1345-22 113T1345-54 113T1345-104		1
- 590	113T1323-36	...	RIB- OPTIONAL PART: 113T1323-8 USED ON: 113T1345-22 113T1345-54 113T1345-104		1
595	113T1323-27	...	RIB- USED ON: 113T1345-103		1
- 600	113T1323-28	...	RIB- USED ON: 113T1345-104		1
605	113T1347-22	..	BUSHING-		1
605	113T1347-114	..	BUSHING-		1
610	113T1347-24	..	BUSHING-		2
610	113T1347-116	..	BUSHING-		2
615	113T1312-5	..	BUSHING		2
617	113T1347-23	..	BUSHING-		1
617	113T1347-115	..	BUSHING-		1
620	113T3000-51	..	ARM INSTL-DRIVE POSITION DATA: LH SIDE VARIABLE DRAWING REF: 113T3000-5039 FOR DETAILS SEE: 27-51-20-01		1
- 625	113T3000-52	..	ARM INSTL-DRIVE POSITION DATA: RH SIDE VARIABLE DRAWING REF: 113T3000-5040 FOR DETAILS SEE: 27-51-20-01		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED


HXL

57-52-01-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-01
FIG. 01
PAGE 18
AUG 22/09

BOEING
767
PARTS CATALOG (MAINTENANCE)

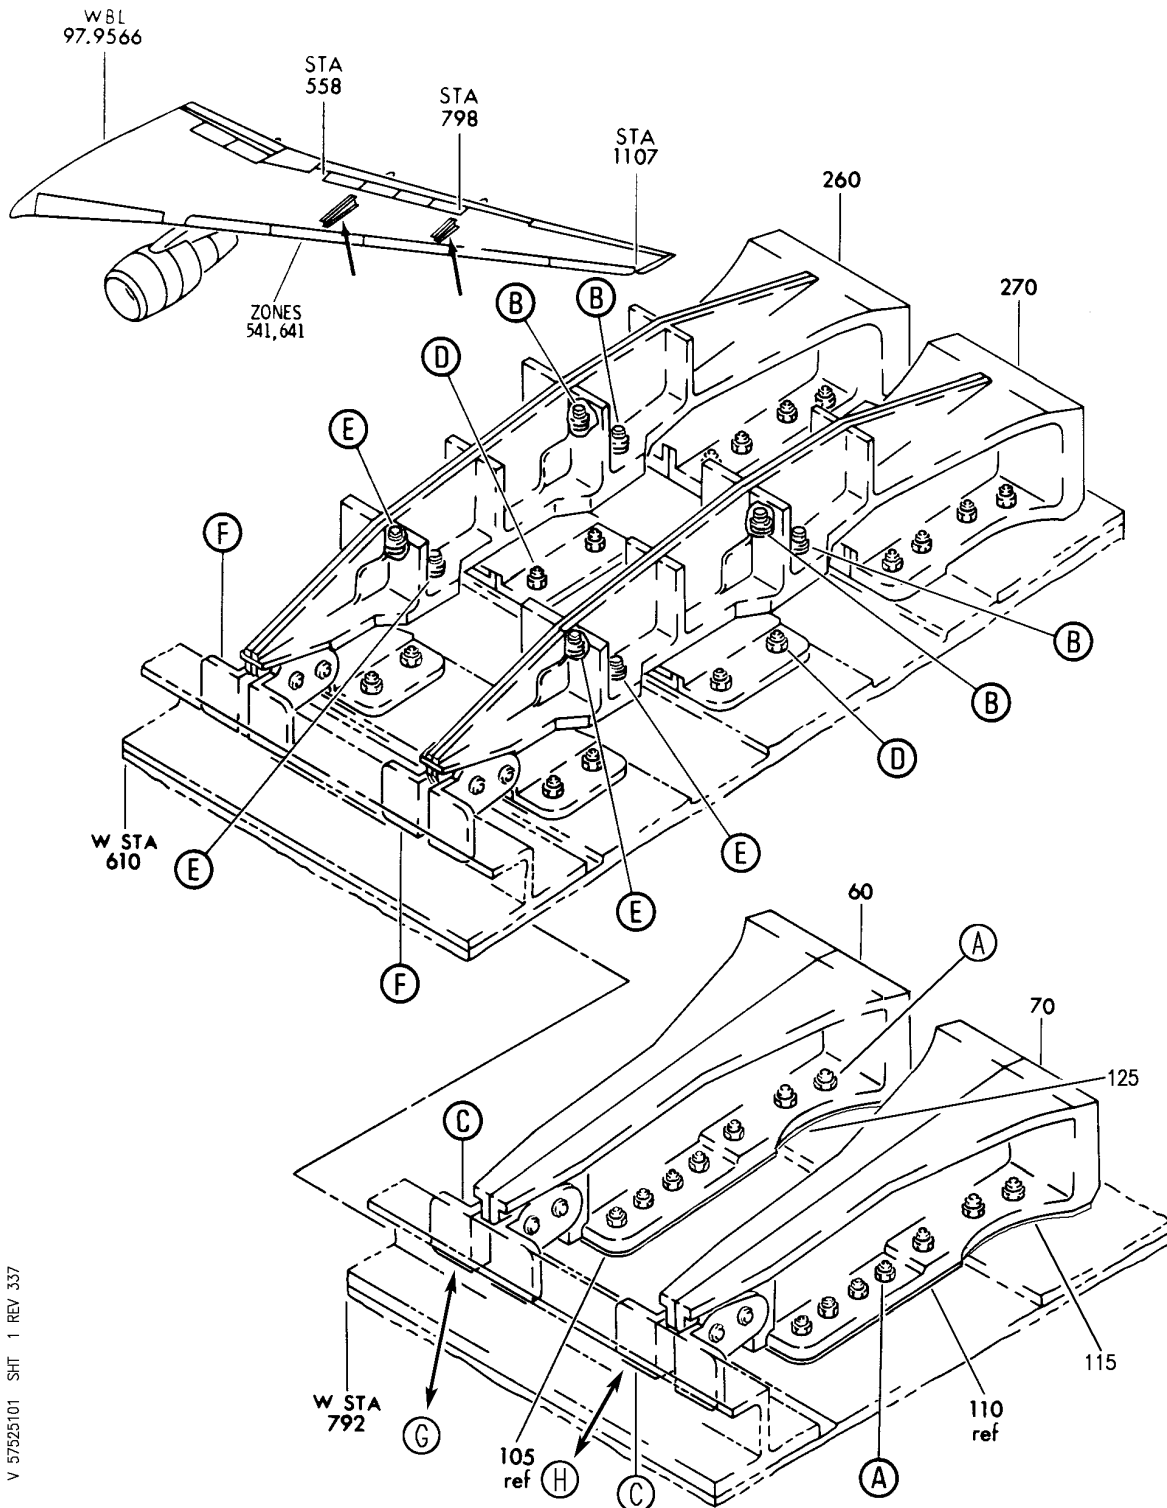

V 57525101 SHT 1 REV 337


FITTING INSTL-WING STA 798.2 AND 616.2 ACTR BACKUP
FIGURE 1 (SHEET 1)

57-52-51-01

HXL
APR 22/09

57-52-51-01
PAGE 0

BOEING
767
PARTS CATALOG (MAINTENANCE)

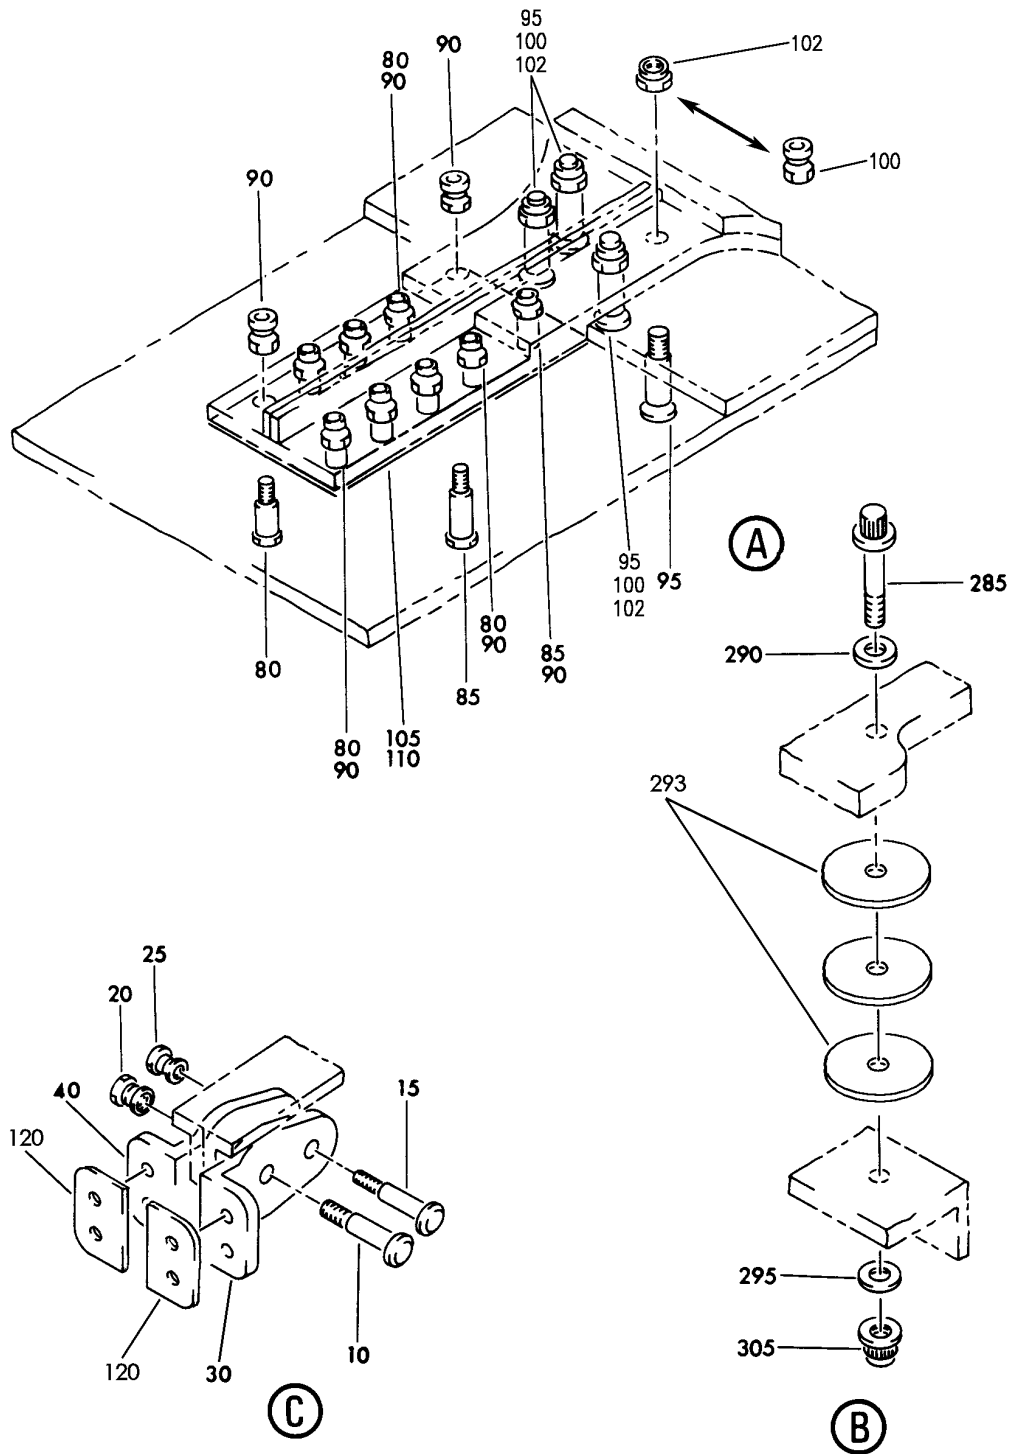

V 57525101 SHT 2 REV 276

FITTING INSTL-WING STA 798.2 AND 616.2 ACTR BACKUP
FIGURE 1 (SHEET 2)


57-52-51-01

HXL
DEC 22/06

57-52-51-01
PAGE 0A

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
767
PARTS CATALOG (MAINTENANCE)

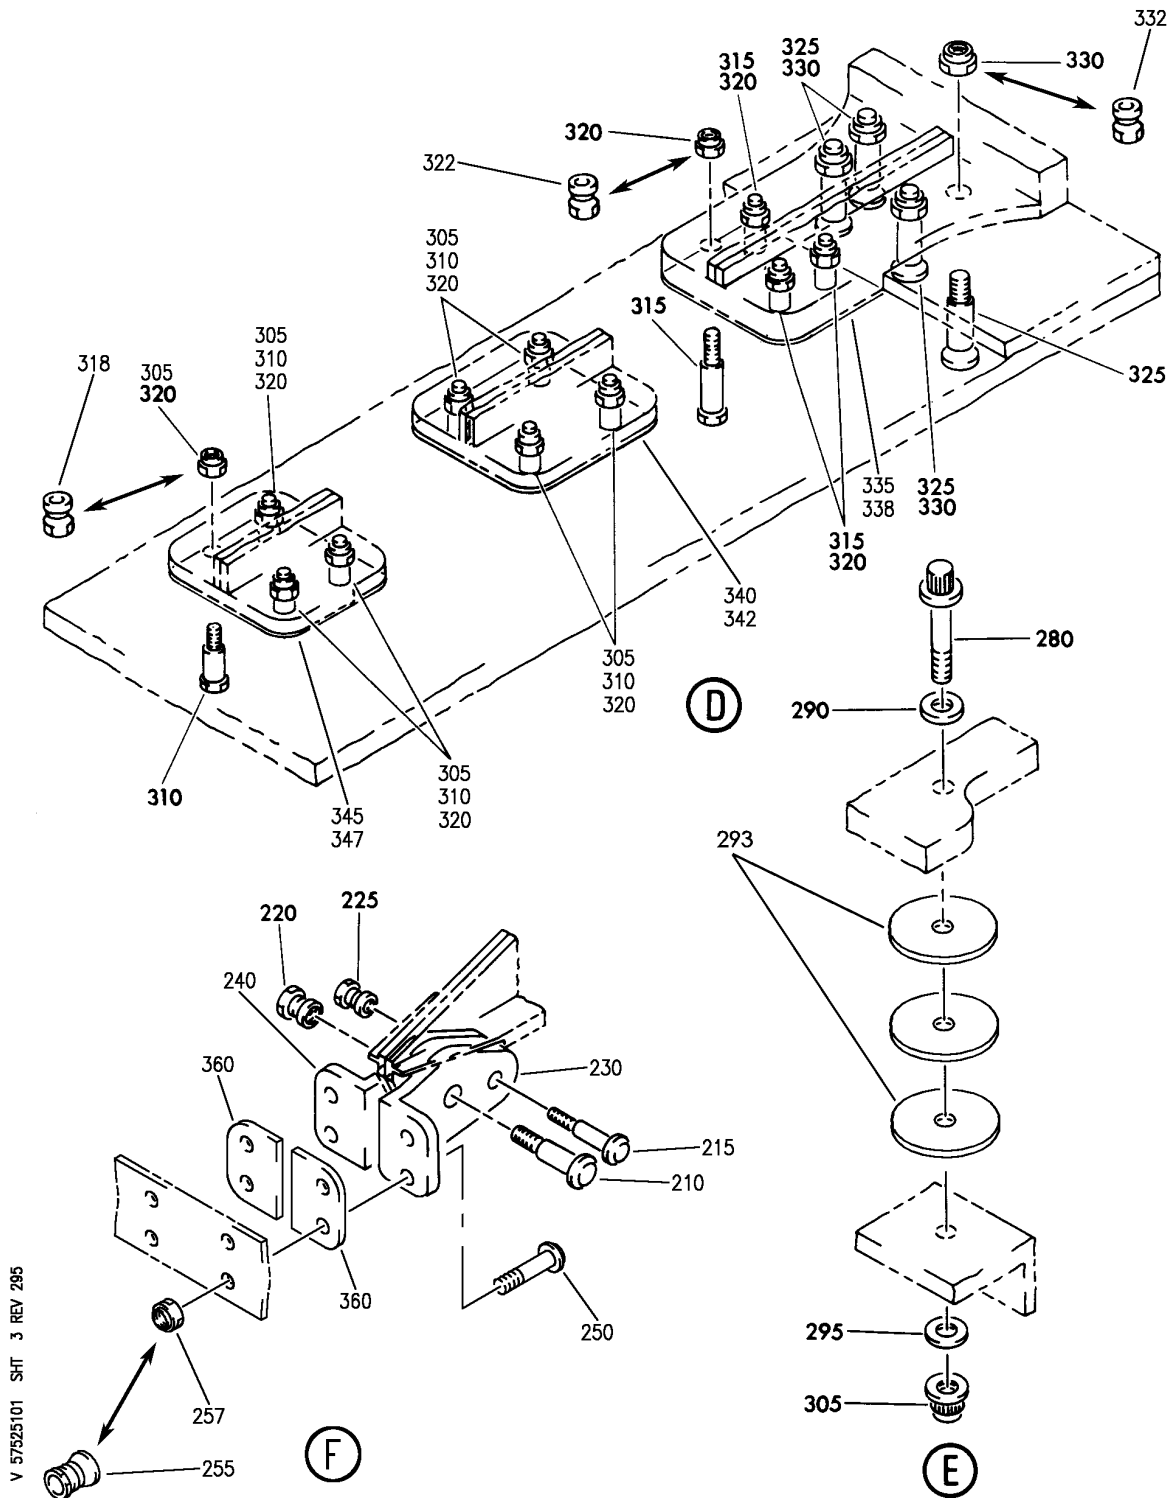

V 57525101 SHT 3 REV 295



FITTING INSTL-WING STA 798.2 AND 616.2 ACTR BACKUP
FIGURE 1 (SHEET 3)

57-52-51-01

HXL
DEC 22/06

57-52-51-01
PAGE 0B

BOEING
767
PARTS CATALOG (MAINTENANCE)

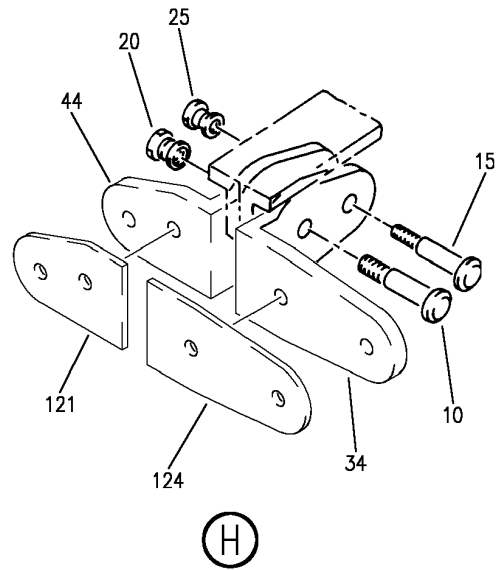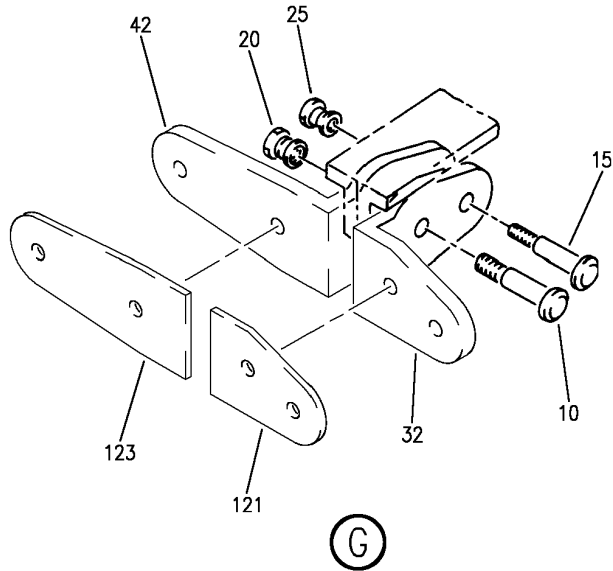

V 57525101 SHIT 4 REV 337

FITTING INSTL-WING STA 798.2 AND 616.2 ACTR BACKUP
FIGURE 1 (SHEET 4)

57-52-51-01

HXL
APR 22/09

57-52-51-01
PAGE 0C

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1			FITTING INSTL-WING STA 798.2 AND 616.2 ACTR BACKUP		
- 1	112T5121-1		FITTING INSTL-WING ACTR BACKUP POSITION DATA: STA 798.2 LH FOR NHA SEE: 57-11-53-04		RF
- 5	112T5121-2		FITTING INSTL-WING ACTR BACKUP POSITION DATA: STA 798.2 RH FOR NHA SEE: 57-11-53-04		RF
10	L80014K18		.BOLT- SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY14K18		2
15	L80010K18		.BOLT- SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY10K18		2
20	HL79-14		.COLLAR- SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M14 OPTIONAL PART: HL79-14 V73197 HL79-14 V92215 66014-14 V56878 HL79-14 V56878		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-51
FIG. 01
PAGE 1
APR 22/08

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
25	HL79-10		.COLLAR- SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M10 OPTIONAL PART: HL79-10 V73197 HL79-10 V92215 66014-10 V56878 HL79-10 V56878		2
30	112T5121-3		.CLIP- POSITION DATA: LH SIDE		2
- 35	112T5121-4		.CLIP- POSITION DATA: RH SIDE		2
40	112T5121-5		.CLIP- POSITION DATA: LH SIDE		2
- 45	112T5121-6		.CLIP- POSITION DATA: RH SIDE		2
- 50	H8008K10		ATTACHING PARTS .BOLT- SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY8K10		8
- 55	HL79-8		.COLLAR- SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M8 OPTIONAL PART: HL79-8 V73197 HL79-8 V92215 66014-8 V56878 HL79-8 V56878 -----*-----		8
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-51
FIG. 01
PAGE 2
APR 22/08



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
60	112T5245-1		.FITTING ASSY- POSITION DATA: WING STA 794.70 LH SIDE		1
- 65	112T5245-2		.FITTING ASSY- POSITION DATA: WING STA 794.70 RH SIDE		1
70	112T5246-1		.FITTING ASSY- POSITION DATA: WING STA 801.70 LH SIDE		1
- 75	112T5246-2		.FITTING ASSY- POSITION DATA: WING STA 801.70 RH SIDE		1
80	HL13VAZ12-11		ATTACHING PARTS .BOLT- SUPPLIER CODE: V56878 SPECIFICATION NUMBER: BACB30NY12K11 OPTIONAL PART: HL13VAZ12-11 V73197 HL13VAZ12-11 V92215 HL13VAZ12-11 V97928 L801-12K11 V06725 L801-12K11 VOPTK6 HL13VAZ12-11 V60516 HL13VAZ12-11 V17446		16
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-51
FIG. 01
PAGE 3
APR 22/08



767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
85	HL13VAZ12-15		.BOLT- SUPPLIER CODE: V56878 SPECIFICATION NUMBER: BACB30NY12K15 OPTIONAL PART: HL13VAZ12-15 V73197 HL13VAZ12-15 V92215 HL13VAZ12-15 V97928 L801-12K15 V06725 HL13VAZ12-15 V60516 HL13VAZ12-15 V17446 L801-12K15 VOPTK6		4
90	HL1187-12		.COLLAR- SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30X12 OPTIONAL PART: HL1187-12 V73197 HL1187-12 V56878 HL1187-12 V92215		20
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-52-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-51
FIG. 01
PAGE 4
AUG 22/09

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
95	HL11VAZ12-15	.BOLT- SUPPLIER CODE: V60516 SPECIFICATION NUMBER: BACB30NW12K15 OPTIONAL PART: B30NW12K15 V97928 HL11VAZ12-15 V73197 HL11VAZ12-15 V92215 HL11VAZ12-15 V97928 L803-12K15 V06725 HL11VAZ12-15 V0PTK6 HL11VAZ12-15 V56878		8
100	TLN12046	.NUT- SUPPLIER CODE: V97928 SPECIFICATION NUMBER: BACN10WM6 OPTIONAL PART: LH10114B6 V72962 MN156 V73197 VN18616 V92215 H49702-6S V15653 W8506 V08524 H497026 V15653 -----*-----		8
105	112T5121-7	.SHIM-		1
110	112T5121-11	.SHIM-		1
- 200	112T5122-11	FITTING INSTL-WING ACTR BACKUP POSITION DATA: STA 616.2 LH FOR NHA SEE: 57-11-53-02		RF
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

HXL

57-52-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-51
 FIG. 01
 PAGE 5
 APR 22/08



767

PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 205	112T5122-12		FITTING INSTL-WING ACTR BACKUP POSITION DATA: STA 616.2 RH FOR NHA SEE: 57-11-53-02		R F
210	L80014K18		.BOLT- SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY14K18		2
215	L80010K13		.BOLT- SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY10K13		2
220	HL79-14		.COLLAR SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M14 OPTIONAL PART: HL79-14 V73197 HL79-14 V92215 66014-14 V56878 HL79-14 V56878		2
225	HL79-10		.COLLAR- SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M10 OPTIONAL PART: HL79-10 V73197 HL79-10 V92215 66014-10 V56878 HL79-10 V56878		2
230	112T5122-3		.CLIP- POSITION DATA: LH SIDE		2
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

- ITEM NOT ILLUSTRATED

HXL

57-52-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-51
FIG. 01
PAGE 6
APR 22/08

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
- 235	112T5122-4	.CLIP-	POSITION DATA: RH SIDE		2
240	112T5122-5	.CLIP-	POSITION DATA: LH SIDE		2
- 245	112T5122-6	.CLIP-	POSITION DATA: RH SIDE		2
250	L8008K9	.BOLT-	SUPPLIER CODE: V06725 SPECIFICATION NUMBER: BACB30MY8K9		8
255	HL79-8	.COLLAR-	SUPPLIER CODE: V5M902 SPECIFICATION NUMBER: BACC30M8 OPTIONAL PART: HL79-8 V73197 HL79-8 V92215 66014-8 V56878 HL79-8 V56878 -----*-----		8
260	112T5241-5	.FITTING ASSY-	POSITION DATA: WING STA 612.70 LH SIDE		1
- 265	112T5241-6	.FITTING ASSY-	POSITION DATA: WING STA 612.70 RH SIDE		1
270	112T5242-5	.FITTING ASSY-	POSITION DATA: WING STA 619.70 LH SIDE		1
- 275	112T5242-6	.FITTING ASSY-	POSITION DATA: WING STA 619.70 RH SIDE ATTACHING PARTS		1
280	BACB30MR4K15	.BOLT-			4
285	BACB30MR4K23	.BOLT-			4
290	BACW10BN4AC	.WASHER-			8
295	AN960PD416L	.WASHER-			8
305	NAS1805-6	.NUT-			8
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-52-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-51
 FIG. 01
 PAGE 7
 APR 22/08

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
310	HL13VAZ12-12		.BOLT- SUPPLIER CODE: V56878 SPECIFICATION NUMBER: BACB30NY12K12 OPTIONAL PART: HL13VAZ12-12 V73197 HL13VAZ12-12 V92215 HL13VAZ12-12 V97928 L801-12K12 V06725 HL13VAZ12-12 V60516 HL13VAZ12-12 V17446 L801-12K12 VOPTK6		16
315	HL13VAZ12-16		.BOLT- SUPPLIER CODE: V56878 SPECIFICATION NUMBER: BACB30NY12K16 OPTIONAL PART: HL13VAZ12-16 V73197 HL13VAZ12-16 V92215 HL13VAZ12-16 V97928 L801-12K16 V06725 HL13VAZ12-16 V60516 HL13VAZ12-16 V17446 L801-12K16 VOPTK6		8
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL

57-52-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-51
 FIG. 01
 PAGE 8
 APR 22/08

BOEING
 767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7 NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1				
320	TLN12046	.NUT SUPPLIER CODE: V97928 SPECIFICATION NUMBER: BACN10WM6 OPTIONAL PART: LH10114B6 V72962 MN156 V73197 VN18616 V92215 H49702-6S V15653 W8506 V08524 H497026 V15653		24
325	HL11VAZ12-16	.BOLT- SUPPLIER CODE: V60516 SPECIFICATION NUMBER: BACB30NW12K16 OPTIONAL PART: B30NW12K16 V97928 HL11VAZ12-16 V73197 HL11VAZ12-16 V92215 HL11VAZ12-16 V97928 L803-12K16 V06725 HL11VAZ12-16 VOPTK6 HL11VAZ12-16 V56878		8
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE				

— ITEM NOT ILLUSTRATED

HXL

57-52-51-01

BOEING PROPRIETARY - Copyright © - Unpublished Work - See title page for details.

57-52-51
 FIG. 01
 PAGE 9
 APR 22/08



767
PARTS CATALOG (MAINTENANCE)

FIG ITEM	PART NUMBER	1 2 3 4 5 6 7	NOMENCLATURE	EFFECT FROM TO	UNITS PER ASSY
1					
330	TLN12046		.NUT SUPPLIER CODE: V97928 SPECIFICATION NUMBER: BACN10WM6 OPTIONAL PART: LH10114B6 V72962 MN156 V73197 VN18616 V92215 H49702-6S V15653 W8506 V08524 H497026 V15653 -----*-----		8
335	112T5122-7		.SHIM-		1
340	112T5122-8		.SHIM-		1
345	112T5122-9		.SHIM-		1
ILLUSTRATION ITEMS NOT ON PARTS LIST ARE NOT APPLICABLE					

— ITEM NOT ILLUSTRATED

HXL