

## Modification Bulletin

**PAGE: 1/2** 


Model: Whale 3rd Roll Feeder Date			Date	e: 30-Nov-97	No: 01	
Modified Article: Side Plates			Prepared by: A. Sasaki			
From: QAC Field Information Dept.						
Reason for	☐ Parts catalog correction	☐ Vend	dor ch	ange 🔲 To n	neet standards	
Modification:	☐ To facilitate assembly	∑ To improve reliability ( )				
	☐ Part standardization	Other				

Old part number	New part number	Description	Qty	Int	Page	Index	Note
A6132551	A6132547	Right Side Plate	1	X/O	3	9	(*1)
A6132550	A6132546	Left Side Plate	1	X/O	3	10	(*1)

<sup>(\*1)</sup> These parts can be replaced individually but please replace both of them at the same time to make them more effective.

If a large pressure, like when a roll of paper is dropped, is applied to the front cover (Index 21) of the 3rd Roll Feeder when it is opened, the right and left side plates (Index 9 and 10) may become deformed. The guide plate (Index 3), which is in the paper path, is deformed towards the front side. This increases the width of the paper path. This may cause paper jams at the entrance of the cutter unit.

A support plate has been added to the right and left side plates to make them stronger by 10 kgf each (20 kgf for both sides combined).

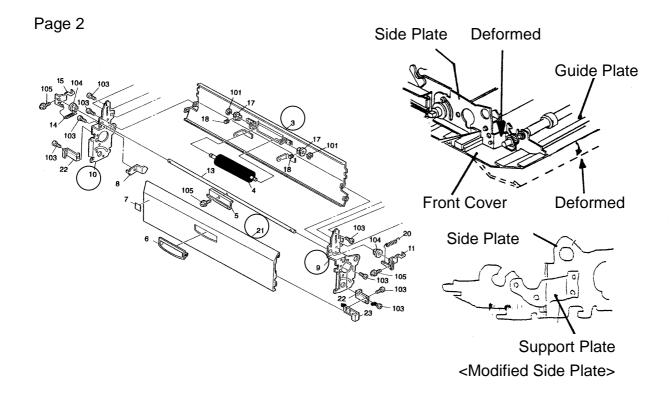



Model: Whale 3rd Roll Feeder

## Modification Bulletin

Date: 30-Nov-97 No: 01

**PAGE: 2/2** 

MODEL NAME	V/ Hz	DESTINATION	CODE	SERIAL NUMBER
3RD ROLL FEEDER TYPE A	115/ 60	USA, CANADA	A613 - 17	A7237050017
3RD ROLL FEEDER TYPE A	220, 230, 240/ 50	EUROPE, etc.	A613 - 27	A7237050001