

Debris examination - update No. 1

Missing aircraft, Boeing 777, 9M-MRO, 8 March 2014

Identification of two items of debris recovered from beaches in Mozambique

ATSB Technical Examination Report

Aviation

AE-2014-054
Debris examination update 1 – 19 April 2016 (amended 17 August 2017)

Released in accordance with section 25 of the Transport Safety Investigation Act 2003

Publishing information

Published by: Australian Transport Safety Bureau **Postal address:** PO Box 967, Civic Square ACT 2608

Office: 62 Northbourne Avenue Canberra, Australian Capital Territory 2601

Telephone: 1800 020 616, from overseas +61 2 6257 4150 (24 hours)

Accident and incident notification: 1800 011 034 (24 hours)

Facsimile: 02 6247 3117, from overseas +61 2 6247 3117

Email: atsbinfo@atsb.gov.au
Internet: www.atsb.gov.au

© Commonwealth of Australia 2016



Ownership of intellectual property rights in this publication

Unless otherwise noted, copyright (and any other intellectual property rights, if any) in this publication is owned by the Commonwealth of Australia.

Creative Commons licence

With the exception of the Coat of Arms, ATSB logo, and photos and graphics in which a third party holds copyright, this publication is licensed under a Creative Commons Attribution 3.0 Australia licence.

Creative Commons Attribution 3.0 Australia Licence is a standard form license agreement that allows you to copy, distribute, transmit and adapt this publication provided that you attribute the work.

The ATSB's preference is that you attribute this publication (and any material sourced from it) using the following wording: Source: Australian Transport Safety Bureau

Copyright in material obtained from other agencies, private individuals or organisations, belongs to those agencies, individuals or organisations. Where you want to use their material you will need to contact them directly.

Addendum

Addendam			
	Page	Change	Date
	3, 4, and 5	Corrected the operator's name.	17 August 2017

Missing aircraft, Boeing 777, 9M-MRO, 8 March 2014

Identification of two items of debris recovered in Mozambique

Introduction

On 27 December 2015 and 27 February 2016, two items of debris were independently found, approximately 220km apart, on the Mozambique coast. Both items were delivered to the relevant Civil Aviation Authorities in Mozambique and South Africa in early March 2016. Assistance from the Australian Transport Safety Bureau (ATSB) was requested by the Malaysian Government in the formal identification of the items to determine if they came from the Malaysia Airlines Boeing 777 aircraft, registered 9M-MRO, operating as MH370.

The parts were packaged in Mozambique and South Africa respectively and delivered safe-hand to the ATSB in their original packaging, in the custody of the ICAO Annex 13 Safety Investigation Team members.

The following is a brief summary of the outcomes from the debris examination. This debris examination summary is released with the concurrence of the Malaysian ICAO Annex 13 Safety Investigation Team for MH370.

Quarantine and marine ecology

On arrival into Australia, both parts were quarantined at the Geoscience Australia facility in Canberra. The parts were unwrapped and examined for the presence of marine ecology and remnants of biological material. Visible marine ecology was present on both parts and these items were removed and preserved. The parts were subsequently cleaned and released from quarantine.


Identification

Part No. 1

The first part was initially identified from a number stencilled on the part (676EB), as a segment from a Boeing 777 flap track fairing (Fairing No. 7) from the right wing (Figure 1). All measurable dimensions, materials, construction and other identifiable features conformed to the applicable Boeing drawings for the identified fairing.

The 676EB stencil font and colour was not original from manufacture, but instead conformed to that developed and used by Malaysia Airlines during painting operations (Figure 2). The part had been repainted, which was consistent with the operator's maintenance records for 9M-MRO.

Figure 1: Location of flap track fairing panel No. 676EB

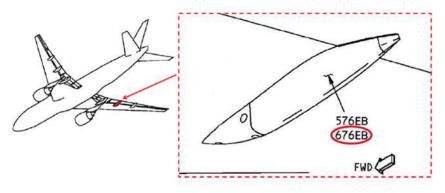

Source: Boeing 777 aircraft maintenance manual (modified by ATSB)

Figure 2: Flap fairing outer surface showing stencil location and comparison

Source: ATSB


Part No. 2

The second part was primarily identified from images showing the materials, construction and "NO STEP" stencil, as a segment of a Boeing 777 RH horizontal stabilizer panel (Figure 3). All measurable dimensions, materials, construction and other identifiable features conformed to the Boeing drawings for the stabiliser panel.

The part was marked on the upper surface in black paint with "NO STEP". The font and location of the stencil were not original from manufacture, however the stencilling was consistent with that developed and used by Malaysia Airlines (Figure 4).

A single fastener was retained in the part. The fastener head markings identified it as being correct for use on the stabiliser panel assembly. The markings also identified the fastener manufacturer. That manufacturer's fasteners were not used in current production, but did match the fasteners used in assembly of the aircraft next in the production line (405) to 9M-MRO (404) (Figure 4).

Figure 3: Location of horizontal stabiliser panel No. 3 upper

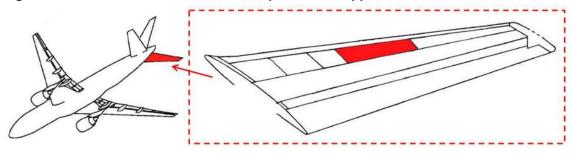

Source: Boeing 777 Parts Catalogue (modified by ATSB)

NO STEP Boeing stencil

NO STIEP

MAB stencil

Recovered part

Line No. 405

Figure 4: Stabiliser panel "NO STEP" stencil and fastener comparison

Source: ATSB, Boeing

Conclusions

At the time of writing, ongoing work was being conducted with respect to the marine ecology identification as well as testing of material samples. The results from these tests will be provided to the Malaysian investigation team once complete. Nevertheless, from the initial examination it was concluded that:

- Part No. 1 was a flap track fairing segment, almost certainly from the Malaysia Airlines Boeing 777 aircraft, registered 9M-MRO.
- Part No. 2 was a horizontal stabiliser panel segment, almost certainly from the Malaysia Airlines Boeing 777 aircraft, registered 9M-MRO.